



Durango, Colorado, Processing and Disposal Sites

FACT SHEET

This fact sheet provides information about the Uranium Mill Tailings Radiation Control Act of 1978 Title I processing and disposal sites located at Durango, Colorado. These sites are managed by the U.S. Department of Energy Office of Legacy Management.

Site Description and History

The Durango processing site is a former uranium-ore-processing facility located 0.25 mile southwest of the city of Durango, Colorado. The site consists of two geographically contiguous, but hydrogeologically separate, areas: the mill tailings area and the raffinate ponds area. Both areas are located on the west bank of the Animas River and are immediately southwest of the intersection of U.S. Highways 160 and 550. A narrow terrace above the Animas River connects the two areas.

The facility was constructed on the site of a former lead smelter that operated from 1880 to 1930. Vanadium Corporation of America constructed and operated the mill from 1942 to 1946 to produce vanadium. Between 1949 and 1963, the mill processed uranium ore for U.S. Government national defense programs. Milling operations produced about 1.2 million cubic yards of radioactive mill tailings, a predominantly sandy material. The tailings contaminated about 33 of the 40 acres of mill tailings area property. Raffinate liquids (the spent solution remaining after removal of uranium and vanadium by solvent extraction) contaminated about 20 acres of the raffinate ponds area. The City of Durango owns the former mill tailings area property, and the Animas-La Plata Water Conservancy District owns the former raffinate ponds area.

From 1986 to 1991, the U.S. Department of Energy (DOE) removed tailings and other tailings-contaminated materials from the Durango processing site and local contaminated properties (known as vicinity properties) and stabilized them in a disposal cell located 3.5 miles southwest of Durango. The disposal cell occupies about 42 acres of a 120-acre disposal site that was permanently transferred from the State of Colorado to DOE. Following removal of the tailings piles and contaminated soils, the former mill tailings and raffinate ponds areas were contoured and reseeded with native grasses.

Some residual contamination was left in place in two regions along the bank of the Animas River, in unreachable areas of windblown contamination on the




Locations of the Durango Processing and Disposal Sites

adjacent slope of Smelter Mountain and in soils of the raffinate ponds area.

Regulatory Setting

Congress passed the Uranium Mill Tailings Radiation Control Act (UMTRCA) in 1978 (Public Law 95-604) and DOE remediated 22 inactive uranium-ore processing sites under the Uranium Mill Tailings Remedial Action Project in accordance with standards promulgated by the U.S. Environmental Protection Agency in Title 40 *Code of Federal Regulations* (CFR) Part 192. Subpart B of 40 CFR 192 regulated cleanup of contaminated groundwater at the processing sites. The radioactive materials were encapsulated in U.S. Nuclear Regulatory Commission–approved disposal cells. The U.S. Nuclear Regulatory Commission general license for UMTRCA Title I sites is established in 10 CFR 40.27. The Durango disposal site was included under the general license in 1996.

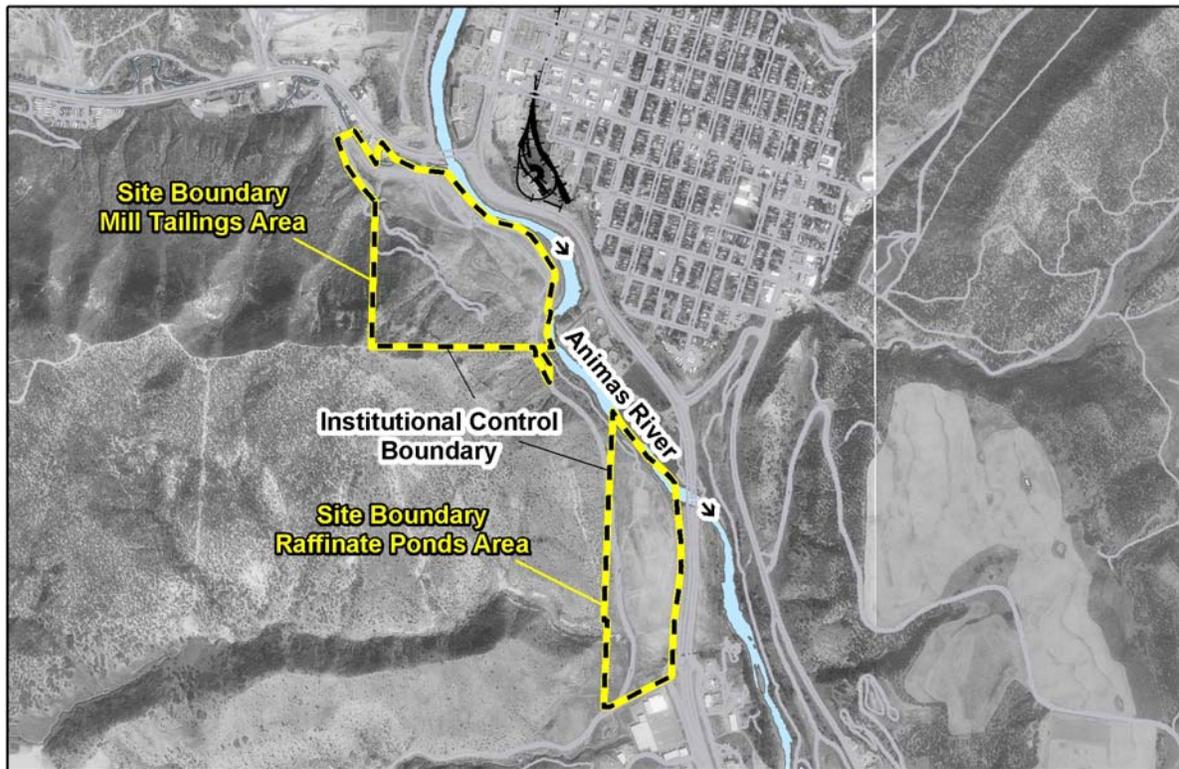

Institutional Control Boundaries at the Durango Sites

Processing Site

Alluvial groundwater beneath the mill tailings area is contaminated as a result of constituents leaching from the tailings piles. Cadmium, molybdenum, uranium, and selenium are the constituents of concern in the mill tailings area groundwater.

Groundwater flow at the raffinate ponds area is primarily through joints, faults, and fractures in bedrock formations in the area. The primary source of groundwater contamination in this area is raffinate liquid from the milling process that was pumped into a ditch, then flowed to the settling ponds, where it was disposed of through evaporation and downward seepage. Uranium and selenium are the only groundwater constituents with concentrations that have consistently exceeded EPA's maximum concentration limits since completion of surface remediation. Sample analytical results indicate that concentrations of all contaminants related to uranium-ore processing have decreased since completion of surface remediation in the raffinate ponds area and continue to show a decreasing trend. Elevated selenium concentrations are not mill related and derive from natural geologic sources in the area.


Compliance Strategy

DOE designed separate groundwater compliance strategies for the mill tailings area and the raffinate ponds area to better address the constituents of concern and groundwater modeling results.

The compliance strategy for the mill tailings area is natural flushing (i.e., natural groundwater movement

and geochemical processes that decrease contaminant concentrations through time) in conjunction with institutional controls and continued monitoring. Groundwater flow-and-transport modeling predicts that concentrations of all constituents except selenium will decrease to levels below their respective standards within 100 years, the maximum time allowed under 40 CFR 192. Evaluation of sample results from background wells has shown that elevated selenium concentrations are due to naturally occurring sources and are not related to uranium-ore processing. Although selenium concentrations are not predicted to decrease to the maximum concentration limit established in 40 CFR 192 (0.01 milligram per liter [mg/L]), modeling indicates that concentrations will decrease to levels below EPA's Safe Drinking Water Act standard (0.05 mg/L) within 60 years. Therefore, DOE has proposed using the Safe Drinking Water Act standard as the alternate concentration limit for selenium in groundwater at the mill tailings area.

At the raffinate ponds area, the compliance strategy is no further remediation in conjunction with application of supplemental standards, institutional controls, and continued monitoring. Supplemental standards are groundwater quality standards that may be applied instead of other, more stringent standards when at least one of eight criteria in 40 CFR 192.21 is met. The criterion that applies to bedrock groundwater at the raffinate ponds area is that of "limited use," that is, the groundwater is considered to have limited use and is not a current or potential source of drinking water because of "widespread, ambient contamination...that

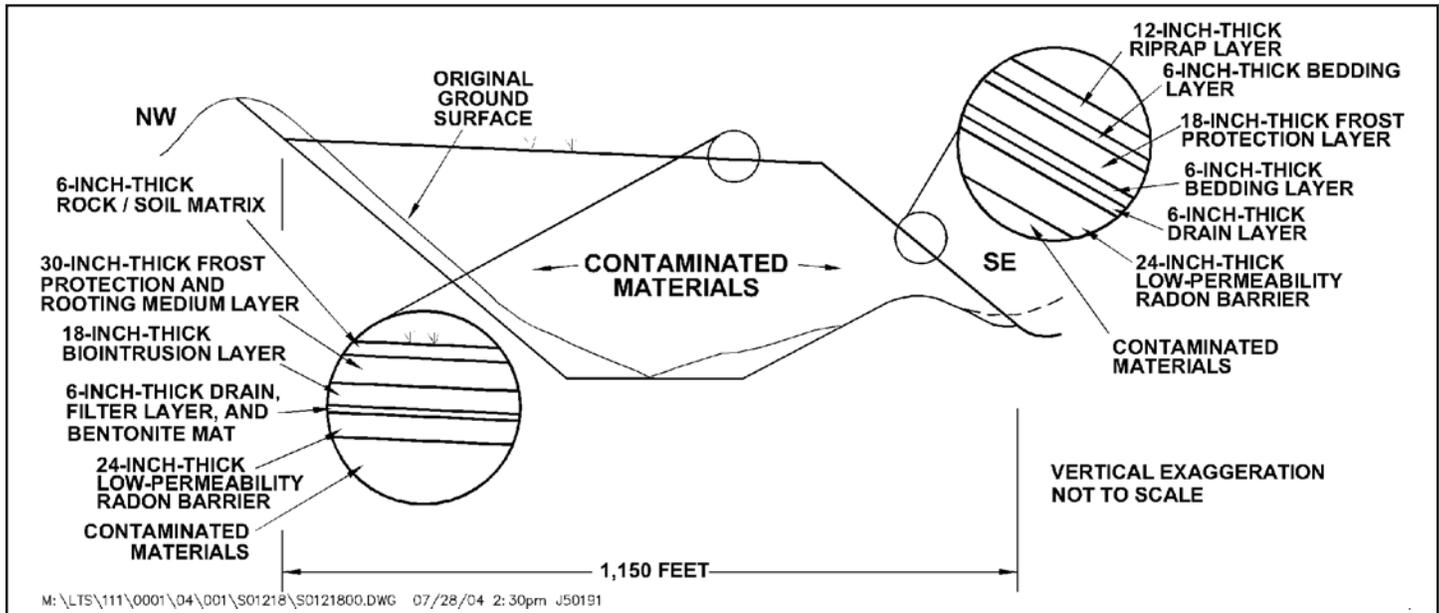

Northwest-Southeast Cross Section of the Durango Disposal Cell

cannot be cleaned up using treatment methods reasonably employed in public water systems.”

Institutional Controls

Institutional controls are safeguards that effectively protect human health and the environment and typically depend on some legal order, such as zoning ordinances and laws, to ensure that protection is effective. EPA standards permit the use of institutional controls at sites where natural flushing will decrease contaminant concentrations to acceptable levels within 100 years.

Institutional controls protect human health by preventing inappropriate intrusion into contaminated groundwater or by restricting access to or use of contaminated groundwater for unacceptable purposes, such as domestic-household use. Institutional controls will remain in place during the natural flushing period at the mill tailings area and in perpetuity at the raffinate ponds area.

Disposal Site

The disposal site is located near the north edge of the San Juan Basin, above the west end of Bodo Canyon. The uppermost aquifer beneath the site is in the Cliff House Sandstone of the Mesaverde Group. Groundwater in this aquifer is generally not suitable for domestic use because of relatively high levels of dissolved solids and the variable quality of the water.

The disposal cell contains about 2.5 million cubic yards of contaminated materials, including tailings, building debris from demolished mill structures, and material from contaminated vicinity properties. The total activity of the contaminated materials within the cell is estimated to be 1,400 curies of radium-226. The

perimeter of the disposal site is not fenced, but 82 warning signs define the site boundary.

Disposal Cell Design

The Durango disposal cell is irregularly shaped and measures approximately 2,400 feet on its long axis by 1,300 feet across, including a surrounding rock apron. The cell cover is a multicomponent system designed to encapsulate and isolate the contaminated materials. The cover consists of (1) a low-permeability radon barrier (first layer placed over compacted tailings), (2) a sand filter/drainage layer and a bentonite mat, (3) a layer of rock to prevent biointrusion, (4) a frost-protection/rooting-medium layer, and (5) a rock/soil matrix layer on the top and rock (riprap) on the side slopes to protect against wind and water erosion. The top of the disposal cell is planted with native grasses. Riprap is keyed into competent bedrock around the base of the cell to prevent headward erosion at the cell boundary.

The cell cover design promotes rapid runoff of precipitation to minimize leachate. Runoff from the top slope of the cell flows to a surrounding rock apron that carries water away from the apron. Native vegetation has been re-established in disturbed areas at the site.

Legacy Management Activities

DOE’s Office of Legacy Management (LM) is responsible for ensuring that the selected groundwater compliance strategy at the Durango processing site continues to be protective of human health and the environment. LM will also monitor the effectiveness of institutional controls and the progress of natural flushing.

LM manages the disposal site according to a site-specific Long-Term Surveillance Plan to ensure that the disposal cell systems continue to prevent release of contaminants to the environment. Under provisions of this plan, LM conducts annual inspections of the site to evaluate the condition of surface features, performs site maintenance as necessary, and monitors groundwater to verify the continued integrity of the disposal cell.

In accordance with 40 CFR 192.32, the disposal cell is designed to be effective for 1,000 years, to the extent reasonably achievable, and, in any case, for at least 200 years. However, the general license has no expiration date, and LM's responsibility for the safety and integrity of the Durango disposal site will last indefinitely.

Contacts

Site-specific documents related to the Durango processing and disposal sites are available on the LM website at <http://www.lm.doe.gov/Durango/Disposal/Sites.aspx> (disposal site), and <http://www.lm.doe.gov/Durango/Processing/Sites.aspx> (processing site).

For more information about LM activities at the Durango processing and disposal sites, contact

U.S. Department of Energy
Office of Legacy Management
2597 Legacy Way, Grand Junction, CO 81503

(970) 248-6070 (monitored continuously) or
(877) 695-5322 (toll-free)