

Rocky Flats Environmental Technology Site

95-ENG-WELD-0052

REVISION 0

RMRS WELDING PLAN

APPROVED BY Paul R Bengel / Paul Bengel / 10/9/95
Vice President, Engineering/ Construction/D&D Print Name Date

APPROVED BY ~~Juan Hernandez~~ / Juan Hernandez / 10 Oct 95
Manager, Quality Assurance Print Name Date

Responsible Organization Engineering/Construction/ D&D Effective Date 10/9/95

CONCURRENCE BY THE FOLLOWING DISCIPLINES WILL BE DOCUMENTED IN THE PROCEDURE HISTORY FILE

Engineering/Construction/D&D
Quality Assurance
Subject-matter Expert

SUPERSEDED

USE CATEGORY 4

The following have been incorporated in this revision
95-DMR-001193

Reviewed for Classification/UCNI
By [Signature] UNW
Date 10/9/95

11 00 W 10

TABLE OF CONTENTS

	<u>TITLE</u>	1
	<u>TABLE OF CONTENTS</u>	2
1	<u>SCOPE</u>	3
2	<u>DESIGN CONTROL</u>	3
3	<u>MATERIAL CONTROL</u>	4
4	<u>RMRS WELDING</u>	5
4 1	WELDING PROCEDURES, QUALIFICATION AND RECORDS	5
4 2	WELDING MATERIAL CONTROL	6
4 3	FABRICATIONS OR REPAIRS	7
5	<u>INSPECTION AND TESTING</u>	8
6	<u>NONCONFORMING ITEMS</u>	9
7	<u>SUBCONTRACTORS</u>	9
8	<u>SAFETY REQUIREMENTS</u>	9
9	<u>REFERENCES</u>	9

Appendices

Welding Procedure Specification RMRS-T1/1

Welding Procedure Specification RMRS-T8/8

1 SCOPE

- 1 1 This plan defines the requirements and responsibilities for Rocky Mountain Remediation Services (RMRS) to perform welding at RFETS in accordance with the American Society of Mechanical Engineers (ASME) Code for Pressure Piping, B31 Series, and American Welding Society (AWS) Structural Welding Codes, D1 1, D1 2, and D1 3, hereinafter referred to as the Code
- 1 2 RMRS will not manufacture, alter or repair ASME Code stamped pressure vessels. All welding on coded vessels will be performed by Kaiser-Hill or approved subcontractors with the required ASME or National Board Stamp
- 1 3 This plan is applicable and mandatory to each component, part or subassembly manufactured, altered or repaired by RMRS
- 1 4 Procedures and practices not specifically addressed in this plan will be in accordance with RMRS policies and procedures

2 DESIGN CONTROL

- 2 1 To ensure proper identification, each drawing, calculation sheet, specification and supporting document prepared for welding components, parts and appurtenances shall be identified with a specific project title and project number
- 2 2 Design calculations shall be prepared by the Design Engineer for Code fabrication or repair project as required. Calculations shall comply with the requirements of the applicable sections of the Code and the RFETS Conduct of Engineering Manual (COEM)
- 2 3 Design specifications shall be prepared by the Design Engineer as required for Code projects per the COEM. They shall include a detailed description of the fabrication or repair, and may include but not limited to (1) material description, (2) material processing procedures, (3) any special instructions for coating, handling, installation, systems operation tests, etc., and (4) safety considerations
- 2 4 Drawings shall be prepared by the Design Engineer for all items, parts and appurtenances related to Code fabrication and repair projects per the COEM. If not identified in the design specification, drawings shall include (1) weld joint design, showing welding symbols and the Welding Procedure Specification (WPS), (2) a materials list with

materials conforming to the applicable sections of the Code and specified by the ASTM or other specification required by the Code

- 2 5 RFETS procedures and standards used for welding, heat treating, nondestructive examination (NDE), inspection, testing, and cleaning shall specify the technical requirements and acceptance criteria for Code fabrication or repair. The Design Engineer is responsible for the inclusion of applicable Code requirements into any procedure used for a Code project. The Design Engineer is responsible for referencing applicable procedures and standards on design drawings or specifications.
- 2 6 Design packages for piping fabricated in accordance with RFETS Standard SP-211, "Fabrication of Piping Systems," shall include a Piping Fabrication Traveler.
- 2 7 All design packages for Code fabrication shall be reviewed and distributed in accordance with the COEM.
- 2 8 All design changes including material substitution shall be made in accordance with the COEM.

3 MATERIAL CONTROL

- 3 1 All materials (including welding materials) used for Code projects shall be purchased to the ASME (or identical ASTM or AWS) specifications. Welding material shall comply with RFETS Standard SM-125, "Welding Rod" and the appropriate WPS. Piping materials shall comply with RFETS Standard SP-220, "Piping Material Specification".
- 3 2 All Code materials will be procured in accordance with RMRS procurement policies and procedures. The purchase order shall require the supplier to provide identification traceability through specification, heat or lot number, size, AWS or SFA classification, purchase order number, and submittal of material test reports. Bare filler material supplied in cut lengths shall be tagged on both ends with the alloy identification.
- 3 3 Receiving inspection of Code materials will be performed by Receiving Control & Inspection (RC&I). RC&I reviews the material for compliance to the Code material specification for proper identification marking, dimensional compliance and workmanship. Documentation must reference the purchase order number and, upon acceptance, is signed by RC&I.

- 3 4 Acceptable material is released to the applicable material storage area One copy of the signed documentation is shipped with the material The original certifications, traceable through the purchase order number, are filed and maintained by RC&I
- 3 5 All materials for Code projects shall be stored in a controlled area All material shall be identified as required by the Code, and the identification shall be transferred to any portion that will later become a separate piece
- 3 6 The issuance and use of Code material specified by the design package is controlled by the responsible Maintenance organization
- 3 7 The Maintenance Supervisor shall perform the following
 - 3 7 1 Verify that materials specified are identical to those on the material to be removed from the storage area
 - 3 7 2 Transfer material identification to any portion of the material that will later become a separate piece (ie sectioning of plate)
 - 3 7 3 Include material test reports in the IWCP package or traveler packet for materials including welding filler metal
 - 3 7 4 Upon issue, prior to fabrication, the Welding Inspector verifies all material is properly identified and recorded Material not properly identified shall be rejected
 - 3 7 5 As part of the fitup and tackweld inspection, the Welding Inspector verifies that the material approved in step 3 7 4 was used for the fabrication/repair and is properly identified

4 RMRS WELDING

4 1 WELDING PROCEDURES, QUALIFICATION AND RECORDS

- 4 1 1 Welding for Code projects shall conform to the requirements of the specified Code Welding shall be specified by WPSs, which are qualified by Procedure Qualification Records (PQRs) and performed by welders or welding operators qualified by the Welder's Qualification Records (WQRs)

- 4 1 2 RMRS Engineering is responsible for the preparation of the WPS and conducting the qualification tests for the WPS required by the Code. The RMRS WPSs will be qualified by RMRS PQRs. A subcontractor may supply the weld coupons, machine the test specimens, and perform the mechanical testing. An RMRS welder will weld the coupon with an RMRS representative present. RMRS will prepare the PQR. RMRS Engineering will maintain a master copy of WPSs, revisions to WPSs, and the supporting PQRs.
- 4 1 3 RMRS is responsible for the performance qualifications of welders and welding operators in accordance to RFETS Standard SM-126, "Welder Qualification," and certifying the qualification by the WQR record. RMRS may subcontract the qualification testing and record keeping.
- 4 1 4 RMRS or a subcontractor will maintain WQRs and keep a list of currently qualified welders. The 180-Day Documentation shall be used to document a welder's continuity. If subcontracted, the subcontractor will maintain the qualification records and notify RMRS when requalification of a welder is required.
- 4 1 5 The maintenance foreman will assign welders for Code projects and ensure those welders are qualified for the WPS listed on the traveler, drawing or specification. The Welding Inspector will verify the qualification as specified on the traveler, drawing, specification or IWCP package.
- 4 1 6 RMRS management, the Design Engineer, the designated Welding Inspector, or the Kaiser-Hill management designee responsible for welding oversight, may require welder requalification anytime their ability is questioned.
- 4 1 7 Qualified Code welders are assigned a unique welder identification stamp. These stamps are symbols with a unique number related to each. Each stamp will be traceable to the person it was issued to by employee number. RMRS may subcontract the issue and control of stamps. RMRS or the subcontractor will maintain a log of issued stamps. Stamps shall be not be reissued for a period of one year following welder retirement.

4 2 WELDING MATERIAL CONTROL

- 4 2 1 Welding filler metal used on Code projects shall be procured and received in the same manner as other Code Material.
- 4 2 2 The Maintenance Supervisor is responsible for removal and control of filler metal used for Code fabrication.

- 4 2 3 Cut lengths of bare welding wire must be stored in the original container with the heat number and manufacturer's marking. If placed in a new container, all of the identification must be transferred to the new container. Only cut lengths identified with the heat number may be returned to the storage area after use.
- 4 2 4 Spools of bare welding wire must have the heat number and manufacturer's markings. This identification must remain intact until the material is depleted. Only spools so identified may be returned to the storage area after use. Spools shall be placed in a box or plastic bag when not in use to protect from dust and dirt.
- 4 2 5 Shielded metal arc electrodes must have the ASME or AWS designation stenciled on the electrode. Low hydrogen electrodes must come from an unopened sealed box, or an oven set at the temperature recommended by the manufacturer or the Code. Electrodes stored in an oven must be identifiable the heat/lot number.
- 4 2 6 Low hydrogen electrodes cannot be used outside the sealed container or oven beyond a 4-hour period. Electrodes exposed beyond this period shall be discarded or used for non-Code work.

4 3 FABRICATIONS OR REPAIRS

- 4 3 1 The Maintenance Supervisor responsible for the Code fabrication or repair will ensure that welding is performed in accordance with the WPSs assigned. The Supervisor is also responsible, along with the designated Welding Inspector, to ensure the following:
 - (1) Material identification markings are visible, identifiable, and traceable on pressure retaining parts.
 - (2) Edges of plate and pipe are visually examined for any evidence of laminations or other defects after cutting.
 - (3) Beveling, fitup, tack welding and welding are within Code acceptable tolerance.
 - (4) Weld joints are clean and free of scale, rust and oil at least 1/2 inch beyond the weld joint for ferrous material and at least 2 inch for nonferrous material.
 - (5) Production welds are identified with the welder by stamping or etching.

- 4 3 2 Tack welds are treated as a portion of Code welding and will be performed by qualified welders using a qualified WPS. Tack welds to be left in place shall be visually examined and if found to be defective, removed.
- 4 3 3 Each welder shall stamp all welds made. The stamp shall be adjacent to the weld at intervals of no more than every 3 feet along the length of the weld. Stamping of tack welds is not required. Repair welds shall be stamped adjacent to the repair.

5 INSPECTION AND TESTING

- 5 1 All inspection and testing will be performed by a subcontractor approved by RMRS. The Welding Inspector is responsible for performing inspections designated by the design and IWCP packages. Welding Inspectors shall be qualified and certified as required by the Code. All Welding Inspectors shall also be AWS Certified Welding Inspectors (CWIs).
- 5 2 All nondestructive examination (NDE) will be performed by a subcontractor using written procedures that have been approved by an appointed Level III Examiner. Appointment of the Level III Examiner will be by letter from RMRS, and will be acknowledged in writing by the Level III Examiner.
- 5 3 All NDE subcontractor Written Practices, personnel qualifications, and equipment calibrations will be reviewed and approved for Code use by RMRS.
- 5 4 All NDE personnel shall be properly qualified for the method, and shall be certified to a Written Practice meeting the requirements of SNT-TC-1A.
- 5 5 Radiographic and ultrasonic testing reports, including radiographic film shall be evaluated, interpreted and accepted by the Level III Examiner. All NDE reports and film shall be reviewed and accepted by RMRS.
- 5 6 Gages, and testing and measuring equipment used for inspection and testing shall be controlled, calibrated and maintained by the RFETS Metrology Laboratory or a subcontractor. Standards used for calibration shall be traceable to the National Institute for Standards and Testing (NIST) where such standards exist.

6 **NONCONFORMING ITEMS**

Deviations from Code or design package requirements are defined as nonconforming items. All nonconforming items will be processed in accordance with RFETS procedure 1-A65-ADM-15 01, "Control of Nonconforming Items."

7 **SUBCONTRACTORS**

7.1 RMRS may subcontract any or all welding, inspection and testing as necessary in support of RMRS's welding activities. All subcontractors shall have an established Welding Program. RMRS shall review the subcontractors program and personnel qualifications including WPSs, PQRs and WQRs to ensure they meet Code requirements. These requirements include having qualified welding procedures, and welders with current qualification to the welding procedures that will be used for the project.

7.2 All subcontracted activities shall be performed in accordance with all established engineering, health and safety practices utilized by RMRS.

8 **SAFETY REQUIREMENTS**

Each Integrated Work Control Program Work Package requiring welding shall stipulate safety precautions for these welding activities. All RMRS and subcontractor welding shall be performed in accordance with the RFETS Health and Safety Practices (HSP) Manual.

9 **REFERENCES**

9.1 ASME Boiler and Pressure Vessel Code, Section IX, Welding and Brazing Qualifications

9.2 ASME B31 1, Power Piping

9.3 ASME B31 3, Chemical Plant and Petroleum Refinery Piping

9.4 AWS D1 1, Structural Welding Code Steel

9.5 AWS D1 2, Structural Welding Code Aluminum

9.6 AWS D1 3, Structural Welding Code Sheet Metal

- 9 7 RFETS Policy 8-64, Welding Program
- 9 8 RFETS Conduct of Engineering Manual
- 9 9 RFETS Integrated Work Control Program

QW-482 SUGGESTED FORMAT FOR WELDING PROCEDURE SPECIFICATION (WPS)
 (See QW-200.1. Section IX, ASME Boiler and Pressure Vessel Code)

Company Name **ROCKY MOUNTAIN REMEDIATION SERVICES**

Welding Procedure Specification No **RMRS-T1/1**

Revision No **0**

Welding Process(es) **GTAW**

Date **10/9/95**

Date **N/A**

By *Robert P. Campbell*

Supporting PQR No (s) **RMRS-T1/1**

Type(s) **MANUAL**

JOINTS QW-402)

Details


Joint Design **VEE GROOVE**

Backing Yes No

Backing Material (Type) **N/A**

Metal Nonfusing

Nonmetallic Other **NONE**

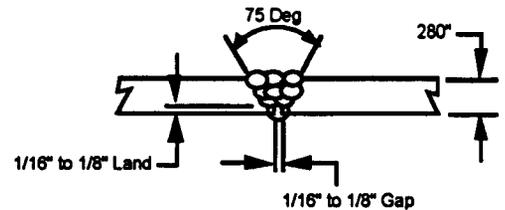

Sketches, Production Drawings, Weld symbols or Written Description should show the general arrangement of the parts to be welded. Where applicable, the root spacing and the details of weld groove may be specified.

(At the option of the Mfgr , sketches may be attached to illustrate joint design, weld layers and bead sequence, e g for notch toughness procedures, for multiple process procedures, etc)

*** BASE METALS (QW-403)**

P-No **11** Group No **1** to P-No **1** Group No **1**

or

Specification type and grade **ASTM A-285,A-105,A-106,A-234 GR A&B TYPICAL**

to Specification type and grade. **GR A&B TYPICAL**

Chemical Analysis and Mechanical Property

to Chemical Analysis and Mechanical Property

Thickness Range

Base Metal Groove **054" TO 750"** Fillet **ALL**

Pipe Dia Range Groove **1/2" TO UNLIMITED** Fillet **ALL**

Other

*** FILLER METALS (QW-404)**

Specification No (SFA) **SFA-5 18**

AWS No (Class) **ER70S-2 THROUGH ER70S-7**

F-No **6**

A-No **A1 AND OR A2**

Size of Filler Metal **1/16", 3/32" & 1/8"**

Weld Metal

Thickness Range

Groove **054" TO 750"**

Fillet **ALL**

Electrode- Flux (Class) **NONE**

Flux Trade Name **NONE**

Consumable Insert. **NONE**

Other:

* Each base metal-filler metal combination should be recorded individually

QW-482 (BACK)
WPS NO RMRS-T1/1 Revision No 0

POSITIONS (QW-405)

Position(s) of Groove ALL
 Welding Progression UP
 Position(s) of Fillet. ALL

POSTWELD HEAT TREATMENT (QW-407)

Temperature Range NONE
 Time Range N/A

PREHEAT (QW-406)

Preheat Temperature - Min 60 deg F
 Interpass Temperature - Max 300 DEG F
 Preheat Maintenance NONE
 (Continuous or special heating where applicable should be recorded)

GAS(es) (QW-408)

	Gas(es)	Percent Composition (Mixture)	Flow Rate
Shielding	ARGON	99.9% PURE	10 TO 20 CFH
Trailing	NONE		
Backing	NONE		

ELECTRICAL CHARACTERISTICS (QW-409)

Current DC Polarity DCEN- STRAIGHT
 Amps (Range) 80-150 Volts (Range) 10-18

(Amps and volts range should be recorded for each electrode size, position, and thickness, etc This information may be listed in a tabular form similar to that shown below)

Tungsten Electrode Size and Type: 2% CERATED TUNGSTEN 3/32 " DIA.

Mode of Metal Transfer for GMAW N/A

Electrode Wire feed speed range N/A

TECHNIQUE (QW-410)

String or Weave Bead STRING
 Office or Gas Cup Size # 4,5 OR 6
 Initial and Interpass Cleaning (Brushing, Grinding, etc) BRUSHING
 Method of Back Gouging N/A
 Oscillation MANUAL
 Contact Tube to Work Distance N/A
 Multiple or Single Pass (per side) MULTIPLE
 Multiple or Single Electrodes SINGLE
 Travel Speed MANUAL
 Peening NONE
 Other GRINDING ALLOWED TO FEATHER EDGES OF TACK WELDS

Weld Layer(s)	Process	Filler Metal		Current			Travel Speed	Other (e g , Remarks, comments, Hot Wire Addition, Technique, Torch Angle, Etc
		Class	Diameter	Type Polar	Amp Range	Volt Range		
ALL	GTAW	ER70S-6	1/16" 3/32" 1/8"	DCEN	80-100 100-120 120-150	10-13 12-15 12-18	MANUAL	

QW-482 SUGGESTED FORMAT FOR WELDING PROCEDURE SPECIFICATION (WPS)
 (See QW-200.1. Section IX, ASME Boiler and Pressure Vessel Code)

Company Name **ROCKY MOUNTAIN REMEDIATION SERVICES**

By *Robert P Campbell*

Welding Procedure Specification No **RMRS-T8/8**

Date **10/9/95**

Supporting PQR No (s) **RMRS-T8/8**

Revision No **0**

Date **N/A**

Welding Process(es) **GTAW**

Type(s) **MANUAL**

JOINTS **QW-402)**

Details


Joint Design **VEE GROOVE**

Backing Yes No

Backing Material (Type) **NONE**

Metal Nonfusing

Nonmetallic Other **NONE**

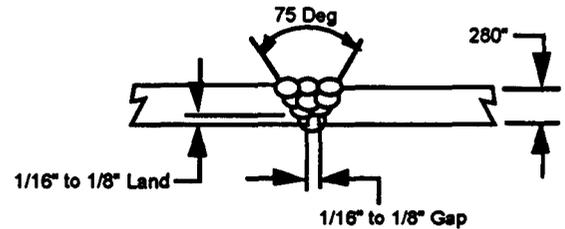

Sketches, Production Drawings, Weld symbols or Written Description should show the general arrangement of the parts to be welded. Where applicable, the root spacing and the details of weld groove may be specified.

(At the option of the Mfgr , sketches may be attached to illustrate joint design, weld layers and bead sequence, e g for notch toughness procedures, for multiple process procedures, etc)

*** BASE METALS (QW-403)**

P-No **8** Group No **1** to P-No **8** Group No **1**

or

Specification type and grade **ASTM A-312,A-182,A-240 TYPICAL**

to Specification type and grade **TP-304L**

or

Chemical Analysis and Mechanical Property

to Chemical Analysis and Mechanical Property

Thickness Range

Base Metal Groove **054" TO 750" INCLUSIVE** Fillet **ALL**

Pipe Dia Range Groove **1/2" TO UNLIMITED**

Other

*** FILLER METALS (QW-404)**

Specification No (SFA) **SFA-5 9**

AWS No (Class) **ER 308 L**

F-No **6**

A-No **1**

Size of Filler Metal **1/16",3/32"&1/8"**

Weld Metal

Thickness Range

Groove **054" TO 750"**

Fillet **ALL**

Electrode- Flux (Class) **N/A**

Flux Trade Name **N/A**

Consumable Insert. **N/A**

Other

* Each base metal-filler metal combination should be recorded individually

QW-482 (BACK)
WPS NO RMRS-T8/8 Revision No 0

POSITIONS (QW-405)

Position(s) of Groove ALL
 Welding Progression UP
 Position(s) of Fillet ALL

POSTWELD HEAT TREATMENT (QW-407)

Temperature Range NONE
 Time Range N/A

PREHEAT (QW-406)

Preheat Temperature - Min 60 DEG F
 Interpass Temperature - Max 300 DEG F
 Preheat Maintenance NONE
 (Continuous or special heating where applicable should be recorded)

GAS (QW-408)

	Gas(es)	Percent Composition (Mixture)	Flow Rate
Shielding	ARGON	99.9% PURE	10-20 CFH
Trailing	NONE		
Backing	ARGON	99.9% PURE	10-20 CFH

ELECTRICAL CHARACTERISTICS (QW-409)

Current DC Polarity DCEN-STRAIGHT
 Amps (Range) 90-180 Volts (Range) 10-20
 (Amps and volts range should be recorded for each electrode size, position, and thickness, etc This information may be listed in a tabular form similar to that shown below)
 Tungsten Electrode Size and Type 2% CERATED 3/32" TUNGSTEN
 Mode of Metal Transfer for GMAW N/A
 Electrode Wire feed speed range N/A

TECHNIQUE (QW-410)

String or Weave Bead STRING
 Office or Gas Cup Size. # 4,5 OR 6
 Initial and Interpass Cleaning (Brushing, Grinding, etc) GRINDING TO FEATHER TACK WELDS PERMITTED
 BRUSHING WITH STAINLESS STEEL BRUSH ONLY
 Method of Back Gouging N/A
 Oscillation MANUAL
 Contact Tube to Work Distance N/A
 Multiple or Single Pass (per side) MULTIPLE
 Multiple or Single Electrodes SINGLE
 Travel Speed MANUAL
 Peening NO
 Other

Weld Layer(s)	Process	Filler Metal		Current			Travel Speed	Other (e g , Remarks, comments, Hot Wire Addition, Technique, Torch Angle, Etc
		Class	Diameter	Type Polar	Amp Range	Volt Range		
ALL	GTAW	ER-308 L	1/16", 3/32" 1/8"	DCEN	90-110 100-140 140-180	10-15 12-16 15-20	MANUAL	

QW-482 SUGGESTED FORMAT FOR WELDING PROCEDURE SPECIFICATION (WPS)
 (See QW-200.1. Section IX, ASME Boiler and Pressure Vessel Code)

Company Name **ROCKY MOUNTAIN REMEDIATION SERVICES**
 Welding Procedure Specification No **RMRS -T1/1** Date **10/9/95**
 Revision No **0** Date **N/A**
 Welding Process(es) **GTAW**


By *Robert P. Campbell*
 Supporting PQR No (s) **RMRS T1/1**
 Type(s) **MANUAL**

JOINTS QW-402)

Details

Joint Design **VEE GROOVE**
 Backing Yes No
 Backing Material (Type) **N/A**

Metal Nonfusing
 Nonmetallic Other **NONE**

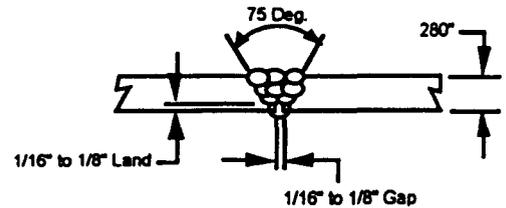

Sketches, Production Drawings, Weld symbols or Written Description should show the general arrangement of the parts to be welded. Where applicable, the root spacing and the details of weld groove may be specified.

(At the option of the Mfgr , sketches may be attached to illustrate joint design, weld layers and bead sequence, e g for notch toughness procedures, for multiple process procedures, etc)

*** BASE METALS (QW-403)**

P-No **11** Group No **1** to P-No **1** Group No **1**

or

Specification type and grade **ASTM A-285,A-105,A-106,A-234 GR A&B TYPICAL**
 to Specification type and grade **GR A&B TYPICAL**

Chemical Analysis and Mechanical Property
 to Chemical Analysis and Mechanical Property

Thickness Range

Base Metal	Groove 054" TO 560"	Fillet ALL
Pipe Dia Range	Groove 1/2" TO UNLIMITED	Fillet ALL
Other		

*** FILLER METALS (QW-404)**

Specification No (SFA). **SFA-5 18**

AWS No (Class) **ER70S-2 THROUGH ER70S-7**

F-No **6**

A-No **A1 AND OR A2**

Size of Filler Metal **1/16",3/32" & 1/8"**

Weld Metal

Thickness Range.

Groove: **054" TO 560"**

Fillet **ALL**

Electrode- Flux (Class) **NONE**

Flux Trade Name **NONE**

Consumable Insert **NONE**

Other

* Each base metal-filler metal combination should be recorded individually

QW-482 (BACK)
WPS NO RMRS -T1/1 Revision No 0

POSITIONS (QW-405)

Position(s) of Groove ALL
 Welding Progression. UP
 Position(s) of Fillet. ALL

POSTWELD HEAT TREATMENT (QW-407)

Temperature Range NONE
 Time Range N/A

PREHEAT (QW-406)

Preheat Temperature - Min 60 deg F
 Interpass Temperature - Max. 300 DEG F
 Preheat Maintenance NONE
 (Continuous or special heating where applicable should be recorded)

GAS(es) (QW-408)

		Percent Composition	
	Gas(es)	(Mixture)	Flow Rate
Shielding	ARGON	99.9% PURE	10 TO 20 CFH
Trailing	NONE		
Backing	NONE		

ELECTRICAL CHARACTERISTICS (QW-409)

Current DC Polarity DCEN- STRAIGHT
 Amps (Range) 80-150 Volts (Range) 10-18

(Amps and volts range should be recorded for each electrode size, position, and thickness, etc This information may be listed in a tabular form similar to that shown below)

Tungsten Electrode Size and Type 2% CERATED TUNGSTEN 3/32 " DIA.

Mode of Metal Transfer for GMAW N/A

Electrode Wire feed speed range. N/A

TECHNIQUE (QW-410)

String or Weave Bead. STRING

Office or Gas Cup Size # 4,5 OR 6

Initial and Interpass Cleaning (Brushing, Grinding, etc) BRUSHING

Method of Back Gouging: N/A

Oscillation. MANUAL

Contact Tube to Work Distance N/A

Multiple or Single Pass (per side) MULTIPLE

Multiple or Single Electrodes SINGLE

Travel Speed. MANUAL

Peening NONE

Other GRINDING ALLOWED TO FEATHER EDGES OF TACK WELDS

Weld Layer(s)	Process	Filler Metal		Current		Volt Range	Travel Speed	Other (e.g., Remarks, comments, Hot Wire Addition, Technique, Torch Angle, Etc)
		Class	Diameter	Type Polar	Amp Range			
ALL	GTAW	ER70S-6	1/16" 3/32" 1/8"	DCEN	80-100 100-120 120-150	10-13 12-15 12-18	MANUAL	

QW-482 SUGGESTED FORMAT FOR WELDING PROCEDURE SPECIFICATION (WPS)
 (See QW-200.1. Section IX, ASME Boiler and Pressure Vessel Code)

Company Name \ ROCKY MOUNTAIN REMEDIATION SERVICES

By *Robert P. Campbell*
 Supporting PQR No (s) RMRS-T8/8

Welding Procedure Specification No · RMRS -T8/8

Date *10/9/95*

Revision No 0

Date N/A


Welding Process(es) GTAW

Type(s) MANUAL

JOINTS QW-402)

Details

Joint Design VEE GROOVE
 Backing Yes No
 Backing Material (Type) NONE
 Metal Nonfusing
 Nonmetallic Other NONE

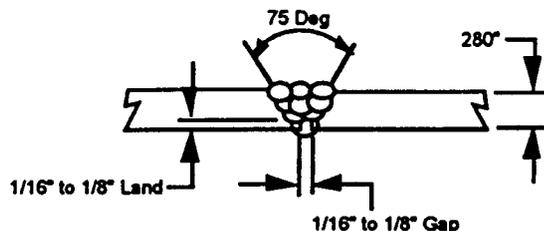

Sketches, Production Drawings, Weld symbols or Written Description should show the general arrangement of the parts to be welded. Where applicable, the root spacing and the details of weld groove may be specified.

(At the option of the Mfgr , sketches may be attached to illustrate joint design, weld layers and bead sequence, e g for notch toughness procedures, for multiple process procedures, etc)

*** BASE METALS (QW-403)**

P-No 8 Group No 1 to P-No 8 Group No 1

or

Specification type and grade ASTM A-312,A-182,A-240 TYPICAL

to Specification type and grade TP-304L

or

Chemical Analysis and Mechanical Property

to Chemical Analysis and Mechanical Property

Thickness Range

Base Metal Groove 054" TO 560" INCLUSIVE Fillet ALL

Pipe Dia. Range Groove 1/ 2" TO UNLIMITED

Other

*** FILLER METALS (QW-404)**

Specification No (SFA) SFA-5 9

AWS No (Class) ER 308 L

F-No 6

A-No 1

Size of Filler Metal 1/16",3/32"&1/8"

Weld Metal

Thickness Range

Groove 054" TO 560"

Fillet ALL

Electrode- Flux (Class) N/A

Flux Trade Name N/A

Consumable Insert. N/A

Other

* Each base metal-filler metal combination should be recorded individually

QW-482 (BACK)
WPS NO RMRS -T8/8 Revision No 0

POSITIONS (QW-405)

Position(s) of Groove ALL
 Welding Progression. UP
 Position(s) of Fillet. ALL

POSTWELD HEAT TREATMENT (QW-407)

Temperature Range NONE
 Time Range N/A

PREHEAT (QW-406)

Preheat Temperature - Min 60 DEG F
 Interpass Temperature - Max 300 DEG F
 Preheat Maintenance NONE
 (Continuous or special heating where applicable should be recorded)

GAS (QW-408)

	Percent Composition		
	Gas(es)	(Mixture)	Flow Rate
Shielding	ARGON	99 9% PURE	10-20 CFH
Trailing	NONE		
Backing	ARGON	99 9% PURE	10-20 CFH

ELECTRICAL CHARACTERISTICS (QW-409)

Current: DC Polarity: DCEN-STRAIGHT
 Amps (Range) 90-180 Volts (Range) 10-20
 (Amps and volts range should be recorded for each electrode size, position, and thickness, etc This information may be listed in a tabular form similar to that shown below)

Tungsten Electrode Size and Type 2% CERATED 3/32" TUNGSTEN
 Mode of Metal Transfer for GMAW N/A
 Electrode Wire feed speed range: N/A

TECHNIQUE (QW-410)

String or Weave Bead. STRING
 Office or Gas Cup Size # 4,5 OR 6
 Initial and Interpass Cleaning (Brushing, Grinding, etc) GRINDING TO FEATHER TACK WELDS PERMITTED
 BRUSHING WITH STAINLESS STEEL BRUSH ONLY
 Method of Back Gouging: N/A
 Oscillation. MANUAL
 Contact Tube to Work Distance. N/A
 Multiple or Single Pass (per side) MULTIPLE
 Multiple or Single Electrodes SINGLE
 Travel Speed. MANUAL
 Peening NO
 Other

Weld Layer(s)	Process	Filler Metal		Current			Travel Speed	Other (e.g., Remarks, comments, Hot Wire Addition, Technique, Torch Angle, Etc)
		Class	Diameter	Type Polar	Amp Range	Volt Range		
ALL	GTAW	ER-308 L	1/16", 3/32" 1/8"	DCEN	90-110 100-140 140-180	10-15 12-16 15-20	MANUAL	

DOCUMENT RECEIPT TRANSMITTAL (DRT) FORM

SECTION 1						Shaded Areas For Document Control Use Only															
Organization	Org Code	Name	Mail Stop	Ext/pager	Date																
RMR5/109		Robert Campbell	T150F	9616	10/10/95																
SECTION 2																					
Pre-verification Acceptance										Date											
HISTORY FILE NOT RECEIVED <input checked="" type="checkbox"/>										HISTORY FILE ACCEPTED AS IS <input checked="" type="checkbox"/> {not a verification of contents}											
Date <u>10/10/95</u>																					
SECTION 3																					
DOCUMENT IDENTIFICATION																					
										- PPG PROC <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO											
(Please check one)																					
Title <u>RMR5 Welding Plan</u>																					
Document Number <u>95-ENG-WELD-0052</u>																					
Revision <u>0</u> PCN/DMR/PMCR <u>95-DMR-001193</u> Effective Date <u>10/9/95</u>																					
Classification <input type="checkbox"/> UCNI <input checked="" type="checkbox"/> UNU						Distribution Cost (Must be completed for processing) Cost Center <u>0483</u> Charge Number <u>T0084575</u>															
(Please check one)																					
DOCUMENT TYPE																					
(Check Appropriate blocks)										Supersedes Document No _____											
Drawing <input type="checkbox"/>	Specification <input type="checkbox"/>	Calculation <input type="checkbox"/>	Design Pkg <input type="checkbox"/>	Report <input type="checkbox"/>	Vendor <input type="checkbox"/>	Draw <input type="checkbox"/>	Spec <input type="checkbox"/>	Other <input type="checkbox"/>	Other _____	Procedure (Stand-alone) <input type="checkbox"/>	Procedure (Manual) <input type="checkbox"/>	PCN/DMR/PMCR <input type="checkbox"/>	Policy/Program Plan <input checked="" type="checkbox"/>	Periodic Review <input type="checkbox"/>	PM Procedures <input type="checkbox"/>	Administrative <input type="checkbox"/>	Technical <input type="checkbox"/>	New <input checked="" type="checkbox"/>	Revision <input type="checkbox"/>	Canceled Document <input type="checkbox"/>	Pen & Ink Changes <input type="checkbox"/>
Attached to the Document.																					
Distribution List <input type="checkbox"/>										Special Instructions.											
Procedure Revision Request <input type="checkbox"/>																					
Procedure History File Material <input type="checkbox"/>																					
Table of Contents <input type="checkbox"/>																					
Other <input type="checkbox"/>																					
SECTION 4																					
DOCUMENT RETURNED TO ORIGINATOR																					
DESCRIBE DEFICIENCIES																					
making history - originating DMR/concurrence																					
RETURNED BY D C PERSONNEL <u>[Signature]</u>										DATE <u>10/10/95</u>											
DOCUMENT ACCEPTED AND VERIFIED BY <u>[Signature]</u>										DATE <u>10/10/95</u>											
DOCUMENT IDENTIFIER <u>PADC-95-02381</u>																					