REV 45

DOCUMENT CONTROL SYSTEM - CORRESPONDENCE FILE

WELDON SPRING SITE REMEDIAL ACTION PROJECT
MK-FERGUSON CO., INC. WO 3589 (314) 441-8086
7295 Highway 94 South
St. Charles, MO 63304

Document Number: 84062

▸▸Document Type: TR-MKFB-MKFW

Originators DCN: 3840-C:GE-N05-4811-0

▸SUBJECT GROUNDWATER OPERABLE UNIT SOIL SAMPLING REPORT

▸AUTHOR DILLE, J.C. ▸▸TO WESELY, MARJ ▸▸DATE 06/21/99

▸SUBJECT CODE/WORK PACKAGE NUMBER 21 6010 476

REFERENCED DOCUMENT(S)

ACTION ITEM TRACKING

INITIATE ACTION ITEM

INDIVIDUAL ASSIGNED TO ACTION _____ DEPARTMENT _____

ACTION REQUIRED _____

DUE DATE / / _____ ACTION ITEM LOG NUMBER _____

CLOSE ACTION ITEM

ACTION ITEM LOG NUMBER _____ INITIATING DOCUMENT DIN _____

COMPLETION DATE _____ APPROVAL _____

COMMENTS _____

DISTRIBUTION	ATTACH W	ATTACH W/O	APPRVL. ORDER	ROUTE INITIAL	DISTRIBUTION	ATTACH W	ATTACH W/O	APPRVL. ORDER	ROUTE INITIAL	DISTRIBUTION	W	W/O
D.E. STEFFEN					S.L. HODGES					**DOE**		
K.M. GREENWELL					A.D. SISSON					S.H. MCCRACKEN		
S.D. WARREN										G.A. NEWTOWN		
J. HEITKAMP										P.S. THOMPSON		
D.K. MURANO										J.R. ENRIGHT		
P.D. CATE										K.A. REED		
D.E. HOFFMAN										T.C. PAULING		
W.W. JOHNSON										A.D. PICKETT		
G.E. MCKAY												
D.S. HIXSON												
M. MITCHELL										PAI		
P.J. FINCH										M.B. BALLEW		
C.R. SAVAGE										S. RICHARDSON		
D.C. WIGTON					DOCUMENT CONTROL:					Y. DEYO		
M.L. WESELY					CORRESPONDENCE FILE					W.R. OWEN		
S.D. ANDERSON					WORK PACKAGE FILE					J. MARTIN		
G.L. VALETT												
					TECH EDITOR							
					ORIGINATOR:							

MORRISON KNUDSEN CORPORATION
ENGINEERING, CONSTRUCTION
& ENVIRONMENTAL GROUP

84062

WSSRA PROJECT DOCUMENT TRANSMITTAL FORM

DOCUMENT NO.	W.P. NO.	TASK NO.	DATE
3840-C:GE-N-05-4811-00	476	852	6/18/99

TO:

WSSRAP
7295 Highway 94 South
St. Charles, Missouri 63304
(314) 441-8086

Attn: M. Wesely/R. Cato

FROM:

Engineering, Construction
& Environmental Group
P.O. Box 73
Boise, ID 83729

Attn: J. Carl Dille

Recipient:

Signature:

Date Received:

ADDRESSEE:
SIGN AND RETURN ONE COPY OF TRANSMITTAL TO: ENVIRONMENTAL SERVICES AT ABOVE ADDRESS WITHIN __5__ WORKING DAYS

APPROVED FOR CONSTRUCTION / FABRICATION	A
APPROVED AS NOTED - WORK MAY PROCEED, REVISE AND RESUBMIT	B
NOT APPROVED - WORK MAY NOT PROCEED, REVISE AND RESUBMIT	C
REJECTED	D
RECEIPT ACKNOWLEDGE-APPROVAL NOT REQUIRED	E
FOR INFORMATION ONLY	F
APPROVAL ACTION REQUESTED	G

DRAWING, SPECIFICATION, OR ITEM NUMBER	REVISION NUMBER	NO. OF COPIES	TITLE OR DESCRIPTION	ACTION
3840TM-5031 3840-C:GE-K-05-4810	0	1	Groundwater Operable Unit Soil Sampling Report	A

DISTRIBUTION: • Transmittal Only

cc: Task File
P. Patchin
K. Nanney •

REMARKS/INSTRUCTIONS:

N/A

Prepared By:
Carol Montgomery *Carol Montgomery*

Approved By:
J. Carl Dille *Clm for J. Carl Dille*

Title:
Off-Site Design Manager

tm-852.doc

DISTRIBUTION: ORIGINAL-WSS; YELLOW-BHO; PINK-WP.

84062

MORRISON KNUDSEN CORPORATION
ENGINEERING, CONSTRUCTION
& ENVIRONMENTAL GROUP

WSSRA PROJECT DOCUMENT TRANSMITTAL FORM

DOCUMENT NO.	W.P. NO.	TASK NO.	DATE
3840-C:GE-N-05-4811-00	476	852	6/18/99

TO:

WSSRAP
7295 Highway 94 South
St. Charles, Missouri 63304
(314) 441-8086

Attn: M. Wesely/R. Cato

FROM:

Engineering, Construction
& Environmental Group
P.O. Box 73
Boise, ID 83729

Attn: J. Carl Dille

Recipient:

Signature:

Date Received:

ADDRESSEE:
SIGN AND RETURN ONE COPY OF TRANSMITTAL TO: ENVIRONMENTAL SERVICES AT ABOVE ADDRESS WITHIN __5__ WORKING DAYS

APPROVED FOR CONSTRUCTION / FABRICATION	A
APPROVED AS NOTED - WORK MAY PROCEED, REVISE AND RESUBMIT	B
NOT APPROVED - WORK MAY NOT PROCEED, REVISE AND RESUBMIT	C
REJECTED	D
RECEIPT ACKNOWLEDGE APPROVAL NOT REQUIRED	E
FOR INFORMATION ONLY	F
APPROVAL ACTION REQUESTED	G

DRAWING, SPECIFICATION, OR ITEM NUMBER	REVISION NUMBER	NO. OF COPIES	TITLE OR DESCRIPTION	ACTION
3840TM-5031 3840-C:GE-K-05-4810	0	1	Groundwater Operable Unit Soil Sampling Report	A

DISTRIBUTION: *Transmittal Only

cc: Task File
P. Patchin
K. Nanney *

REMARKS/INSTRUCTIONS:

N/A

Prepared By:
Carol Montgomery *Carol Montgomery*

Approved By:
J. Carl Dille *Clm for J. Carl Dille*

Title:
Off-Site Design Manager

tm-852.doc

DISTRIBUTION: ORIGINAL-WSS; YELLOW-BHO; PINK-WP.

84062

Morrison Knudsen Corporation
Engineers and Constructors Group

WSSRA PROJECT REVIEWS AND APPROVALS

W.P. NO. 476 TASK NO. 852 DOC. NO. 3840-C: GE-K-05-4810-00

W.P. TITLE: Quarry Restoration

QUALITY LEVEL 2

LEAD DISCIPLINE Geology

SUBJECT: WSSRAP – Groundwater Operable Unit
Soil Sampling Report
Report – Rev. 0
Technical Memorandum
No. 3840TM-5031-00

	PRINT/TYPE NAME	SIGNATURE	DATE
PREPARED:	P. Patchin	Paul C Patchin	6/15/99
REVIEWED:	A. Benfer	Alan Benfer	6/15/99
APPROVED MK E&C:			
- LEAD TASK ENGINEER	P. Patchin	Paul C Patchin	6/15/99
- LEAD DISCIPLINE DEPT. MGR.	R. Raymondi	Phil Raymondi	6/15/99
- DESIGN MANAGER	J. C. Dille	John Bussanich for JCD	6-16-99
- ENGINEERING MANAGER	M. Tavelli	[illegible] for MT	6/17/99
APPROVED:			
- OFF-SITE QUALITY MANAGER	M. Maier	M J Maier	6/17/99

WELDON SPRING SITE REMEDIAL ACTION PROJECT

WSSRAP GROUNDWATER OPERABLE UNIT (GWOU)
SOIL SAMPLING REPORT

Task 852

Technical Memorandum No. 3840TM-5031-00

June 1999

Rev. 0

Prepared By

Morrison Knudsen Corporation
Engineers and Constructors Group
720 Park Boulevard
Boise, ID 83729

for

MK-Ferguson Group
7295 Highway 94 South
St. Charles, MO 63304

WSSRAP
Chemical Plant
Technical Memorandum No. 3840TM-5031-00
Task No. 852
GWOU Soil Sampling Report

CONTENTS

1.0 INTRODUCTION
2.0 ENVIRONMENTAL SAFETY AND HEALTH
3.0 WASTE MANAGEMENT
4.0 DRILLING AND SAMPLING
5.0 DATA ANALYSIS
6.0 REFERENCES

FIGURES

Figure 1 – TSA Borehole Locations
Figure 2 – Bedrock Topography

ATTACHMENTS

- Borehole Logs

1.0 Introduction

This memorandum describes the soil sampling activities performed as part of the RI/FS process for the Groundwater Operable Unit at the WSSRAP. Field studies were conducted in the temporary storage area (TSA) from February 3rd through February 19th, 1999. During that period, thirty-two boreholes were drilled and sampled. The work was generally performed as described in the *Sampling Plan for the Remedial Investigation/Feasibility Study for the Groundwater Operable Unit at the Chemical Plant and Ordnance Works – Addendum 4: Soil Sampling for TCE at the Chemical Plant,* (MKF&JEG, 1999). As stated in the plan, the objectives of this investigation were to:

- Identify the source of PCE and TCE contamination to the shallow aquifer beneath the chemical plant
- Delineate the vertical and horizontal extent of PCE and TCE soil contamination if a source area is identified.

Geotechnology Inc. was subcontracted to perform all drilling, sampling, and borehole abandonment as part of Work Package 476, Task 15.

2.0 Environmental Safety and Health

The drilling was performed in accordance with the subcontractor's safe work plan under the authority of the PMC site health and safety plan. PMC safety representatives performed an initial safety inspection of the subcontractor's drill rig and provided coverage throughout the fieldwork. Work was performed in modified Level C personal protective equipment consisting of poly-coated Tyveck® coveralls, latex gloves, steel-toed boots, safety glasses, and hard hats. Non-drilling personnel wore fluorescent safety vests. No safety-related incidents or accidents occurred during this investigation.

ES&H personnel provided constant coverage during the fieldwork. All soil samples retrieved during drilling were scanned for beta and gamma activity before leaving the work area.

3.0 Waste Management

Soil cuttings generated from the drilling and sampling within the TSA fence were not collected because additional excavation of contaminated soil within the area was planned. Other waste generated during the drilling inside the TSA such as personal protective equipment was bagged and disposed of as radioactive trash. For those boreholes drilled outside the TSA fence, the cuttings were collected and contained in lined 55-gallon drums and transported to the Ash Pond area and emptied. All other waste generated outside the TSA was disposed of as clean waste.

4.0 Drilling and Sampling

A total of 32 boreholes were drilled in six areas of the temporary storage area (TSA). Four borings that were originally planned for the south end of raffinate pit 4 were not drilled following reevaluation of sampling data which showed PCBs in the area. It was determined that PCB decontamination requirements would significantly delay a subsurface investigation here, therefore, sampling was not conducted. Collection of samples from this area will likely be performed at a later date.

The investigation boreholes were drilled at locations shown in the *Sampling Plan* except where access to the original location was limited. In this case, the borehole was moved the minimum distance (less than 25 feet) from the original location. Figure 1 shows the final locations of the TCE soil sampling boreholes in the TSA vicinity. Monitoring wells and previous soil gas sampling locations are also shown. Table 4-1 below is a summary of the boreholes drilled during this program.

Table 4-1 Borehole Summary Table				
Borehole ID	**Northing[1]**	**Easting[1]**	**Ground Elevation[2]**	**Total Depth (ft.)[3]**
TSA1-1	1042160.70	753592.60	666.56	49.0
TSA1-2	1042132.60	753543.84	664.29	45.0
TSA1-3	1042120.01	753456.60	665.56	48.5
TSA1-4	1042078.35	753618.52	663.90	45.5
TSA1-5	1042019.31	753455.53	659.02	33.0
TSA1-6	1042043.73	753555.03	662.51	38.0
TSA1-7	1041970.78	753568.11	661.84	39.5
TSA1-8	1041899.53	753481.25	653.25	32.5
TSA2-1	1041778.19	753479.33	654.15	26.5
TSA2-2	1041732.92	753486.52	656.06	27.5
TSA2-3	1041667.71	753480.84	656.27	34.0
TSA2-4	1041619.59	753483.70	658.12	37.5
TSA3-1	1041461.85	753480.41	656.11	30.0
TSA3-2	1041481.03	753620.27	662.39	32.0
TSA3-3	1041405.31	753555.52	665.00	42.5
TSA3-4	1041328.06	753483.40	657.06	37.0
TSA3-5	1041353.87	753646.26	665.63	31.5
TSA3-6	1041262.41	753537.09	660.85	28.0
TSA3-7	1041265.30	753645.58	664.54	37.0
TSA3-8	1041321.03	753708.15	666.95	31.0
TSA4-1	1041992.53	753941.03	664.25	45.5
TSA4-2	1041937.33	753876.70	661.34	39.0
TSA5-1	1041575.34	753828.02	660.53	28.5
TSA5-2	1041471.95	753832.04	662.20	30.0
TSA5-3	1041339.66	753831.92	666.26	35.0
TSA5-4	1041255.53	753858.47	671.62	40.0
TSA6-1	1041500.75	753936.36	665.39	35.5
TSA6-2	1041449.67	753928.54	664.80	34.5
TSA6-3	1041409.04	753933.60	664.25	35.5
TSA6-4	1041399.07	753943.61	664.48	35.5
TSA6-5	1041322.18	753933.63	666.59	28.0[4]
TSA6-6	1041316.97	753934.44	667.15	36.0

[1] NAD 1983 survey datum.
[2] In feet above sea level.
[3] Total depth at the top of bedrock.
[4] Total depth above bedrock because of stuck sampler.

Two drilling rigs were used to expedite the investigation. A truck-mounted CME-75 was initially used to drill and sample the boreholes. It was joined by an all-terrain CME-550 drill rig. Hollow stem augers with an inside diameter (ID) of 4-¼-inches and outside diameter (OD) of 8-¼-inches were used on both rigs. Soil samples were collected continuously throughout each borehole using a CME continuous soil sampler with an ID of 3 inches.

Soils were retrieved from the sampler and divided into 2-½-foot samples. Each section was split lengthwise and approximately one-quarter of the sample was immediately placed and sealed in a plastic bag and the remaining three-quarters was described by the PMC geologist according to

the Unified Soil Classification System and ES&H procedure 4.4.7. The bagged samples were later screened for volatile organic compounds in the headspace as described in Section 4.1.

All boreholes except one were advanced to the top of bedrock to characterize and sample the overburden soil. Borehole TSA6-5 was terminated at 28 ft. because the CME-sampler became stuck in the augers. After repeated attempts to remove the sampler, the augers were withdrawn from the hole, the sampler retrieved, and the hole was abandoned by grouting. Borehole TSA3-3 had to be re-drilled a few feet away from the original location after poor sample recoveries were caused by a wood piece plugging the auger bit. The re-drilled hole successfully reached bedrock with good sample recoveries.

4.1 Headspace and Laboratory Sampling

Headspace screening for volatile organic compounds was conducted on each 2-½ ft. soil sample collected during this investigation. A photoionization detector (PID) with a lamp suitable for ionizing the compounds TCE and PCE was used during the headspace screening. Results from this screening will be published in an upcoming completion report.

The *Sampling Plan* stated that those samples registering at least five times the levels measured in the atmosphere during PID screening would be selected for laboratory analysis. No sample obtained during the field effort registered this high. Therefore, those samples with any noticeably higher reading than background were selected for laboratory analysis. If headspace screening showed no samples greater than background, the top 5 feet of soil from the borehole was sent for laboratory analysis. Sampled intervals and results from headspace screening and laboratory analysis will be published in the completion report.

4.2 Borehole Abandonment

Each borehole was abandoned according to the work package specifications and Missouri well construction rules. When drilling was completed, a tremie pipe was placed to the bottom of the hole and the borehole was grouted to the surface using Grout Well® high solids bentonite grout. Each borehole was checked for grout settlement and topped off as necessary.

5.0 Data Analysis

5.1 Soils

Soils sampled during the drilling effort were relatively consistent across the TSA. Recent fill material related to the construction of the TSA was encountered in a majority of the boreholes ranging up to 13 ft. deep. The thickest areas of recent fill were seen in Area 1. The recent fill was characterized primarily as re-worked Ferrelview Formation clay with its distinctive high plasticity and mottled colors. Pre-TSA fill material placed during the construction of the chemical plant was also encountered in most of the areas, sometimes beneath the recent fill. It

ranged in thickness up to 6 ft. and was distinguishable as a dark colored, low plasticity, siltier material.

The native soil stratigraphy in the chemical plant area is described in detail in the *GWOU Remedial Investigation Report* (MKF-JEG, 1997). Native soils encountered beneath the fill were consistent with previous drilling in this area of the Chemical Plant. The Ferrelview Formation, a high plasticity clay, was commonly found beneath the fill or at the ground surface at thickness' from 8 to 21.5 feet. In a few areas, the Roxana Silt, which overlies the Ferrelview, was described and where identified, it ranged in thickness from 2 to 9 feet. Below the Ferrelview Formation was the clay till unit, which ranged in thickness from 7 to 21.5 feet. A subunit of the clay till, the basal till was described in a two of the boreholes. Beneath the clay till and directly above the bedrock surface, the residuum unit was usually encountered prior to auger refusal on the bedrock, however, some boreholes showed no discernable residuum soil. Overall, this unit was generally thin in comparison with other areas on the site, ranging in thickness from 1.5 to 10.5 feet.

5.2 Bedrock

The weathered surface of the Burlington-Keokuk Limestone was encountered in the majority of the boreholes drilled in the TSA area. Auger and sampler refusal generally indicated that the bedrock surface had been intercepted. However, because of the cobble and boulder-sized rock fragments commonly found at the base of the clay till unit or within the residuum overlying the bedrock, sampler refusal did not always indicate the top of the bedrock. In some cases, an SPT sampler was driven to confirm the top of bedrock.

Figure 2 shows the bedrock topography after incorporating borehole data from the TSA area and recent drilling performed within Raffinate Pit #3. The most notable effect when compared to previous mapping is the greater definition on the bedrock surface in the TSA area. No significant changes to the overall morphology of the bedrock are noted.

6.0 References

MK-Ferguson Company and Jacobs Engineering Group. *Sampling Plan for the Remedial Investigation/Feasibility Study for the Groundwater Operable Unit at the Chemical Plant and Ordnance Works – Addendum 4: Soil Sampling for TCE at the Chemical Plant,* DOE/OR/21548-445: 4, Prepared for the U.S. Department of Energy, Oak Ridge Operations Office. St. Charles, MO. January, 1999.

MK-Ferguson Company and Jacobs Engineering Group. *Remedial Investigation for the Groundwater Operable Units at the Chemical Plant Area and the Ordnance Works Area, Weldon Spring, Missouri,* DOE/OR/21548-571 (Final), Prepared for the U.S. Department of Energy, Oak Ridge Operations Office. St. Charles, MO. July, 1997.

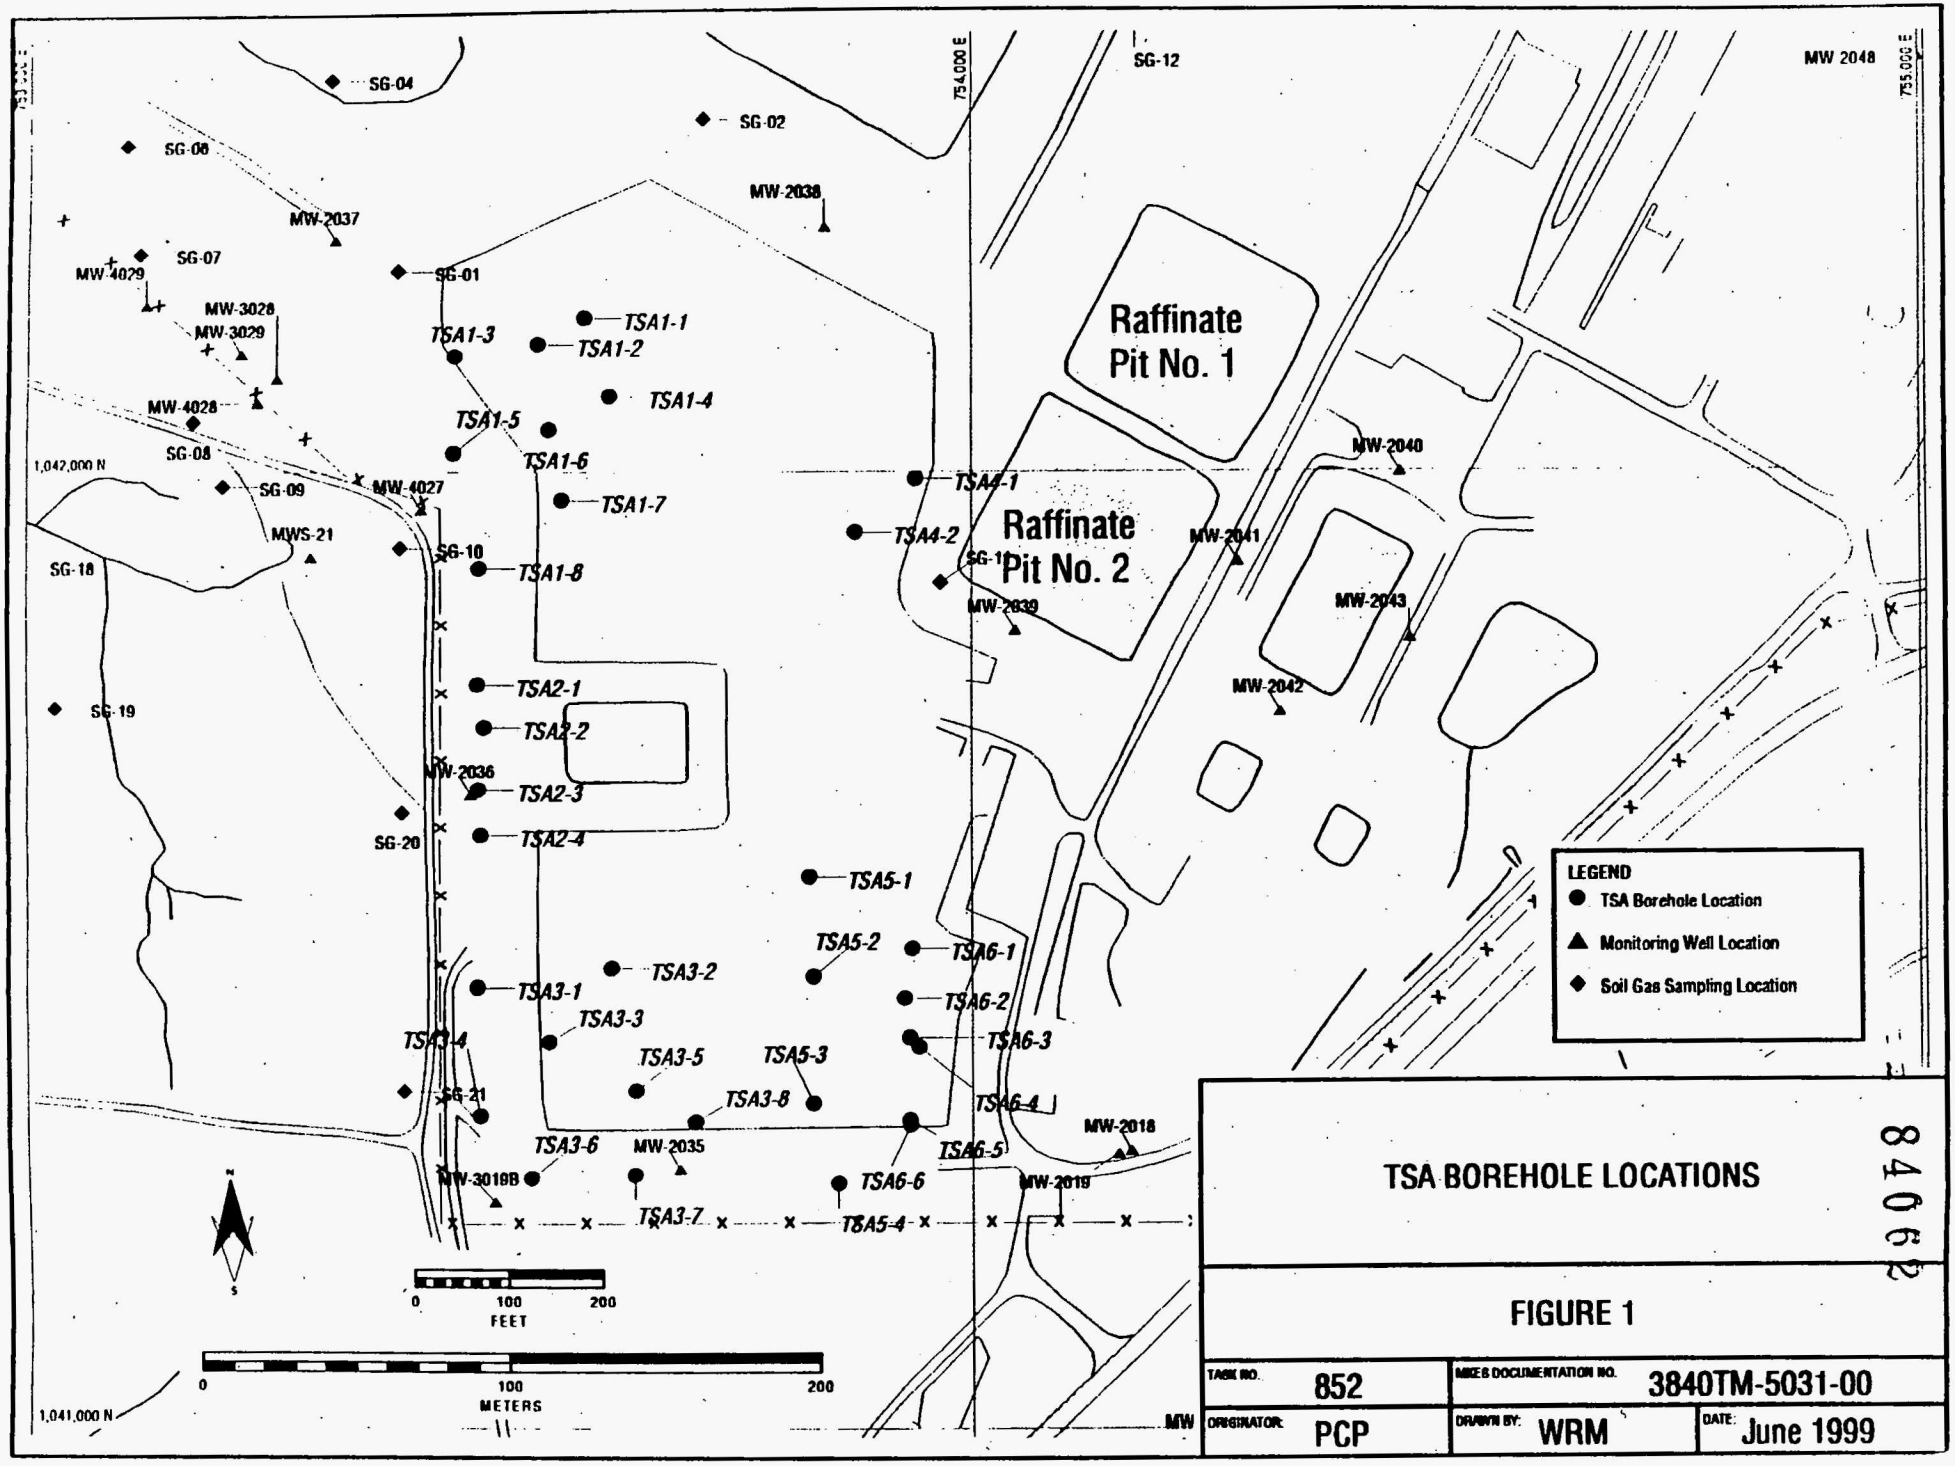
SG-04
SG-02
SG-12
MW 2048
754,000 E
755,000 E
SG-06
MW-2037
MW-2038
SG-07
MW-4029
SG-01
MW-3028
MW-3029
TSA1-1
TSA1-2
TSA1-3
TSA1-4
MW-4028
TSA1-5
TSA1-6
SG-08
1,042,000 N
SG-09
MW-4027
TSA1-7
MWS-21
SG-10
TSA1-8
SG-18
TSA4-1
TSA4-2
SG-11
MW-2039
Raffinate Pit No. 1
Raffinate Pit No. 2
MW-2040
MW-2041
MW-2043
MW-2042
SG-19
TSA2-1
TSA2-2
MW-2036
TSA2-3
SG-20
TSA2-4
TSA5-1
TSA5-2
TSA6-1
TSA3-2
TSA3-1
TSA6-2
TSA3-3
TSA3-4
TSA6-3
TSA3-5
TSA5-3
SG-21
TSA3-8
TSA6-4
MW-2018
TSA3-6
MW-2035
TSA6-5
MW-3019B
TSA6-6
MW-2019
TSA3-7
TSA5-4
MW
LEGEND
TSA Borehole Location
Monitoring Well Location
Soil Gas Sampling Location
0
100
200
FEET
0
100
200
METERS
1,041,000 N
TSA BOREHOLE LOCATIONS
FIGURE 1
TASK NO. 852
MKES DOCUMENTATION NO. 3840TM-5031-00
ORIGINATOR: PCP
DRAWN BY: WRM
DATE: June 1999
84062

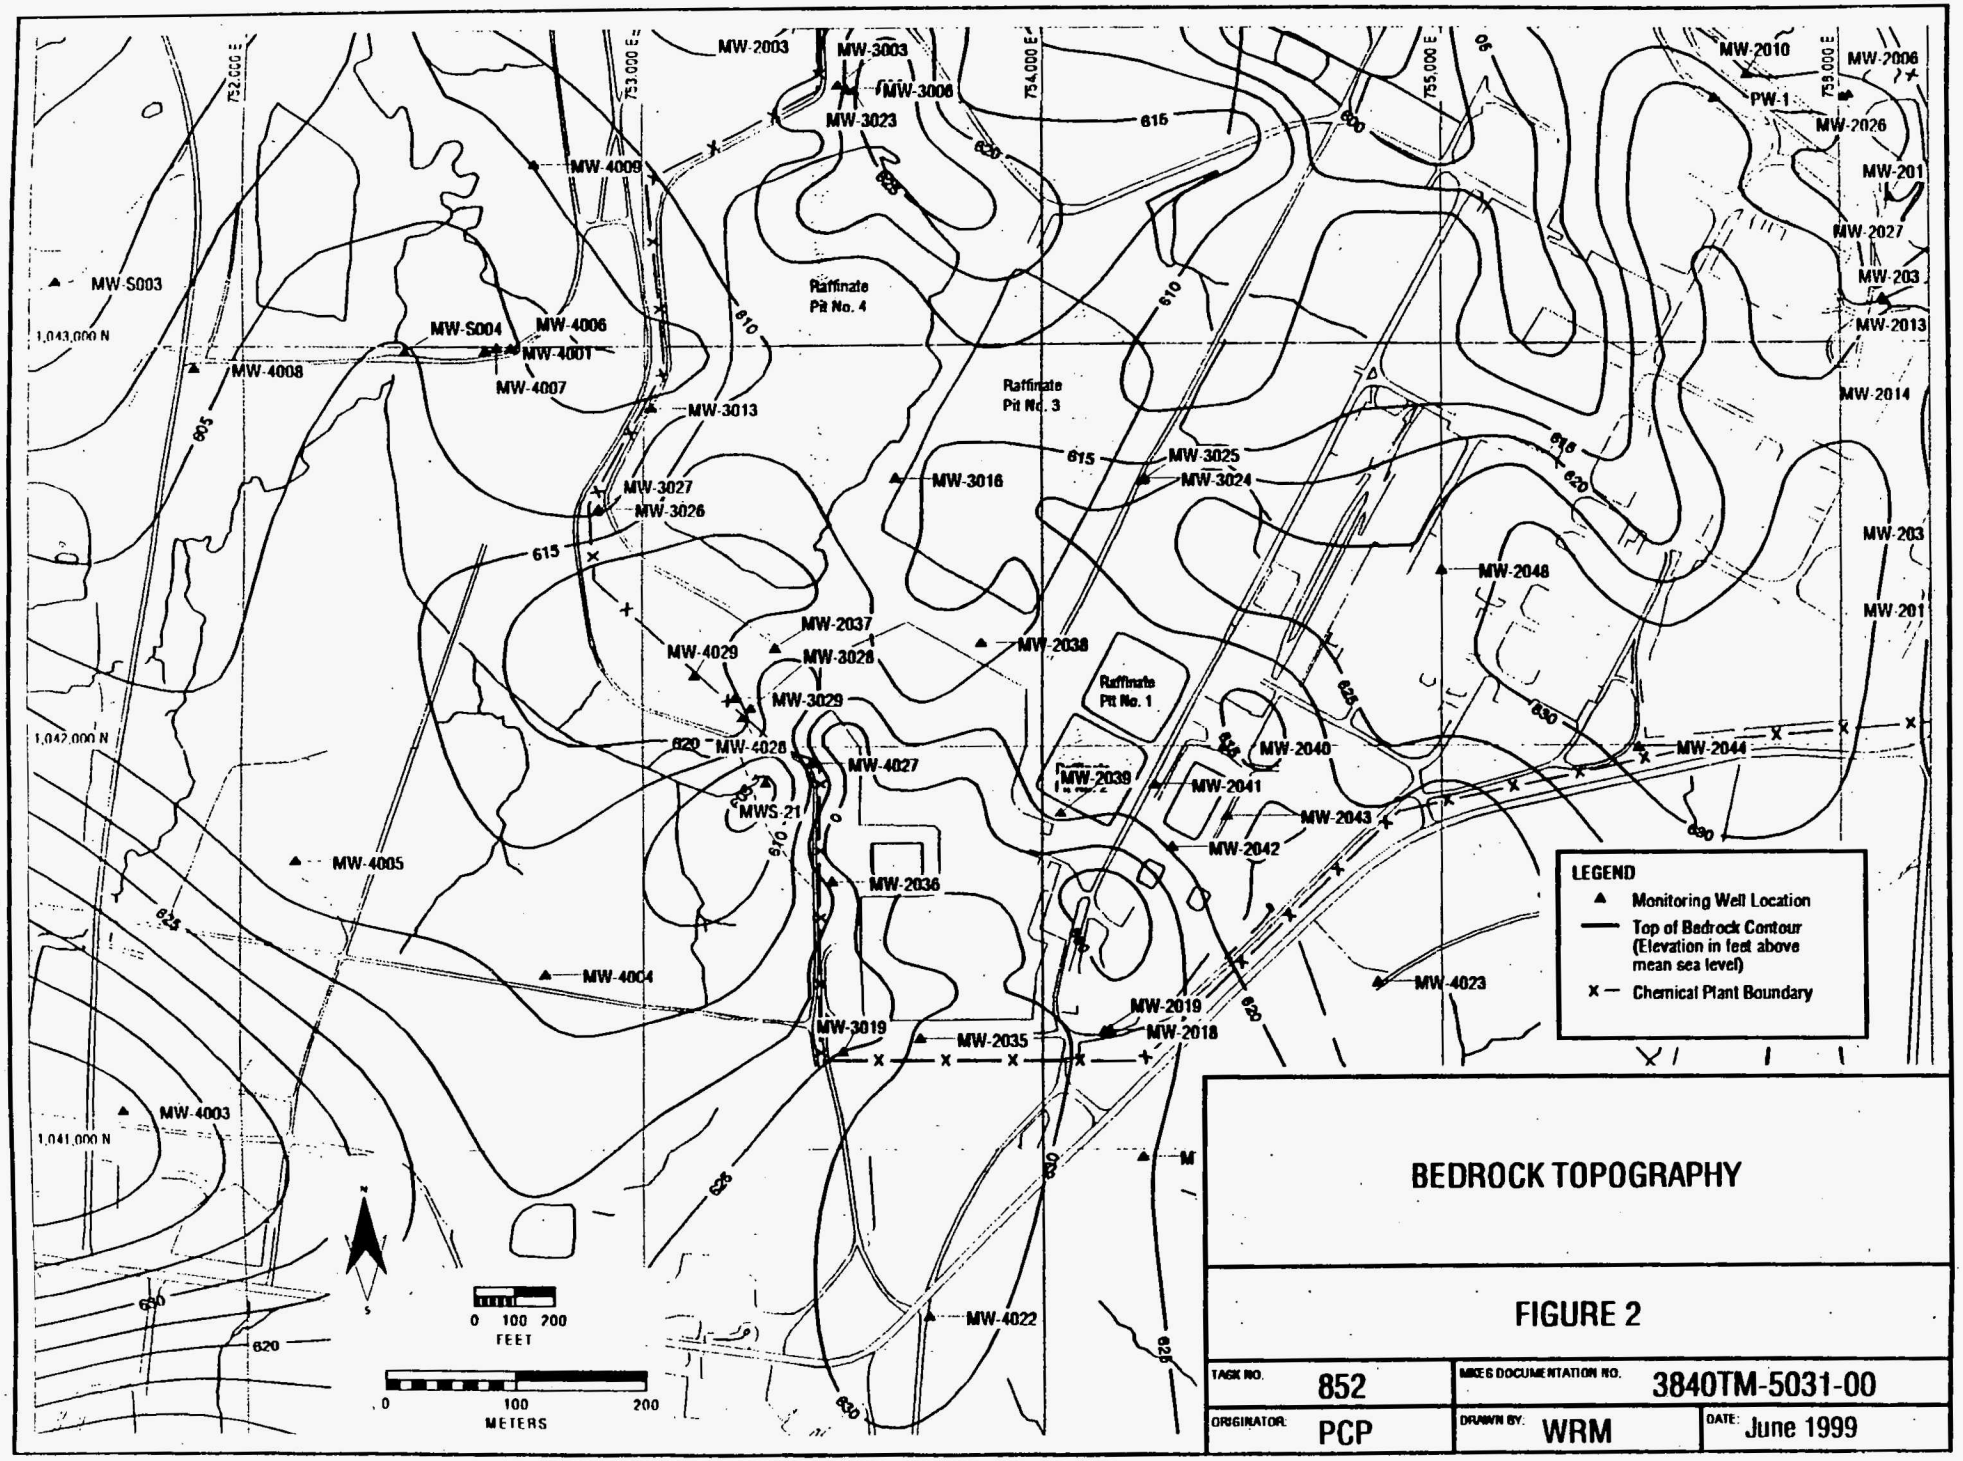

BEDROCK TOPOGRAPHY

FIGURE 2

TASK NO. 852	MKES DOCUMENTATION NO. 3840TM-5031-00		
ORIGINATOR: PCP	DRAWN BY: WRM	DATE: June 1999	

84069

ATTACHMENTS – BOREHOLE LOGS

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA-1-1

Project: TCE SOURCE INVESTIGATION	Location: NW CORNER OF TSA
Coordinates: 1042160.7 N 753592.6 E	Drilling Contractor: GEOTECHNOLOGY

Drill Make and Model	Depth Top of Rock	Depth Casing & Size	Hole Size
CME-55 ATV MOUNT	~49	NA	8.5"

Elevation	Angle from Vert. and Bearing	Depth Bottom of Hole
666.56'	VERTICAL (0°)	49'

Water Level	Fluid & Additives	Date Start	Date Finish	Logger
NA	NA	2/11/99	2/11/99	N. BOSS

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	0	0–4	CME-1	4/4	NA	CL	(0-2.5) Silty CLAY; mot. rd brn & lt gry; high plas; little silt; some clay; tr vf gly; feld sand; v stiff; tr. subang. fresh, ls gravel; damp; reworked; no odor; MnOx stain; FeOx nodules; [Fernal view Fe1C]
		4–9	CME-2	5/5	NA	OL	(2.5-5.0) Silty CLAY; blk; sl-med plas; little silt; some clay; tr. subang ls gravel road base; damp; organic odor; roots; reworked (compressed); firm [Remnant Topsoil (Fill?)]
1938	5					CL	(5-7.5) See 0-2.5' for description
						OL	(7.5-8.5) Silty CLAY; blk; sl-med plas; little silt; some clay; tr vf subang gly sand; damp; organic odor; roots; native; not reworked; firm [Remnant Native Topsoil]
1950	10	9–14	CME-3	5/5	NA	ML	(8.5-10.5) Clayey Silt; rd brn; sl plas; little clay; mostly silt; tr vf sand; damp-dry; no odor; FeOx stain; loess?; firm [Rovena Silt]
		14–19	CME-4	5/5	NA	CH	(10.5-22) CLAY; mottled rd brn & lt gry; high plas; tr. silt; some clay; tr. vf subang gly & feld sand; v stiff; damp; no odor; MnOx stain; FeOx nodules [Native Fernal]
1909	20	19–24	CME-5	5/5	NA		
	25	24–26	CME-6	5/5		CL	See pg. 2 for description [CLAY TILL]

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA-1-1

Project: TRE SOURCE INVESTIGATION
Location: NW CORNER OF TSA

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION: Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol
	25	24–29	CME-6	5/5	NA	CL	(22-45) Silty CLAY; rd brn; med plas; some silt; some clay; little vf, qtz & feld, subang sand; tr. highly weathered granitic pebs; stiff; damp; no odor; MnO2 stain
	30	29–34	CME-7	5/5	NA		
	35	34–39	CME-8	5/5	NA		
	40	39–44	CME-9	2/5	NO REC FROM 42-44'		[CLAY TILL]
	45	44–49	CME-10	5/5	NA	GC	(45-49) Clayey GRAVEL; white - lt gray chert & lo gravel (max size 3"); little v.plas fines; clay matrix = rd brn; v.dense; damp; p.sorted; subang - subround gravel appear mod weathered - 47-49 no gravel present, clay is v.high plas white - lt gray [Residuum]
	50						Boring terminated @ 49' bgs, due to auger; sampler refusal upon incompetent bed rock. Boring backfilled w/ bentonite slurry. Samples collected in 1-gal Ziplocs @ 2.5' intervals as composites for PID headspace analysis.

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: WP-476, Task 15
Hole Number: TSA-1-2

Project: TCE Source Investigation	Location: NW CORNER OF TSA
Coordinates: 1042132.60 N 753543.84 E	Drilling Contractor: GEOTECHNOLOGY
Drill Make and Model: CME-55 ATV MOUNT	Depth Top of Rock: ~45'
Depth Casing & Size: NA	Hole Size: 8.5"
Elevation: 664.29	Angle from Vert. and Bearing: VERTICAL (0°)
Depth Bottom of Hole: 45'	
Water Level: NA	Fluid & Additives: NA
Date Start: 2/11/99	Date Finish: 2/11/99
Logger: N. BOSS	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	0	0–4	CME-1	4/4	NA	CL	(0-11) Silty CLAY; mottled rd brn & lt gry; high plas; little silt; some clay; tr vf-m qtz sand; tr-little subang fresh gravel; damp; stiff-v. stiff; reworked; no odor; MnOx stain & FeOx nods & smear [Ferrelview Fill]
	5	4–9	CME-2	5/5	NA		
	10	9–14	CME-3	5/5	NA		
	15	14–19	CME-4	5/5	NA	CH	(11-20) CLAY; mottled rd brn & lt gray; high plas; tr silt; some clay; tr. vf subang qtz sand; v stiff; damp; tr. granite pebs (weathered); no odor; MnOx stain; FeOx nods; decrease in FeOx w/ depth -15-20', clay is predom. lt gry w/ tr. FeOx stain [NATIVE Ferrelview]
	20	19–24	CME-5	5/5	NA	CL	(16-32) Silty CLAY; rd brn; med plas; some silt; some clay; little vf, qtz subang sand; tr. high weathered granitic pebs; stiff; damp; no odor; abundant MnOx stain [CLAY TILL]
	25	24–29	CME-6	5/5	NA		

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA-1-2

Project: TCE Source Investigation
Location: NW CORNER OF TSA

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	25	24–29	CME-6	5/5	NA	CL	See pg 1 for description
1516	30	29–34	CME-7	5/5	NA	CL	
528	35	34–39	CME-8	5/5	NA	CL	[CLAY TILL]
550	40	39–44	CME-9	5/5	NA	GC	(40-42.5) Clayey GRAVEL; lt gray gravel; yel brn matrix; some v. plas fines (clay; silt); little subang cherty sands; dense; damp-moist; p. sorted; p. bound; no odor [Basal Till?]
		44–45				GC	(42.5-45) Clayey GRAVEL; white-lt gry gravel; rd matrix; little plas fines (clay); gravel is chert; mod weathered; is up to 3" max; v. dense; damp; p. sorted; no odor [Residuum]
1608	45	44–45	SS-1	1/1	NA		
	50						Boring terminated @ 45' bgs due to sampler/auger refusal upon impenetrable Residuum. Boring backfilled w/ bentonite slurry upon completion.

- Samples were collected in 1-gal Ziplocs @ 2.5' intervals as composites for PID headspace analysis

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sampler - 3.0" I.D. CME continuous

Sheet 1 of 2

Project Number: Task 852

Hole Number: TSA-1-3

Project: TCE at the Chem. Plant	Location: Inside TSA, NW, offset hole ~12'
Coordinates: 1041937.33N 753456.60E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75, H.S. auger	Depth Top of Rock: 48.5'
Depth Casing & Size: —	Hole Size: 4¼"/8¼"
Elevation: 665.56'	Angle from Vert. and Bearing: Vertical
Depth Bottom of Hole: 48.5'	
Water Level: —	Fluid & Additives: None
Date Start: 0820 2/11/99	Date Finish: 1020 2/11/99
Logger: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER (3.0" D)	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0'			Lean clay (CL) - orange brown, with FeO nodules moist, stiff, reworked Ferrelview clay. at 1.5 - olive gray and brown, with some gravel. FILL
	5	5.0					
		5.0	CME 2	5.0'			Fill as above.
	10	10.0					
		10.0	CME 3	5.0'			Lean clay (CL) mostly light brown with FeO nodules, moist, v. stiff - reworked Ferrelview - FILL 13'
	15	15.0					Lean clay (CL), mottled light brown and gray, abundant FeO nodules, moist - stiff. (Roxanna-like) Ferrelview 17.0'
		15.0	CME 4	5.0'			Fat clay (CH) orange brown with light gray streaks (appear to follow paleo fractures), scattered FeO nodules, moist, v. stiff, slickensided, massive Ferrelview Trace of sand 22.0'
	20	20.0					
		20.0	CME 5	5.0'			Fat clay (CH) ~20% sand, ~5% fine gravel, mottled yellow brown, with light gray and black (MnO). moist, v. stiff. CLAY TILL
	25	25.0					

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-1-3

Project: ICE at the Chem. Plant
Location: inside TSA, NW

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
0925		25.0	CME 6	5.0'			Fat clay (CH) ~20% sand, trace of fine gravel, minor FeO nodules, predominantly yellow brown with streaks of light gray and black, both appear to follow fractures, damp to moist, v. stiff, CLAY TILL
	30	30.0					
		30.0	CME 7	5.0'			✓ as above, scattered gravel ~5% fine to up to 1", light gray does follow fractures (mostly healed), black also follows fractures (open) but also as nodules. at 33-35' - yellow brown only
	35	35.0					
0940		35.0	CME 8	5.0'			CH as above, gravel pockets of chert up to 2", clean fine sand lense at 37.5' (3") light gray and black coating fractures.
	40	40.0					~40'
		40.0	CME 9	4.0'			Lean Clay, CL, silty, light gray with orange brown FeO blebs., blocky texture, moist, stiff CLAY TILL 44'
	45	45.0					
		45.0	CME 10	3½'			Clayey gravel, (GC), angular chert with plastic clay matrix, orange brown, moist, dense, at 47': 3" seam of high plastic clay Residuum
1010		48.5	SPT		25/24		
	50						T.D. 48.5' 1020, on Limestone. 2/11/99 Hole backfilled with Grout well bentonite slurry

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

3.0" I.D. CME continuous sampler

Sheet 1 of 2

Project Number: Task 852

Hole Number: TSA-1-4

Project: TCE at the Chem Plant	Location: inside TSA, NW
Coordinates: 1042078.35N 753618.52E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 H.S. Auger	Depth Top of Rock: 45.5'
Depth Casing & Size: —	Hole Size: 4¼"/8¼"
Elevation: 663.90	Angle from Vert. and Bearing: vertical
Depth Bottom of Hole: 45.5'	
Water Level: —	Fluid & Additives: none
Date Start: 1535 2/10/99	Date Finish: 1645 2/10/99
Logger: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER (3.0")	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0'			Lean clay, brown to dark brown, abundant FeO nodules, moist, stiff. Reworked Ferrelview Clay 5-6', old topsoil FILL 6.0'
	5	5.0	CME 2	5.0'			Lean Silty Clay (CL) mottled orange brown and dark gray, abundant FeO nodules moist, stiff. Ferrelview Clay at 8', mostly light brown. (Roxanna-like) 11'
	10	10.0	CME 3	5.0'			Fat clay (CH) mostly orange brn, moist light gray, some FeO nodules, massive highly plastic, moist stiff, slickensided. at 13', mostly light gray.
	15	15.0	CME 4	5.0'			CH as above 18.5'
	20	20.0	CME 5	5.0'			Fat clay, (CH), ~10% sand, some fine gravel, mottled yellow-orange brown, light gray with black streaks (MnO), moist, v. stiff, CLAY TILL at 21', ~20% sand, 10% fine grvl., orange brown to brown with light gray, MnO nodules and streaks, larger gravel at 24', CLAY TILL
1.0	25	25.0					

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-1-4

Project: T&E at the Chem Plant
Location: Inside TSA, NW

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		25.0	CME 6	5.0'			Fat clay (CH) yellow brown, ~20% sand, ~10% gravel, streaks of MnO, Moist, v. stiff. CLAY TILL
		30.0					at 29' increase in gravel
30		30.0	CME 7	5.0'			As above, light gray and black tend to follow fractures, damp -
35		35.0					
		35.0	CME 8	5.0'			as above to 36.5. at 36.5 - 37.5, heavy gravel zone - 37.5 - 39.0', light brown. very silty clay - 40'
40		40.0					
		40.0	CME 9	4.0'			Clayey Gravel, (GC) angular Chert, red-dish brown to brown high plastic clay matrix, Moist, dense Residuum
45		45.0					
							T.D. 45.5', probabably bed-rock, 1645 2/10/99. Hole backfilled with Grout Well bentonite slurry.

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: WP-476, Task 15
Hole Number: TSA-1-5

Project: TCE SOURCE INVESTIGATION	Location: NW CORNER OF TSA (OUTSIDE FENCE)
Coordinates: 1042019.31N 753455.53E	Drilling Contractor: GEOTECHNOLOGY

Drill Make and Model	Depth Top of Rock	Depth Casing & Size	Hole Size
CME-55 ATV-MOUNT	~33'	NA	8.5"

Elevation	Angle from Vert. and Bearing	Depth Bottom of Hole
659.02	VERTICAL (0°)	33'

Water Level	Fluid & Additives	Date Start	Date Finish	Logger
NA	NA	2/19/99	2/19/99	N. BOSS

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	0	0–3.5	CME-1	3.5/3.5	NA	FILL (CL)	(0-8) Silty CLAY; mottled rd brn; lt gray; high plas; little silt; some clay; tr vf-m qtz sand; tr-little subang fresh gravel; damp; stiff-v. stiff; reworked; no odor; MnOx stain; FeOx nods (smeared) [FERREWION FILL]
	5	3.5–8.5	CME-2	5/5	NA		
		8.5				OL	(8-8.5) Silty CLAY; blk; sl-med plas; little silt; some clay; damp; firm; org odor; tr sand; roots [Cement TOPSOIL]
	10	8.5–13.5	CME-3	5/5	NA	CH	(8.5-16) CLAY; mottled rd brn; lt gray; high plas; tr. silt; mostly clay; tr. vf-med qtz sands; tr. granitic (v. weathered) pebs; v. stiff; damp; slickensided; no odor; MnOx stain; abundant FeOx nods [Ferrel view]
	15	13.5–18.5	CME-4	5/5	NA		
	20	18.5–23.5	CME-5	5/5	NA	CL	(16-29) Silty CLAY; rd brn; med plas; some silt; some clay; little vf qtz, subang sand; tr. high weathered granitic pebs; abundant MnOx stain; no odor; v stiff
	25	23.5–28.5	CME-6	5/5	NA.		-> peb content w/ depth [CLAY FILL]

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP-476, Task 15
Hole Number: T8A-1-5

Project: TCE SOURCE INVESTIGATION
Location: NW CORNER OF T8A (OUTSIDE FENCE)

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	25	23.5 – 28.5	CME-6	5/5	NA	CL	(See pg. 1 for description) [CLAY FILL]
	30	28.5 – 33	CME-7	4.5/4.5	NA	GC	(29-33) Clayey GRAVEL; white & lt. gry subround gravel; red clay matrix; little v. plas fines; v. dense; gravel is chert & lo up to 3" max; damp; p. sorted; gravel mod weathered; no odor [Residuum]
	35						Boring terminated @ 33' bgs due to auger/sampler refusal upon impenetrable Residuum
	40						Boring backfilled w/ bentonite slurry upon completion
	45						Samples collected in 1 gal Ziplocs @ 2.5' intervals as composites for PID headspace analysis.
	50						

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2

Project Number: WP-476, Task 15

Hole Number: TSA-1-6

Project: TCE SOURCE INVESTIGATION	Location: NW CORNER OF TSA
Coordinates: 1042043.73 N 753555.03E	Drilling Contractor: GEOTECHNOLOGY
Drill Make and Model: CME-55 ATV MOUNT	Depth Top of Rock: NA; Depth Casing & Size: NA; Hole Size: 8.5"
Elevation: 662.51	Angle from Vert. and Bearing: VERTICAL (0°); Depth Bottom of Hole: 38' bgs
Water Level: NA	Fluid & Additives: NA; Date Start: 2/10/99; Date Finish: 2/10/99; Logger: N. BOSS

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	0	0–3	CME-1	3/3	NA	CL	(0-6.5) Silty CLAY; mottled rd brn & lt.gry; high plas; little silt; some clay; tr. vf-m qtz sand; tr-little subang fresh ls gravel; damp; reworked; compressed; no odor; MnOx stain; FeOx nodules [Ferrelview Fill]
	5	3–8	CME-2	5/5		OL	(5-6.5) Silty CLAY; blk; sl-med plas; little silt; some clay; tr. subang ls gravel road base; damp; organic odor; roots [Remnant Topsoil]
	10	8–13	CME-3	5/5		CH	(6.5-16) CLAY; mottled rd brn & lt.gry; high plas; trace silt; some clay; tr. vf subang qtz sand; v.stiff; damp-dry; no odor; MnOx stain; FeOx nodules; [Native Ferrelview] -> sand to 25% from 8-11' bgs
	15	13–18	CME-4	5/5			
	20	18–23	CME-5	5/5		CL	(16-32) Silty CLAY; rd brn; med plas; some silt; some clay; little vf, qtz, subang sand; tr. mgn weathered granitic pebbles; stiff; damp; no odor; MnOx stain [CLAY TILL] -> sand & < silt content from 20-22 (Sandy Silt)
	25	23–28	CME-6	5/5			

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP-476, Task 15
Hole Number: TSA-1-6

Project: TCE SOURCE INVESTIGATION
Location: NW Corner of TSA

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	25	23–28	CME-6	5/5	NA		See pg 1 for description
	30	28–33	CME-7	5/5	NA		
	35	33–38	CME-8	5/5	NA	CL	(32.5-36) Silty CLAY; lt. gry; med-high plas; some silt; some clay; stiff; laminated; dry; no odor; FeO stain tr. granitic pebbs [Basal Till]
						GC	(36-38) Clayey GRAVEL; white chert; 1s gravel (up to 3"); little plas fines; clay matrix is red brn; v. dense; dry; p sorted; gravel = weathered [Residuum]
	40						Boring terminated @ 38' bgs due to sampler/auger refusal upon impenetrable Residuum. Boring back-filled w/ bentonite slurry.
	45						- Samples collected in 1 gal Ziploc @ 2.5' intervals as composite for on-site PID head space screening

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES DIVISION

BOREHOLE LOG

Sheet 1 of 2
Project Number: Task 852
Hole Number: TSA-1-7

Project: TCE at the Chem. Plant	Location: Inside TSA - NW
Coordinates: 1041970.78N 753568.11E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75, H.S. auger	Depth Top of Rock: 38'
Depth Casing & Size: —	Hole Size: 4¼"/8¼"
Elevation: 661.84	Angle from Vert. and Bearing: Vertical
Depth Bottom of Hole: 39.5'	
Water Level: —	Fluid & Additives: —
Date Start: 1015 2/10/99	Date Finish: 1420 2/10/99
Logger: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER (3.0")	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0			Reworked Ferrelview Clay - Fill trace gravel.
	5	5.0					
1025		5.0	CME 2	5.0'			Fat Clay (CH), dark gray, moist, stiff 6.5-7.5 - limestone gravel with clay matrix, probable old road. 7.5-10.0 - lean clay (CL), olive gray, moist, stiff - Fill
	10	10.0					
		10.0	CME 3	5.0'			CL 10.5' Lean clay, silty, orange brown & light gray with abundant black MnO and abundant FeO nodules, moist, v. stiff Ferrelview 13.4
	15	15.0					CH Fat clay, mottled orange brown with some light gray, ¼" FeO nodules, moist, very stiff, massive. Ferrelview 15.0'
			CME 4	5.0'			Fat Clay (CH) ~20% sand, some fine to coarse gravel, mottled orange brown & light gray, FeO nodules, MnO streaks, moist v. stiff CLAY TILL 17.5
	20	20.0					Fat clay (CH) trace sand, mottled orange/brown light gray, black, massive moist very stiff, slickensided 20'
		20.0	CME 5	5.0			Fat Clay (CH) ~10% fine to crse sand ~5% fine gravel. Mostly yellow brown with some light gray, considerable black MnO. Moist, v. stiff. CLAY TILL
	25	25.0					

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-1-7

Project: TCE at the Chem Plant
Location: Inside TSA, NW

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
1330		25.0	CME 6	5.0'			Fat Clay (CH) ~15% sand & ~10% fine gravel, mottled yellow brown, orange brown, light gray & black, some FeO nodules, MnO streaks, moist very stiff, highly plastic CLAY TILL
	30	30.0					
		30.0	CME 7				32.5'
345						34.5	Fat Clay (CH) mottled reddish brown, orange brown, some light gray and black FeO nodules, moist, v. stiff - highly plastic CLAY TILL
	35	35.0					Clayey gravel, red high plastic clay matrix (GC) Residuum
		35.0	CME 8				As above, red, orange brown, light brown black, zones of less gravel 38'
		38.0	SPT		28 28 30		Chert and weathered limestone.
		39.5					
	40						T.D. 39.5' 1420 2/10/99
							hole backfilled with Grout Well bentonite slurry
	45						

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA1-8

Project: TCE SOURCE INVESTIGATION	Location: NW CORNER OF TSA (OUTSIDE FENCE)
Coordinates:	Drilling Contractor: GEOTECHNOLOGY

Drill Make and Model:	Depth Top of Rock:	Depth Casing & Size:	Hole Size:
CME-55 ATV MOUNT	32	NA	8.5"

Elevation:	Angle from Vert. and Bearing:	Depth Bottom of Hole:
	VERTICAL (0°)	32.5'

Water Level:	Fluid & Additives:	Date Start:	Date Finish:	Logger:
NA	NA	2/19/99	2/19/99	N. BOSS

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	0	0–3	CME-1	3/3	NA	FILL	Ls. gravel road base (0-1')
						OL	(1-5') Silty CLAY; blk; sl-med plas; little silt; some clay; damp; firm; org odor; tr. qtz sand; roots appears reworked/compressed (Fill?) [Topsoil]
	5	3–8	CME-2	5/5	NA	ML	(5-8.5') Clayey SILT; rd brn; sl plas; little clay; mostly silt; tr. vf sand; damp-dry; no odor; FeOx stain; firm; loess?; fissile - solvent odor from 6-8' [Roxana Silt]
	10	8–13	CME-3	5/5	NA	CH	(8.5-14) CLAY; mottled rd brn; lt. gray; high plas; tr. silt; some clay; tr. vf subang qtz; feld sand; occ v. weathered granitic pebs; v. stiff; damp; no odor; MnOx stain; FeOx nodules; slickensided [Native Ferndale]
	15	13–18	CME-4	5/5	NA	CL	(14-26) Silty CLAY; rd brn; med plas; some silt; some clay; little vf qtz, subang sand; abundant MnOx stain; tr. fine gravel granitic pebs; firm
	20	18–23	CME-5	5/5	NA		-> fine-med qtz sand content from 18-22 (up to 20%)
	25	23–28	CME-6	5/5	NA		[CLAY TILL]

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA1-8

Project: TCE SOURCE INVESTIGATION
Location: NW CORNER OF TSA (OUTSIDE FENCE)

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	25	23				CL	See pg. 1 for description [CLAY TILL]
		28	OME-6	5/5	NA	GC	(26-32) Clayey GRAVEL; white; lt. gry subround-subang; gravel; rd-brn clay matrix; little v. plas fines; v. dense; gravel is chert & lo up to 3" max; dense; p. sorted; gravel is mod weathered - matrix changes to lt gry in color [Residuum]
		28	OME-7	4.5/4.5	NA		
	30						
		32.5				LS	(32-32.5') Weathered Limestone; lt. gry (N6); sl. fossiliferous; mod weathered; fine-grained; high porosity; high vesc to HCl; mod hard [Burlington-Keokuk]
	35						
							Boring terminated @ 32.5' bgs due to refusal upon confirmed bedrock. Boring backfilled w/ bentonite slurry.
	40						- Samples collected in 1 gal Ziplocs @ 2.5' intervals as composites for onsite PID head space screening.
	45						
	50						
	55						

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2

Project Number: WP-476, TASK 15

Hole Number: TSA 2-1

Project: TCE SOURCE INVESTIGATION	Location: West side of TSA (Outside fence)
Coordinates: 1041778.19N 753479.33E	Drilling Contractor: GEOTECHNOLOGY

Drill Make and Model	Depth Top of Rock	Depth Casing & Size	Hole Size
CME-55 ATV MOUNT	~26.5'	NA	8.5"

Elevation	Angle from Vert. and Bearing	Depth Bottom of Hole
654.15	VERTICAL (0°)	26.5'

Water Level	Fluid & Additives	Date Start	Date Finish	Logger
NA	NA	2/18/99	2/18/99	N. BOSS

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0–3	CME-1	3/3	NA	CL	(0-4) Silty CLAY; mottled rd brn & lt gry; high plas; little silt; some clay; tr vf-m qtz sand; tr-little roots; damp; stiff-v stiff; reworked; no odor; MnOx & FeOx stain; 0-1.5' is highly organic [Ferrelview Fill]
5		3–8	CME-2	5/5	NA	ML	(4-7) Clayey SILT; rd brn; sl plas; little clay; mostly silt; tr vf sand; damp-dry; no odor; Fe Ox stain; loess?; firm [Roxana Silt]
10		8–13	CME-3	5/5	NA	CH	(7-14) CLAY; mottled rd brn & lt gray; high plas; tr silt; some clay; tr vf subang qtz & feld sand; v stiff; damp; no odor; MnOx stain; Fe Ox nodules [Ferrelview Native]
15		13–18	CME-4	5/5	NA	CL	(14-23.5) Silty CLAY; rd brn; med plas; some silt; some clay; little vf qtz & feld sand; tr high weather granitic pebs; v stiff; damp; no odor; abundant MnOx stain
20		18–23	CME-5	5/5	NA		- < stiffness & fissile [CLAY TILL]
25		23–26.5	CME-6	3.5/3.5	NA	GC	(23.5-26.5) Clayey GRAVEL; lt gry gravel; rd brn matrix; little plas fines; v dense; gravel is subang chert & lc; damp; poorly sorted; weathered; no odor [Residuum]

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA 2-1

Project: TCE SOURCE INVESTIGATION
Location: West side of TSA (outside fence)

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION: Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol
	25	23 26.5	DME-6	35/35	NA	GC	See pg 1 for description [Residuum]
							Boring terminated @ 26.5' bgs due to auger / sampler refusal upon impenetrable Residuum.
	30						Boring backfilled w/ bentonite slurry upon completion.
	35						Samples collected in 1 gal Ziploc @ 2.5' intervals as composites for PID headspace analysis.
	40						
	45						
	50						
	55						

-= 84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA-2-2

Project: TCE SOURCE INVESTIGATION	Location: West side of TSA (outside fence)
Coordinates: 1041732.92N 753486.52	Drilling Contractor: GEOTECHNOLOGY

Drill Make and Model	Depth Top of Rock	Depth Casing & Size	Hole Size
CME-55 ATV MOUNT	NA	NA	8.5"

Elevation	Angle from Vert. and Bearing	Depth Bottom of Hole
656.06	VERTICAL (0°)	27.5'

Water Level	Fluid & Additives	Date Start	Date Finish	Logger
NA	NA	2/18/99	2/18/99	N. BOSS

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0–4	CME-1	4/4	NA	FILL CL/OL	(0-3) Silty CLAY; mottled rd brn & lt gray; high plas; little silt; some clay; tr. vf-med gray sand; damp; stiff-v stiff; reworked; no odor; 0-1.5' w highly organic [Ferrelview Fill]
5		4–9	CME-2	5/5	NA	ML	(3-6.5) Clayey SILT; rd brn; sl. plas; little clay; mostly silt; damp-dry; tr. vf-sand; no odor; abundant MnOx stain; firm; loess? <Roxana SILT>
10		9–14	CME-3	5/5	NA	CH	(6.5-14.5) CLAY; mottled rd brn & lt gray; high plas; tr. silt; mostly clay; tr vf subang-subround gray feld sand; v. stiff; damp; no odor; MnOx stain; FeOx nods [Native Ferrelview]
15		14–19	CME-4	5/5	NA	CL	(14.5-24.5) Silty CLAY; rd brn; med plas; some silt; some clay; little gray feld sand; tr. granitic pebs; v. stiff; damp; no odor; abundant MnOx stain
20		19–24	CME-5	5/5	NA	CL	->silt w/ depth, fissile
25		24–27.5	CME-6	3.5/3.5	NA	GC	See pg 2 for description [Residuum]

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA-2-2

Project: TCE SOURCE INVESTIGATION
Location: West side of TSA (outside fence)

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	25	24					(24-27.5) Clayey GRAVEL; lt. gray-white gravel; rd brn clay matrix; little plas fines; v dense; gravel is sub-ang chert; lo; damp; p sorted; weathered; no odor
		27.5	Cone-6	3.5/3.5	NA	GC	[Residuum]
	30						Boring terminated @ 27.5' bgs due sampler) auger refusal upon impenetrable Residuum.
	35						Boring backfilled w/ bentonite slurry upon completion.
							Samples collected in 1 gal Ziplocs @ 2.5' intervals as composites for PID headspace analysis
	40						
	45						
	50						
	55						

== 84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: Task 852
Hole Number: TSA-2-3

Project: TCE at the Chem Plant	Location: W. side TSA, outside Fence: offset hole ~25' W.
Coordinates: 104167.71N 753480.84E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 H.S. auger	Depth Top of Rock: Possibly 34'
Depth Casing & Size: —	Hole Size: 4 1/4" / 8 1/4"
Elevation: 656.27'	Angle from Vert. and Bearing: vertical
Depth Bottom of Hole: 34'	
Water Level: —	Fluid & Additives: —
Date Start: 1445 2/4/99	Date Finish: 1445 2/4/99
Logged: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		.0	CME 1	5.0			Lean clay (CL) dark brown, some organics Moist FILL 2.5'
	5	5.0	CME 2	5.0			Fat clay (CH) mottled orange brown and black, v. stiff, some FeO Nodules FERREL VIEW CLAY as above, massive, some FeO & MnO nodules, v. stiff (3.0).
	10	10.0	CME 3	5.0			mostly light gray, slickensided
	15	15.0	CME 4	5.0'			17.0 Fat Clay (CH) with ~15% sand and fine gravel, mottled orange brown and light gray - some MnO streaks v. stiff CLAY TILL
	20	20.0	CME 5	5.0'			at 23.5' abundant fine gravel angular limestone
	25	25.0					

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-2-3

Project: TCE at the Chem. Plant
Location: W. Side TSA, outside fence, offset hole ~25' to west

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION: Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol
		25.0	CME 6	4.0'			Gravel with fat clay, gravel weathered and soft. Clay orange brown, gravel light gray. CLAY TILL
		30.0			LOSS		
	30		CME 7	2.0			As above -
		34.0			LOSS		
	35						T.D. 34', auger refusal. 1445 2/24/99. Hole backfilled with Grout well bentonite.

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: Task 852
Hole Number: TSA-2-4

Project: TCE at the Chem. Plant	Location: W. of TSA, outside fence, offset hole ~4'
Coordinates: 1041619.59 N 753483.70 E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 H.S. augers	Depth Top of Rock: probable 37.5
Depth Casing & Size: —	Hole Size: 4 1/4" / 8 1/4"
Elevation: 658.12	Angle from Vert. and Bearing: vertical
Depth Bottom of Hole: 37.5'	
Water Level: —	Fluid & Additives: —
Date Start: 1025 2/4/99	Date Finish: 1410 2/4/99
Logger: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0'			Lean Clay (CL), brown, some roots, moist, minor gravel - FILL. Increase Gravel at 3', dark brown. 3.5'
	5	5.0					Lean Clay (CL), mottled brown and light brown, dark brown, some FeO nodules - FERRELVIEW CLAY (Roxanna-Lake)
		5.0	CME 2	5.0'			as above 8'
	10	10.0					Fat Clay (CH) mottled, orange brown and light gray, moist, stiff to very stiff (2.0) Ferrelview
		10.0	CME 3	5.0			CH as above - massive. Some slickensides and FeO nodules
	15	15.0					
		15.0	CME 4	5.0'			Predominantly light gray at 17.5' becoming sandy. at 19.5' - 1" Sand lense.
	20	20.0					
		20.0	CME 5	5.0			22.5'
	25	25.0					Fat Clay with Sand (CH), ~15% - minor fine gravel, mottled yellow brown to orange brown, light brown, some MnO, CLAY TILL

04062

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-2-4

Project: TCE at the Chem. Plant
Location: W. side TSA - outside fence

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		25.0	CME 6	2½'	TSA-2-4 25.0-27.5		Increase in gravel.
		20.0			LO SS		
	30	30.0	CME 7	2½'	TSA-2-4 30.0-32.5		Fat clay with angular limestone gravel up to 2"; some chert. Clay orange brown. CLAY TILL; possibly Residuum.
		35.0			LO SS		35
	35		CME 8	2½'			As above, predominantly yellow brown. Probable residuum
		37.5					T.D. 37.5' auger refusal 1410 2/4/99. Probable bedrock. Hole back filled with Grout Well bentonite

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2

Project Number: Task 852

Hole Number: TSA-3-1

Project: TCE at the Chem. Plant	Location: Outside fence, W. side TSA · offset hole ~15' west
Coordinates: 1041461.85N 753480.41	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 H.S. auger	Depth Top of Rock: ~30
Depth Casing & Size: —	Hole Size: 4 1/4" / 8 1/4"
Elevation: 656.11	Angle from Vert. and Bearing: vertical
Depth Bottom of Hole: 30'	
Water Level: —	Fluid & Additives: —
Date Start: 0815 2/4/99	Date Finish: 0915 2/4/99
Logger: A. Barfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER (30")	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0'			Lean Clay, dark brown, some organics, moist - Fill CL
	5	5.0					
		5.0	CME 2	5.0'			6.0' 6-7', Lean Clay, dark gray, abundant FeO & MnO nodules. Ferrelview CL 7'- Fat Clay (CH), mottled orange brown, light gray, minor FeO nodules very stiff (3.0) Ferrelview
	10	10.0					
		10.0	CME 3	5.0'			minor gravel at 14' ~15% sand at 15'
	15	15.0					
		15.0	CME 4	5.0'			at 19'- gravelly
	20	20.0					20'
		20.0	CME 5				Fat Clay (CH) ~15% sand & fine gravel / yellow brown, black, moist very stiff - CLAY TILL at 23' mostly gray & black
	25	25.0					

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number:
Hole Number: TSA - 3-1

Project: TCE at the Chem Plant
Location: W. side TSA · Outside Fence

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOL LOG	SOIL DESCRIPTION: Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol
		25.0	CME 6	40'			~~Fat Clay~~ gravelly Fat Clay with sand - yellow brown, black, light clay (gravel). Gravel is angular limestone, some chert. CLAY TILL
		30.0					T.D. 30.0' auger Refusal 0915

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: Task 852
Hole Number: TSA-3-2

Project: TCE at the Chem Plant	Location: Inside TSA
Coordinates: 1041481.03N 753620.27E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 H.S. auger	Depth Top of Rock: possibly 32'
Depth Casing & Size: —	Hole Size: 4¼" / 8¼"
Elevation: 662.39	Angle from Vert. and Bearing: Vertical
Depth Bottom of Hole: 32'	
Water Level: —	Fluid & Additives: —
Date Start: 1635 2/6/99	Date Finish: 1615 2/6/99
Logger: A. Beaufer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0			Lean Clay, some gravel, mostly olive gray, moist stiff FILL
	5	5.0					6.0'
		5.0	CME 2	5.0'			Fat Clay (CH) - mottled orange brn & light. FeO nodules, moist, v. stiff. FERRELVIEW CLAY at 8.0' - massive, highly plastic
	10	10.0					
		10.0	CME 3	5.0			as above, slickensided
	15	15.					
		15.0	CME 4	5.0			16.0 Fat CLAY, trace sand & fine grvl., mottled yellow brown & light gray, some black (MnO). Moist v. stiff CLAY TILL
	20	20.0					
		20.0	CME 5	5.0'			at 22.5'. increase in gravel and MnO.
	25	25.0					

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-3-2

Project: TCE at the Chem. Plant
Location: Inside TSA.

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		25.0	CME 6	5.0'			at 30.', 4" Clayey fine sand loose v. moist
							28.5'
		30.0					Clayey gravel - up to 1½", black with white, highly plastic clay, abundant MnO, moist, dense
	30	30.0	CME 7	2.0'			Probable Residuum
		32.0					
							T.D. 32.' refusal 1615 2/4/99
							hole grouted with Guard Well bentonite

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: Task 852
Hole Number: TSA-3-3

Project: TCE at the Chem. Plant	Location: Inside TSA (2nd hole, Moved ~3')
Coordinates: 104 1405.31 N 753555.52E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75	Depth Top of Rock: 42.5'
Depth Casing & Size: —	Hole Size: 4¼"/8¼"
Elevation: 665.0'	Angle from Vert. and Bearing: Vertical
Depth Bottom of Hole: 42.5'	
Water Level: —	Fluid & Additives: —
Date Start: 0950 2/8/99	Date Finish: 1400 2/8/99
Logger: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	TYPE & NUMBER (3.0")	RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	3½'			Lean Clay (CL) mottled orange brown and light brown, moist, v. stiff, trace gravel. Reworked Ferrelview FILL
	5	5.0					
		5.0	CME 2	5.0'			- mostly olive gray, trace gravel FILL
	10	10.0					
		10.0	CME 3	5.0'			FILL 12.0'
	15	15.0					Lean Clay (CL), silty, mottled orange brn and gray, abundant FeO nodules, moist stiff Ferrelview
		15.0	CME 4	5.0'			CL - with light gray FeO, MnO nodules, v. stiff (3.0)
	20	20.0					20'
		20.0	CME 5	5.0'			Fat Clay, ~10% sand and fine gravel, mottled orange brown, gray, moist, v. stiff at 23' - mostly light gray. CLAY TILL
	25	25.0					

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-3-3

Project: TCE at the Chem. Plant.
Location: Inside TSA

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		25.0	CME 6	5.0'			increase in gravel content at 29': heavy gravel
	30	30.0					
		30.0	CME 7	5.0			Fat Clay (CH) occasional gravel, orange brown and black, moist, stiff. at 33.5' - CH, light gray with indurated clay fragments (unusual), damp
		35.0					
		35.0	CME 8	3.5'			at 35': heavy gravel. Clay with gravel, light gray and orange brown. probably CLAY TILL ~40'
		40.0					
			CME 9				Fat Clay (CH) with chert gravel, reddish brown possibly Residuum
		42.9					
							T.D. 42.5' Refusal on bedrock 1335 2/8/99 Hole back filled with bentonite

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: Task 852
Hole Number: TSA-3-4

Project: TCE at the Chem. Plant	Location: SW Corner TSA outside fence, offset ~8'
Coordinates: 1041328.06N 753483.40	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 H.S. Auger	Depth Top of Rock: Probable 37'
Depth Casing & Size: —	Hole Size: 4¼"/8¼"
Elevation: 657.06'	Angle from Vert. and Bearing: Vertical
Depth Bottom of Hole: 37'	
Water Level: —	Fluid & Additives: —
Date Start: 1400 2/3/99	Date Finish: 1530 2/3/99
Logger: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0'	TSA A-4 0-2.5		Lean Clay with occasional limestone gravel (CL), roots to ~1.0', dark brown, moist, very stiff (2.5). Fill
					TSA-A4 2.5-5.0'		3.0' Lean Clay (CL), mottled light brown, gray orange/brown, FeO, MnO, moist, very stiff (2.5). Ferrelview. (Roxanna-like)
	5	5.0	CME 2	5.0	TSA-A-4 5.0-7.5'		mostly light gray
					TSA-A-4 7.5-10.0'		mostly orange brown.
	10	10.0	CME 3	5.0	TSA-A-4 10.0-12.5		10.0' Fat Clay, mottled orange brown and light gray, moist, very stiff (3.0). Some Slickensides
					TSA-A-4 12.5-15.0'		Abundant FeO nodules 12-14'.
	15	15.0	CME 4	5.0	TSA-A-4 15.0-17.5'		CH. mottled reddish brown, light gray + black (MnO).
					TSA-A-4 17.5-20.0'		at 17', some fine limestone gravel and angular limestone sand, white. lower Ferrelview.
	20	20.0	CME 5	5.0	TSA A-4 20.0-22.5		21.0' Fat Clay with gravel, up to 2" (CH), yellow brown + black (MnO), minor light gray. Some Sand. Clay Till
	25	25.0			TSA-A-4 22.5-25.0		

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-3-4

Project: TSA at Chem Plant
Location: SW corner TSA outside Fence

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		25.0	CME 6	5.0'	TSA-A-4 25.0'-27.5		Lean Clay (CL) minor limestone gravel, buff, damp, very stiff (PP=2.5) 27.5
					TSA-A-4 27.5'-30.0		
30		30.0					
		30.0	CME 7	5.0'			Mostly yellow brown, moist, with angular limestone and chert gravel. possibly Residuum saturated ~33'-34',
35		35.0					sample refusal
			Auger only				auger refusal 37', probable bedrock 1530 2/3/99 grouted hole with grout-well

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: Task 852
Hole Number: TSA-IS-3-5

Project: TCE at the Chem Plant	Location: Inside TSA, South end
Coordinates: 1041353.87N 753646.26E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 H.S. Auger	Depth Top of Rock: probably 31.5'
Depth Casing & Size: —	Hole Size: 4 1/4" / 8 1/4"
Elevation: 665.63	Angle from Vert. and Bearing: Vertical
Depth Bottom of Hole: 31.5'	
Water Level: —	Fluid & Additives: —
Date Start: 1415 2/6/99	Date Finish: 1500 2/6/99
Logger: A. Beafer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	TYPE & NUMBER	RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0'			Lean Clay (CL) mostly dark gray with some gravel, moist stiff - at 2.5' - mostly orange brown and gray. Reworked Ferrelview FILL
	5	5.0					some olive gray 8.0'
		5.0	CME 2	5.0'			Fat Clay (CH) mottled orange brown + gray, moist, v. stiff, abundant FeO nodules - Ferrelview.
	10	10.0					
		10.0	CME 3	4.0'			Massive, very plastic, less FeO,
	15	15.0					
		15.0	CME 4	5.0'			Slickensided, MnO
	20	20.0					
			CME 5	5.0'			as above - ~10% sand, Trace fine gravel - 23.5
	25						Fat Clay (CH) mottled yellow brn + gray, ~10% sand, trace f. gravel, moist stiff CLAY TILL

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-IS-3-5

Project: TCE at the Chem Plant
Location: Inside TSA - south end

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION: Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol
		25.0	CME 6	5.0'			Fat Clay (CH), ~15% sand, 10% fine gravel, mottled yel. brn, light gray, some black (MnO), moist v. stiff. CLAY TILL Increase in gravel, up to 2", at 29.5' abundant MnO - black
	30	30.0					
		30.0	CME 7	1.5'			abundant gravel, light brown to white. Maybe Residuum.
		31.5					
							T.D. 31.5' 1500 2/6/99 Refusal
	35						Hole grouted with Grout Well bentonite.

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Kevin Bessler driller

Sheet 1 of 2

Project Number: Task 852

Hole Number: TSA-3-6

Project: TCE at the Chem Plant	Location: SW corner TSA · outside Fence
Coordinates: 1041262.41N 753537.09E	Drilling Contractor: Geotech no 1097
Drill Make and Model: CME - 75 H.S. Auger	Depth Top of Rock: — ?
Depth Casing & Size: —	Hole Size: 4 1/4 / 8 1/4"
Elevation: 660.85'	Angle from Vert. and Bearing: Vertical
Depth Bottom of Hole: 28	
Water Level: —	Fluid & Additives: —
Date Start: 0955 2/3/99	Date Finish: 1300 2/3/99
Logger: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER (3.0")	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N) Samples	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	1	0	CME 1	3.5'	TSA-3-1		0-1.0 - Lean clay with limestone gravel, dark brown, wet, topsoil CL
	2				—		Lean Clay (CL), mottled orange brown and light brown with dark gray, minor FeO & MnO, moist, v. stiff (2.5)
	3				TSA-3-1		Ferrelview Clay (Roxanna-like)
	4	4.5					
		4.5	CME 2	5.0	TSA-3-2		
					—		
					TSA-3-2		8.5'
		9.5					Fat Clay, (CH), mottled orange brown & light gray, minor MnO, v. stiff (2.5) Ferrelview.
	10	9.5	CME 3	5.0'	TSA-3-3		at 12' mostly light gray
					—		
					TSA-3-3		
		14.5					
	15	14.5	CME 4	5.0'	TSA-3-4		As above
					—		
					TSA-3-4		
		19.5					
	20	19.5	CME 5	5.0'	TSA-3-5		at 20', with fine limestone gravel and angular sand, white, ~ 15% Lower Ferrelview
					—		
					TSA-3-5		
		24.5					24.5'
	25	24.5					

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-3-6

Project: TCE at the Chem. Plant
Location: SW corner TSA.

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
			CME 6				Lean Clay with localized coarse limestone gravel, (CL), localized abundant MnO, yellow brown, black, moist. CLAY TILL
		29.5					Refusal, T.D. 28.0'. Probably Not bedrock. Clay Till too thin. 1300 2/3/99. grouted hole with 3, 50# bags of Grout-well.
	30						

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA 3-7

Project: TCE SOURCE INVESTIGATION	Location: SW CORNER OF TSA (outside fence)
Coordinates: 104426.5.30 N, 753645.58 E	Drilling Contractor: GEOTECHNOLOGY

Drill Make and Model	Depth Top of Rock	Depth Casing & Size	Hole Size
CME-55 ATV MOUNT	37	NA	8.5"

Elevation	Angle from Vert. and Bearing	Depth Bottom of Hole
664.54'	VERTICAL (0°)	37

Water Level	Fluid & Additives	Date Start	Date Finish	Logger
NA	NA	2/17/99	2/17/99	N. BOSS

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0–5	CME-1	5/5	NA	OL	(0-2) Silty CLAY; blk; sl-med plas; little silt; some clay; damp; firm; org odor; tr qtz sand; roots; [TOPSOIL]
						ML	(2-7.5) Clayey SILT; rd brn; sl plas; little clay; mostly silt; tr vf sand; damp-dry; no odor; FeOx stain; firm; loess?; fissile; abundant FeOx nods [Roxana Silt]
	5	5–10	CME-2	5/5	NA	CH	(7.5-20) CLAY; mottled rd brn & lt.gry; high plas; tr silt; some clay; tr vf subang qtz & feld sand; occ v weathered granitic pebs; v stiff; damp; no odor; MnOx stain; FeOx nods; slickensided [Native Fernelview]
	10	10–15	CME-3	5/5	NA		
	15	15–20	CME-4	5/5	NA		
	20	20–25	CME-5	5/5	NA	CL	(20-26.5) Silty CLAY; rd brn; med plas; some silt; some clay; little vf qtz, subang sand; abundant MnOx stain; tr rounded granitic pebs; firm [CLAY TILL]
	25	25–32	CME-6	5/5	NA		

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA3-7

Project: TCE SOURCE INVESTIGATION
Location: SW CORNER OF TSA (OUTSIDE FENCE)

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	25	25–30	CME-6	5/5	NA	CL	See pg. 1 for description [CLAY TILL]
	30	30–35	CME-7	5/5	NA	GC	(26.5-37) Clayey GRAVEL; lt. gry-white gravel; rd brn-rd clay matrix; little plas fines; v. dense; gravel is subang chert & ls; damp; p. sorted; weathered; no odor
	35	35–37	CME-8	2/2	NA	GC	- clay matrix grades to lt. gray & > to 50% [Residuum]
	40						Boring terminated @ 37' bgs due to sampler/auger refusal upon suspected bedrock.
	45						Boring backfilled w/ bentonite slurry upon completion.
	50						Samples collected in 1 gal Ziploc @ 2.5' intervals as composite for PID headspace analysis.
	55						

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: Task 852
Hole Number: TSA-3-B

Project: TCE at the Chem Plant	Location: Inside the TSA, South end. offset hole ~5' N
Coordinates: 1041321.03N 753708.15E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 H.S. auger	Depth Top of Rock: 31'+
Depth Casing & Size: —	Hole Size: 4¼"/8¼"
Elevation: 666.95'	Angle from Vert. and Bearing: vertical
Depth Bottom of Hole: 31'	
Water Level: —	Fluid & Additives: —
Date Start: 1615 2/5/99	Date Finish: 0840 2/6/99
Logger: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER (30")	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0'			Lean Clay (CL) mottled orange brown & light brown with FeO nodules, moist, stiff. Reworked Ferrelview at 2.5', dark brown to olive gray minor gravel FILL
	5	5.0					
		5.0	CME 2	5.0'			7.5' Silty Lean Clay (CL), mostly light brown, stiff with MnO + FeO nodules, moist Ferrelview Clay Roxanna-like
	10	10.0					
		10.0	CME 3	5.0'			12.5 Fat Clay (CH), mottled orange brown & light gray, with FeO nodules, massive, moist, v. stiff Ferrelview
	15	15.0					
		15.0	CME 4	5.0'			at 18', mottled reddish brown & light gray, increased MnO.
	20	20.0					
		20.0	CME 5	5.0'			as above, reddish brown, trace sand + fine gravel. Lower Ferrelview
	25	25.0					25

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-3-8

Project: TCE at the Chem Plant
Location: inside TSA, south end

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION: Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol	
		25.0	CME 6	50'			Fat Clay (CH), Minor gravel, ~10% Sand, Mottled yellow brown, black, some light gray, moist, V. stiff. 29-30" Abundant MnO Clay TILL	2/5/99
		30.0					gravelly, light gray, damp	
		31.0	CME 7				T.D. 31' 0845 2/6/99 Auger Refusal. Probably Not bedrock, Clay Till too thin. Hole backfilled with Grout well bentonite.	08 2/6/99
	40							

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: Tas 852
Hole Number: TSA-4-1

Project: TCE at the Chem Plant	Location: Inside TSA - NE
Coordinates:	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 H.S. auge	Depth Top of Rock: 45'
Depth Casing & Size: —	Hole Size: 4¼"/8¼"
Elevation:	Angle from Vert. and Bearing: Vertical
Depth Bottom of Hole: 45.5'	
Water Level: —	Fluid & Additives: None
Date Start: 1240 2/11/99	Date Finish: 0920 2/12/99
Logger: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0			Reworked Ferrelview - Fill 4.0'
	5	5.0					Lean clay (CL), silty, abundant FeO & MnO, mottled orange brown light brown, minor gray, moist: stiff. Ferrelview 8: (Roxana-like)
		5.0	CME 2	5.0'			
	10	10.0					Fat clay (CH), mottled orange brown and light gray, FeO and MnO nodules, massive, v. stiff. Ferrelview
		10.0	CME 3	5.0			as above, mostly orange brown with streaks of light gray, slickensided.
	15	15.0					at 15', mostly light gray with minor orange brown.
		15.0	CME 4	5.0			at 17' - MnO streaks appear. Ferrelview 19.0'
	20	20.0					Fat clay (CH) ~10% sand; trace fine gravel, orange brown with minor light gray, abundant MnO fracture coating, some FeO nodules, moist v. stiff. CLAY TILL
	1225						

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-4-1

Project: TCE at the Chem Plant
Location: inside TSA, NE

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		20	CME 5	5.0'			Fat clay (CH) ~15% sand, minor fine gravel, mostly yellow brown with light gray and black streaks (MnO), moist, v. stiff. CLAY TILL
2/11/99	25	25.0					
2/12/99 0800		25.0	CME 6	5.0'			CH as above, ~10% gravel.
	30	30.0					
		30.0	CME 7	5.0'			CH as above, light gray follows fractures such as desiccation cracks and possibly old slickensides, black MnO coats fractures
	35	35.0					
		35.0	CME 8	5.0'			at 32.5', Fat clay (CH), red with minor light gray, highly plastic, minor sand, moist, v. stiff. likely residuum (39)
	40	40.0					Clayey gravel (GC) angular chert with red highly plastic clay matrix, moist, dense. Residuum
2/05		40.0	CME 9	4.0'			at 40', ~~clay~~ matrix brown, black possibly highly weathered limestone in sampler tip.
		45.0			Loss		45.0'
							weathered limestone
							T.D. 45.5', Refusal on bedrock 0920, 2/12/99. Hole backfilled with Grout Well bentonite slurry.

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: WP-476, Task 15
Hole Number: TSA4-2

Project: TLE Source Investigation	Location: NE Corner of TSA
Coordinates: 1041937.33 N, 753876.70 E	Drilling Contractor: GEOTECHNOLOGY

Drill Make and Model	Depth Top of Rock	Depth Casing & Size	Hole Size
CME-55 ATV MOUNT	-39	NA	8.5"

Elevation	Angle from Vert. and Bearing	Depth Bottom of Hole
661.34	VERTICAL (0°)	39

Water Level	Fluid & Additives	Date Start	Date Finish	Logger
NA	NA	2/12/99	2/12/99	N. BOSS

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	0	0–4	CME-1	3.5/4	NO REC FROM 0-0.5'	CL	(0-3.5) Silty CLAY; mottled rd brn & H.gry; high plas; little silt; some clay; tr. vf-m qtz sand; damp; v.stiff; reworked; no odor; MnOx stain; FeOx nodules stain [Ferrelview Fill]
	5	4–9	CME-2	5/5	NA	OL	(3.5-5) Silty CLAY; blk; sl-med plas; little silt; some clay; damp; firm; organic odor; tr sand; roots [Remnant Topsoil]
	10	9–14	CME-3	5/5	NA	CH	(5-16.5) CLAY; mottled rd brn & H.gray; high plas; little silt; some clay; tr vf qtz & feld sands; tr. granitic pebs (weathered); v stiff; damp; slickensided; no odor; MnOx stain; FeOx nodules [Native Ferrelview]
	15	14–19	CME-4	5/5	NA		
	20	19–24	CME-5	5/5	NA	CL	(16.5-33) Silty CLAY; rd brn; med plas; some silt; some clay; little vf, qtz, subang sand; tr. high weathered granitic pebs; stiff; damp-dry; no odor; - increased MnOx stain & pebs content w/ depth
	25	24–29	CME-6	5/5	NA		

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA4-2

Project: TCE Source Investigation
Location: NE CORNER OF TSA

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	25	24–29	CME-6	5/5	NA	CL	See pg 1 for description [CLAY TILL]
	30	29–34	CME-7	5/5	NA		
		34–39	CME-8	5/5	NA	GC	(33-40) Clayey Gravel; white; lt. gray gravel; red matrix; little v. glas fines; v. dense; gravel is chert; 1/s up to 3" max; damp; p. sorted; gravels mod weathered; no odor - matrix from 38-39 is v. lt. gray w/ < chert [Residuum]
	35						
	40	39–40	SS-1	1/1	NA		Boring terminated @ 39' bgs due to auger/sampler refusal upon suspected bedrock; Boring backfilled w/ bentonite slurry upon completion. Samples collected in 1 gal Ziplocs @ 2.5' intervals as composites for PID headspace analysis.

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2

Project Number: WP-476, Task 15

Hole Number: TSA5-1

Project: TCE Source Investigation	Location: Southern end of TSA
Coordinates: 1041575.34N, 753828.02E	Drilling Contractor: GEOTECHNOLOGY

Drill Make and Model	Depth Top of Rock	Depth Casing & Size	Hole Size
CME-55 ATV MOUNT	NA	NA	8.5"

Elevation	Angle from Vert. and Bearing	Depth Bottom of Hole
660.53	VERTICAL (0°)	28.5'

Water Level	Fluid & Additives	Date Start	Date Finish	Logger
NA	NA	2/9/99	2/10/99	N. BOSS

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	0	0–3	CME-1	3/3	NA	CL	(0-11.5) Silty CLAY; mottled rd. brn & lt. gray; high plas; little silt; some clay; tr. vf qtz & feld sand; v. stiff; damp; no odor; mn Ox stain; Fe Ox nodules [Native Ferrelview]
	5	3–8	CME-2	5/5	NA		
	10	8–13	CME-3	5/5	NA		
	15	13–18	CME-4	5/5	NA	CL	(11.5-27) Sandy CLAY; rd. brn; nonplastic; little vf-m qtz feld sand, subang-subround; some clay; tr. weathered granitic pebs; stiff; damp-dry; no odor; mn Ox stain; Fe Ox nodes; weathered [CLAY TILL]
	20	18–23	CME-5	5/5	NA		
	25	23–28	CME-6	5/5	NA		

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP476, TASK 15
Hole Number: TSA5-1

Project: TCE SOURCE Investigation
Location: SOUTHERN END OF TSA

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	25	23	CME-6	5/5	NA	CL	See pg 1 for description
		28				GrC	(27-28.5) Clayey GRAVEL; wh-H gry chert; lg gravel (up to 3"); little v plas fines; clay matrix is rd brn; v. dense; damp; p. sorted; sub ang - sub round gravel appears mod weathered (Residuum) no odor
		30 285	SS-1	0.5/0.5	50+		
	30						Boring terminated @ 28.5' bgs due to auger/sampler refusal upon impenetrable Residuum. TD correlates w/ previous elevation change w/ respect to TSA 5-2.
	35						Boring backfilled w/ Bentonite slurry upon completion.
							Samples collected in 1-gal Ziplocs @ 2.5' intervals as composites for PID headspace analysis.

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA5-2

Project: TCE Source Investigation	Location: SE Corner of TSA
Coordinates: 1041471.95N 753832.04E	Drilling Contractor: Geotechnology

Drill Make and Model	Depth Top of Rock	Depth Casing & Size	Hole Size
CME-55 ATV Mount	N/A	NA	8.5"

Elevation	Angle from Vert. and Bearing	Depth Bottom of Hole
662.20'	VERTICAL (0°)	30' bgs

Water Level	Fluid & Additives	Date Start	Date Finish	Logger
DRY	NA	2/8/99	2/8/99	N. Boss

Elevation	Depth Below Surface	Sample Interval	Sample Type & Number	Sample Recovery	Standard Penetration Test Results 6"-6"-6" (N)	Symbolic Log	Soil Description (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	0	0–3.5	CME-1	3.5/3.5	NA	CL	(0-13.5) Silty CLAY; mottled rd. brn & l. gray; high plas; little silt; some clay; tr. vf. qtz & feld sands; v. stiff-hard; damp; slickensided; no odor; Mn Ox stain; Fe Ox nodules; [Native Fernleaf View]
	5	3.5–8.5	CME-2	5/5	NA		- < mottling to light gray
	10	8.5–13.5	CME 3	5/5	NA		-> increasing sand & Mn Ox w/ depth
	15	13.5–18.5	CME-4	5/5	NA	CL	(13.5-28) Silty CLAY; rd brn; med plas; some silt; some clay; little vf, qtz, subang sand; tr, highly weathered granitic pebbs; stiff; damp-dry; no odor; abundant Mn Ox stringers; weathered. [CLAY TILL]
	20	18.5–23.5	CME 5	5/5	NA		
	25	23.5–28.5	CME-6	5/5	NA		

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA5-2

Project: TCE SOURCE INVESTIGATION
Location: SE CORNER OF TSA

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	25	25.5 – 28.5	CME-6	5/5	NA	CL	(15.5-28). See pg 1 for description
		28.5 – 30.0	CME-7	1.5/1.5	NA	GC	(28-30) Clayey GRAVEL; white - lt gray chert; lt gravel (up to 3"); little v. pins fines; clay matrix is red. brn; v. dense; damp; poorly sorted subangular - subround gravel; coarse mod weathered Residuum
	30						Boring terminated @ 30' bgs due to auger / sampler refusal upon impenetrable Residuum. Boring backfilled w/ bentonite slurry.
	35						- Samples collected in 1 gal Ziplocs @ 2.5' intervals as composites for on-site PID headspace screening.

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: Task 852
Hole Number: TSA-5-3

Project: TCE at the Chem. Plant	Location: Inside TSA, SE
Coordinates: 1041339.66N 753831.92E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 H.S. auger	Depth Top of Rock: Possibly 35'
Depth Casing & Size: —	Hole Size: 4¼" / 8¼"
Elevation: 666.26'	Angle from Vert. and Bearing: Vertical
Depth Bottom of Hole: 35'	
Water Level: —	Fluid & Additives: —
Date Start: 1500 2/8/99	Date Finish: 1615 2/8/99
Logger: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER (3.0")	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0'			Lean Clay (CL), Silty, Mottled orange brn & gray, Moist, Stiff, with 1/4" MnO nodules - Ferrelview Roxanna-like
	5	5.0					
		5.0	CME 2	5.0'			9'
	10	10.0					Fat Clay (CH) Mottled orange brn + gray, Moist, V. Stiff, Massive, FeO nodules Ferrelview CLAY highly plastic, slickensided, orange brown & light gray, 1/16" FeO nodules. Trace white angular sand. Trace fine gravel.
		10.0	CME 3	5.0'			
	15	15.0					
		15.0	CME 4	5.0'			19.0'
	20	20.0					Fat Clay, ~15% sand & fine grvl, orange brown with light gray & black streaks (MnO), Moist, V. Stiff. CLAY TILL - increase in sand + grvl + MnO.
		20.0	CME 5	5.0'			
		25.0					

8406?

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-5-3

Project: TCE at the Chem Plant
Location: Inside TSA, SE corner

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		25.0	CME 6	5.0'			Pockets of weathered limestone gravel. 27.5'-30.0' - less sand & gravel, highly plastic, slickensided, FeO nodules CLAY TILL
	30	30.0					
		30.0	CME 7	5.0			Fat clay with gravel pockets orange brown, red, gray black
							34'
	35	35.0					~~Gravel with~~ Clayey Gravel, light gray, clay highly plastic, Chert + weathered limestone Probable Residuum
							T.D. 35', refusal. 1615 2/8/99
							hole grouted with Grout well Bentonite Made by Wyo-Ben. 3, 50# bags mixed with 26-gals water/bag.

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA-5-4

Project: TCE SOURCE INVESTIGATION	Location: SE CORNER OF TSA (outside fence)
Coordinates: 1041255.53N, 753858.47E	Drilling Contractor: GEOTECHNOLOGY

Drill Make and Model	Depth Top of Rock	Depth Casing & Size	Hole Size
CME-55 ATV MOUNT	NA	NA	8.5"

Elevation	Angle from Vert. and Bearing	Depth Bottom of Hole
671.62'	VERTICAL (0°)	40

Water Level	Fluid & Additives	Date Start	Date Finish	Logger
NA	NA	2/17/99	2/17/99	N. BOSS

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0–4	CME-1	2/4	NO REC FROM 0-2'		(0-2) GRAVEL, ls, road base
						CL	(2-5) Silty CLAY; mottled rd brn & lt.gry; high plas; little silt; some clay; tr gty sand; damp; stiff; reworked; no odor; MnOx stain & FeOx nods [Fervelrow Fill]
	5	4–9	CME-2	5/5	NA	CH	(5-26.5) CLAY; mottled rd brn & lt.gray; high plas; tr. silt; mostly clay; tr vf-med gty sands; v. stiff; damp; slickensided; no odor; MnOx stain; FeOx nods
	10	9–14	CME-3	5/5	NA		
	15	14–19	CME-4	5/5	NA		
	20	19–24	CME-5	5/5	NA		
	25	24–29	CME-6	5/5	NA		[Native Fervelrow]

0837

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP-476, TASK 15
Hole Number: TSA-5-4

Project: TCE SOURCE INVESTIGATION
Location: SE CORNER OF TSA (OUTSIDE

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	25	24–29	CME-6	5/5	NA	CH	See pg. 1 for description [Native Ferrelvale]
	30	29–34	CME-7	5/5	NA	CL	(26.5-37.5) Silty CLAY; rd brn; med plas; some silt; some clay; little vf gty; subang sand; tr. high weathered granitic pebs; abundant MnOx stain; no odor; stiff
	35	34–39	CME-8	5/5	NA		[CLAY TILL]
		39–40	CME-9	1/1	NA	GC	(37.5-40) Clayey GRAVEL; ltgry subang chert gravel; rd brn clay matrix; little plas fines; v. dense; damp, p. sorted; weathered; no odor [Residuum]
	40						Boring terminated @ 40' bgs due to sampling / auger refusal upon impenetrable Residuum.
	45						Boring back filled w/ bentonite slurry upon completion.
	50						Samples collected in 1 gal Ziploc @ 25' intervals as composites for PID headspace analysis
	55						

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2

Project Number: Task 852

Hole Number: TSA-6-1

Project: TCE at the Chem Plant	Location: Inside TSA, SE
Coordinates: 1041500.75N 753936.36E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75, H.S. Auger	Depth Top of Rock: 35.0'
Depth Casing & Size: —	Hole Size: 4¼"/8¼"
Elevation: 665.39	Angle from Vert. and Bearing: Vertical
Depth Bottom of Hole: 35.5	
Water Level: —	Fluid & Additives: —
Date Start: 0750 2/10/99	Date Finish:
Logger: H. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	TYPE & NUMBER (3.0")	RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
0800		0	CME 1	5.0'			Fat clay (CH), mottled orange brown with minor light gray, minor FeO nodules, more abundant 0-1.5', massive, moist, v. stiff. Ferrelview Clay - upper Ferrelview missing.
	5	5.0					
0805		5.0	CME 2	5.0'			CH as above, from 5-7.5', predominantly light gray; from 7.5'-10.0' mostly orange brown, slickensided
	10	10.0					
		10.0	CME 3	5.0'			CH as above, trace sand & fine gravel, MnO streaks, slickensided
	15	15.0					14.0' Fat Clay (CH), ~20%, well graded sand, trace fine gravel, mottled yellow brown and light gray with black streaks (MnO) moist, v. stiff. CLAY TILL
		15.0	CME 4	5.0'			As above, from 17.5'-20.0', increase in MnO and gravel, ~10%. MnO more disseminated instead of streaks
	20	20.0					
0830		20.0	CME 5	5.0'			As above, damp, with pockets of increased sand and gravel
		25.0					

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-6-1

Project: TCE at the Chem. Plant
Location: inside TSA, SE

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
3840		25.0	CME 6	5.0			Fat clay (CH), ~20% sand, ~10% fine to coarse gravel, mottled yellow brown, light gray and black (MnO), damp, v. stiff CLAY TILL 28.5'
	30	30.0					Fat clay (CH) ~10% sand, minor fine gravel, mottled orange brown, light gray and black, massive, moist, very stiff, slickensided, FeO nodules. CLAY TILL 30'-33': as above, reddish brown & light gray, FeO nodules, highly plastic 33.0
		30.0	CME 7	5.0'			Clayey gravel, limestone fragments up to 3", clay matrix highly plastic, light brown to black, moist Residuum 35.0'
	35	35.0	SPT		32/6"		weathered limestone
	40						T.D. 35.5', 0900, 2/10/99 Hole backfilled with Grout Well bentonite slurry

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: Task 852
Hole Number: TSA-6-2

Project: TCE at the Chem. Plant	Location: inside TSA, SE
Coordinates: 1041449.67N 753928.54E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 HS-auger	Depth Top of Rock: 34.0'
Depth Casing & Size: —	Hole Size: 4 1/4" / 8 1/4"
Elevation: 664.80'	Angle from Vert. and Bearing: vertical
Depth Bottom of Hole: 34.5'	Water Level: —
Fluid & Additives: —	Date Start: 1520 2/9/99
Date Finish: 1630 2/9/99	Logger: A. Benfer

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER (30")	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0'			Fat Clay (CH), orange brown with minor light gray, massive, ~10% FeO nodules (1~1/16"), moist, very stiff, (Roxanna-like missing; cut-?) Ferrelview Clay
	5	5.0					
1335		5.0	CME 2	5.0'			at 5', CH as above, mostly light gray with minor orange brown, FeO nodules, slickensided.
	10	10.0					
		10.0	CME 3	5.0'			CH as above, trace sand and fine gravel, mostly gray with black streaks (MnO) slickensided at 14' increase in sand, ~10% basal Ferrelview
	15	15.0					15.0'
		15.0	CME 4	5.0'			Fat Clay (CH) ~20% sand, ~5% fine gravel, mostly yellow brown with light gray and black streaks (MnO) damp, v. stiff - poker chip texture CLAY TILL
	20	20.0					
1610		20.0	CME 5	5.0'			As above, poker chips, mostly yellow brown, light gray seems to follow fractures (slickensides-?) damp.
	25	25.0					

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-6-2

Project: TCE at the Chem. Plant
Location: Inside TSA, SE

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		25.0	CME 7	5.0'			CH as above.
							27.5
							Fat CLAY (CH) trace sand, some FeO nodules, reddish brown with light gray & black following paleo. desiccation fractures, moist, v. stiff, highly plastic - CLAY TILL
30		30.0					
		30.0		4.0'			
							32.5'
							Clay w/ gravel, clay matrix highly plastic, light brown to black, moist dense, abundant MnO - Residuum.
		34.0					
35			SPT		30/6"		
							34.0
							Weathered limestone
							T.D. 34.5 @ 1630, 2/9/99
							hole backfilled with Grout Well bentonite slurry

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: Task 852
Hole Number: TSA-6-3

Project: TCE at the Chem. Plant	Location: Inside TSA, SE
Coordinates: 1041409.04N 753933.60E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 H.S. auger	Depth Top of Rock: 35.0
Depth Casing & Size: —	Hole Size: 4¼"/8¼"
Elevation: 664.25	Angle from Vert. and Bearing: Vertical
Depth Bottom of Hole: 35.5	
Water Level: —	Fluid & Additives: —
Date Start: 12 50 2/9/99	Date Finish: 1415 2/9/99
Logger: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER (30")	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0'			Fat Clay (CH) mottled orange brown & light gray, minor FeO nodules (~1/16") massive, moist, very stiff. (Roxanna-like missing, probably cut area) Ferrelview Clay
	5	5.0					
		5.0	CME 2	5.0'			Fat Clay (CH) as above, slickensided
	10	10.0					
		10.0	CME 3	5.0'			As above with trace of white angular sand grains, basal Ferrelview 12-14.5' mostly gray
	15	15.0					15.5'
		15.0	CME 4	5.0			Fat Clay (CH) with ~15% sand, yellow brown with minor light gray and black streaks (MnO), moist very stiff some fine gravel. CLAY FILL at 18', increase in sand & grvl-
	20	20.0					
		20.0	CME 5	5.0'			Fat Clay as above, slight increase in sand and fine gravel, also MnO. CLAY FILL
	25	25.0					

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-6-3

Project: TCE at the Chem. Plant
Location: Inside TSA, SE

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		25.0	CME 6	5.0'			Fat Clay as above.
							at 28', Fat Clay (CH), reddish brown with minor light gray, FeO nodules minor sand and gravel, some MnO streaks - CLAY TILL (Very similar to Ferrelview - is Clay Till).
	30	30.0					
		30.0	CME 7	5.0'			
							Clay Gravel (GC) well graded, Clay (CH), yellow brown to black, moist, dense 33.0'
	35	35.0					Residuum 35.0'
			SPT		30/5"		Weathered Limestone
							T.D. 35.5', 1415, 2/9/99
							Hole back filled with Grout Well bentonite slurry
	40						

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2
Project Number: Task 852
Hole Number: TSA-64

Project: TCE at the Chem Plant	Location: Inside TSA
Coordinates: 1041399.07N 753933.60E	Drilling Contractor: Geotechnology
Drill Make and Model: CME-75 H.S. auger	Depth Top of Rock: 35.0'
Depth Casing & Size: —	Hole Size: 4¼" / 8¼"
Elevation: 664.48'	Angle from Vert. and Bearing: Vertical
Depth Bottom of Hole: 35.5	
Water Level: —	Fluid & Additives: —
Date Start: 0815 2/9/99	Date Finish: 1630 2/9/99
Logger: A. Benfer	

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	TYPE & NUMBER (3.0")	RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		0	CME 1	5.0'	5		Fat Clay (CH), orange brown with minor light gray, some FeO nodules, moist, v. stiff, massive. Ferrelview. upper Ferrelview missing.
	5	5.0					
		5.0	CME 2	5.0'			As above 7.5'-10.0' - gray
	10	10.0					
		10.0	CME 3	5.0'			Fat Clay, gray, trace white sand, trace fine gravel, moist v. stiff - Ferrelview.
	15	15.0					
0900		15.0	CME 4	5.0			16.0' Fat Clay, ~20% well graded sand, ~10% fine gravel, yellow brown with some light gray & black (MnO) moist, v. stiff, CLAY TILL
	20	20.0					
0905		20.0	CME 5	5.0'			As above, slight increase in sand and gravel, gravel up to 1½". increase in MnO.
	25	25.0					

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: Task 852
Hole Number: TSA-6-4

Project: TCE at the Chem Plant
Location: Inside TSA, SE

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
		25.0	CME 6	5.0'			Fat Clay (CH) pockets of well graded sand, some gravel, fine to 1", Zones of abundant FeO nodules, Some MnO, yellow brown to reddish brown, moist, v. stiff. CLAY TILL
	30	30.0					
0915		30.0	CME 7	5.0'			Fat Clay (CH) reddish brown, minor light grayish black, ~15% sand & gravel, some FeO nodules, CLAY TILL 33.0'
	35	35.0					Gravelly Clay, yellow brown + black, highly plastic Residual. CH at 35', drove SPT to verify bedrock: SPT refusal, weathered limestone in tip.
	40						T.D. 35.5' 0920, Limestone bedrock. 2/9/99. Hole grouted with Grout Well bentonite slurry 1, 50# bag / 26 gals water

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 1
Project Number: WP-476, Task 15
Hole Number: TSA6-5

Project: TCE Source Investigation	Location: SE CORNER OF TSA
Coordinates: 1041322.18N 753933.63E	Drilling Contractor: GEOTECHNOLOGY
Drill Make and Model: CME-55 ATV-MOUNT	Depth Top of Rock: NA; Depth Casing & Size: NA; Hole Size: 8.5"
Elevation: 666.59'	Angle from Vert. and Bearing: VERTICAL (0°); Depth Bottom of Hole: 28'
Water Level: NA	Fluid & Additives: NA; Date Start: 2/9/99; Date Finish: 2/9/99; Logger: N. BOSS

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	TYPE & NUMBER	RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	0	0–3	CME-1	3/3	NA		Boring colocated ~5' North of TSA6-6. Lithology contacts were compared to TSA6-6 lith log. Lith contacts correlate exactly ∴ description from TSA6-6 should be referenced for this boring. No odor present during sampling
	5	3–8	CME-2	5/5	NA		
	10	8–13	CME-3	5/5	NA		
	15	13–18	CME-4	5/5	NA		Samples collected in 1-gal Ziplocs @ 2.5' intervals as composites for PID headspace analysis
	20	18–23	CME-5	5/5	NA		Boring backfilled w/ bentonite slurry upon completion
	25	23–28	CME-6	0/5	NA		Boring terminated @ 28' bgs due to loss of sampler. Hole was abandoned after numerous attempts to retrieve sampler within HSAs. Sampler retrieved after removing entire string of HSAs.

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet 1 of 2

Project Number: WP-476, TASK 15

Hole Number: TSA 6-6

Project: TCE SOURCE INVESTIGATION	Location: SE CORNER OF TSA
Coordinates: 1041316.97N 753934.44	Drilling Contractor: GEOTECHNOLOGY

Drill Make and Model:	Depth Top of Rock:	Depth Casing & Size:	Hole Size:
CME-55 ATV MOUNT	36' bgs	NA	8.5"

Elevation:	Angle from Vert. and Bearing:	Depth Bottom of Hole:
667.15	VERTICAL (0°)	36' bgs

Water Level:	Fluid & Additives:	Date Start:	Date Finish:	Logger:
NA	NA	2/8/99	2/9/99	N. BOSS

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	0.	0–3	CME-1	3/3	NA	CL	(0-5) Silty CLAY; mottled rd brn & ltgry; high plas; little silt; some clay; tr. vf qtz & feld sand; v. stiff; tr. sub ang fresh to gravel; damp; reworked (compressed); no odor; MnOx stain; FeOx nodules; [Ferndview FILL] - from 4-5' - grn gry w/ sl odor (organic)
	5	3–8	CME-2	5/5	NA		
		8–13	CME-3	3/5	NA	CL	(5-15) Silty CLAY; mottled rd brn & ltgry; high plas; little silt; some clay; tr. vf qtz & feld sand; v. stiff; ~~tr. subang fresh to gravel~~; damp; no odor; MnOx stain; FeOx nodules; [Ferndview (Native)] - decreasing mottling to ltgry or lw
	10						
	15	13–18	CME-4	5/5	NA	CL	(15-33) Silty CLAY; rd. brn; med plas; some silt; some clay; little vf, qtz, subang sand; tr. highly weathered granitic pebbs; stiff; damp; no odor; MnOx stain; weathered [CLAY TILL]
	20	18–23	CME-5	5/5	NA		
	25	23–28	CME-6	5/5	NA		

84062

MORRISON KNUDSEN CORPORATION
ENVIRONMENTAL SERVICES GROUP

BOREHOLE LOG

Sheet: 2 of 2
Project Number: WP476, Task 15
Hole Number: TSA6-6

Project: TRE SOURCE INVESTIGATION
Location: SE Corner of TSA

ELEVATION	DEPTH BELOW SURFACE	SAMPLE INTERVAL	SAMPLE TYPE & NUMBER	SAMPLE RECOVERY	STANDARD PENETRATION TEST RESULTS 6"-6"-6" (N)	SYMBOLIC LOG	SOIL DESCRIPTION (Name, Gradation or Plasticity, Particle Size Distribution, Color, Moisture Content, Relative Density or Consistency, Soil Structure, Mineralogy, USCS Group Symbol)
	25	23–28	CMG-6	5/5	NA	CL.	(15-33) See pg. 1 for description
	30	28–33	CMG-7	5/5	NA		
	35	33–36	CMG-8	3/3	NA	GC	(33-36) Clayey GRAVEL; white - lt gray chert; l. gravel (up to 3"); little v. plas fines; clay matrix is red brn; v. dense; damp; p. sorted; subang - subround gravel appear mod weathered [Residuum]
							@ 36' Limestone; lt gray (N6); sl. fossiliferous; sl. weathered; fine-grained; high porous; high reac to HCl; mod-hard [Burlington - Keokuk?]
	40						Boring terminated @ 36' bgs due to refusal upon confirmed bedrock. Boring backfilled w/ bentonite slurry.

- Samples collected in 1 gal Ziplocs @ 2.5' intervals as composites for on-site PID head space screening.