

2955

**PROJECT SPECIFIC PLAN FOR
CERTIFICATION SAMPLING OF THE
AREA 2, PHASE I ACTIVE FLYASH PILE
FOOTPRINT AND ADJACENT AREA EAST
OF THE SOUTH CONSTRUCTION ROAD**

**FERNALD ENVIRONMENTAL MANAGEMENT PROJECT
FERNALD, OHIO**



MAY 3, 2000

**U.S. DEPARTMENT OF ENERGY
FERNALD AREA OFFICE**

**20402-PSP-0003
REVISION B
DRAFT**

006601

**PROJECT SPECIFIC PLAN FOR
CERTIFICATION SAMPLING OF THE
AREA 2, PHASE I ACTIVE FLYASH PILE
FOOTPRINT AND ADJACENT AREA EAST
OF THE SOUTH CONSTRUCTION ROAD**

Document Number 20402-PSP-0003

**Revision B
Draft**

May 3, 2000

APPROVAL:

Tom Crawford, Area 2 Project Manager
Soil and Disposal Facility Project

Date

Mike Rolfes, Area 2 Characterization Lead
Soil and Disposal Facility Project

Date

Tom Buhrlage, Environmental Monitoring
Soil and Water Project

Date

Frank Thompson, Quality Assurance
Soil and Water Project

Date

FERNALD ENVIRONMENTAL MANAGEMENT PROJECT

**Fluor Fernald, Inc.
P.O. Box 538704
Cincinnati, Ohio 45253-8704**

TABLE OF CONTENTS

1.0	Introduction.....	1-1
1.1	Purpose.....	1-1
1.2	Scope.....	1-1
1.3	Key Personnel.....	1-2
2.0	Certification Sampling Program.....	2-1
2.1	Certification Design.....	2-1
2.2	CU Sampling.....	2-1
2.3	Surveying.....	2-2
2.4	Physical Soil Sample Collection.....	2-2
2.4.1	Equipment Decontamination.....	2-3
2.4.2	Certification Physical Sample Identification.....	2-4
3.0	Certification Sample Analysis.....	3-1
4.0	Quality Assurance/Quality Control Requirements.....	4-1
4.1	Field Quality Control Samples, Analytical Requirements and Data Validation.....	4-1
4.2	Project-Specific Procedures, Documents and Manuals.....	4-1
4.3	Independent Assessment.....	4-2
4.4	Implementation of Changes.....	4-2
5.0	Health and Safety.....	5-1
6.0	Data Management.....	6-1
Appendix A	Data Quality Objectives SL-052, Rev. 3	
Appendix B	A2PI AFP CU Samples/Coordinates/Identification	

LIST OF TABLES

Table 1-1	Key Personnel
Table 3-1	Sampling and Analytical Requirements
Table 3-2	A2PI AFP Certification Sampling Target Analyte List

LIST OF FIGURES

Figure 1-1	A2PI Modified Boundary Map
Figure 2-1	A2PI AFP Area CUs
Figure 2-2	A2PI AFP Area CU Sample Locations

LIST OF ACRONYMS AND ABBREVIATIONS

A2PI	Area 2, Phase I
AFP	Active Flyash Pile
APM	Area Project Manager
ASCOC	area-specific constituent of concern
ASL	analytical support level
BTV	benchmark toxicity value
CDL	Certification Design Letter
CERCLA	Comprehensive Environmental Response, Compensation and Liability Act
CLP	Contract Laboratory Program
CU	certification unit
DQO	Data Quality Objectives
FACTS	Fernald Analytical Customer Tracking System
FAL	Field Activity Log
FEMP	Fernald Environmental Management Project
FRL	final remediation level
GIS	Geographical Information System
GPS	Global Positioning System
HAMDC	highest allowable minimum detection concentration
ICP/MS	inductively coupled plasma/mass spectrometry
LAN	Local Area Network
MDC	minimum detection concentration
mg/kg	milligrams per kilogram
OU	operable unit
pCi/g	picoCuries per gram
PSP	Project Specific Plan
QA/QC	Quality Assurance/Quality Control
RWP	Radiological Work Permit
SCQ	Sitewide CERCLA Quality Assurance Project Plan
SED	Sitewide Environmental Database
SEP	Sitewide Excavation Plan
SPL	Sample Processing Laboratory
SSOD	Storm Sewer Outfall Ditch
STP	Sewage Treatment Plant
TAL	Target Analyte List
V/FCN	Variance/Field Change Notice
WAO	Waste Acceptance Operations

1.0 INTRODUCTION

1.1 PURPOSE

This Project Specific Plan (PSP) describes the certification sampling and analysis necessary to certify the footprint of the former Active Flyash Pile (AFP) and adjacent area east of the south construction road.

This Area 2, Phase I (A2PI) area will be herein known as the A2PI AFP area. Certification demonstrates that risk-based, area-specific constituents of concern (ASCOCs) meet final remediation levels (FRLs).

The A2PI AFP consists of approximately 6.5 acres and is located in the southeast portion of A2PI (see Figure 1-1).

The A2PI AFP certification area is bounded to the north by an east-west swale (fed Culvert 1), to the east and south by the Storm Sewer Outfall Ditch (SSOD), and the west by the south construction access road.

There are several remediated footprints in the certification area: the AFP, two north-south ditches (Ditch 9 and 10), and one retention basin (Basin 3). The AFP area also contains one well house (well house 16) and one injection/extraction well house. The well-house footprints will remain inaccessible for certification in this effort. East of the AFP are steep-sloped, tree-covered hillsides that drain into the SSOD.

In the Area 1, Phase II Sewage Treatment Plant (STP) project, the excavations filled with water before the Certification Design Letter (CDL) was completed and subsequent certification samples were collected. As a result, an expedited approach to certification is being implemented for the A2PI AFP area. This expedited approach involves submitting the CDL for review prior to completion of final excavation, and approval after precertification.

Remediation in this area is expected to be complete in Summer 2000. Certification sampling will begin after the remediated footprint is excavated and precertified.

1.2 SCOPE

This PSP covers all physical sampling associated with A2PI AFP area certification. The certification design is consistent with the CDL for A2PI AFP area. All sampling and analysis activities will be as consistent with the Sitewide Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) Quality Assurance Project Plan (SCQ), Section 3.4 of the Sitewide Excavation Plan (SEP),

1 and Data Quality Objectives (DQO) SL-052, Revision 3. DQO SL-052 is included as Appendix A of this
2 PSP.

3
4 This PSP does not cover the certification sampling associated with the soil beneath the basin transfer
5 lines which transect the AFP certification area just south of Basin 3 and east of the AFP footprint.
6 Certification of the soil beneath the well-house footprints is also excluded. The certification of this soil
7 will be conducted in the remaining A2PI certification phases or as part of Area 10 certification.

8
9 1.3 KEY PERSONNEL

10 Key personnel responsible for performance of the project are listed in Table 1-1.

**TABLE 1-1
 KEY PERSONNEL**


1
 2
 3

Title	Primary	Alternate
DOE Contact	Rob Janke	Kathi Nickel
Area Project Manager	Tom Crawford	Jyh-Dong Chiou
Characterization Lead	Mike Rolfes	John Centers
Field Sampling Lead	Tom Buhrlage	Jim Hey
Surveying Lead	Jim Schwing	Jim Capannari
Waste Acceptance Operations (WAO) Contact	Linda Barlow	Lawrence Love
Laboratory Contact	Audrey Hannum	Grace Ruesink
Data Validation Contact	Jim Chambers	Jim Cross
Data Management Contact	Deanna Diallo	Mike Rolfes
Quality Assurance Contact	Reinhard Friske	Mary Eleton
Health and Safety Contact	Debra Grant	Lewis Wiedeman


VI:601314eqn:ncp21-mod1.dgn

STATE PLANNING COORDINATE SYSTEM 1983

27-APR-2000

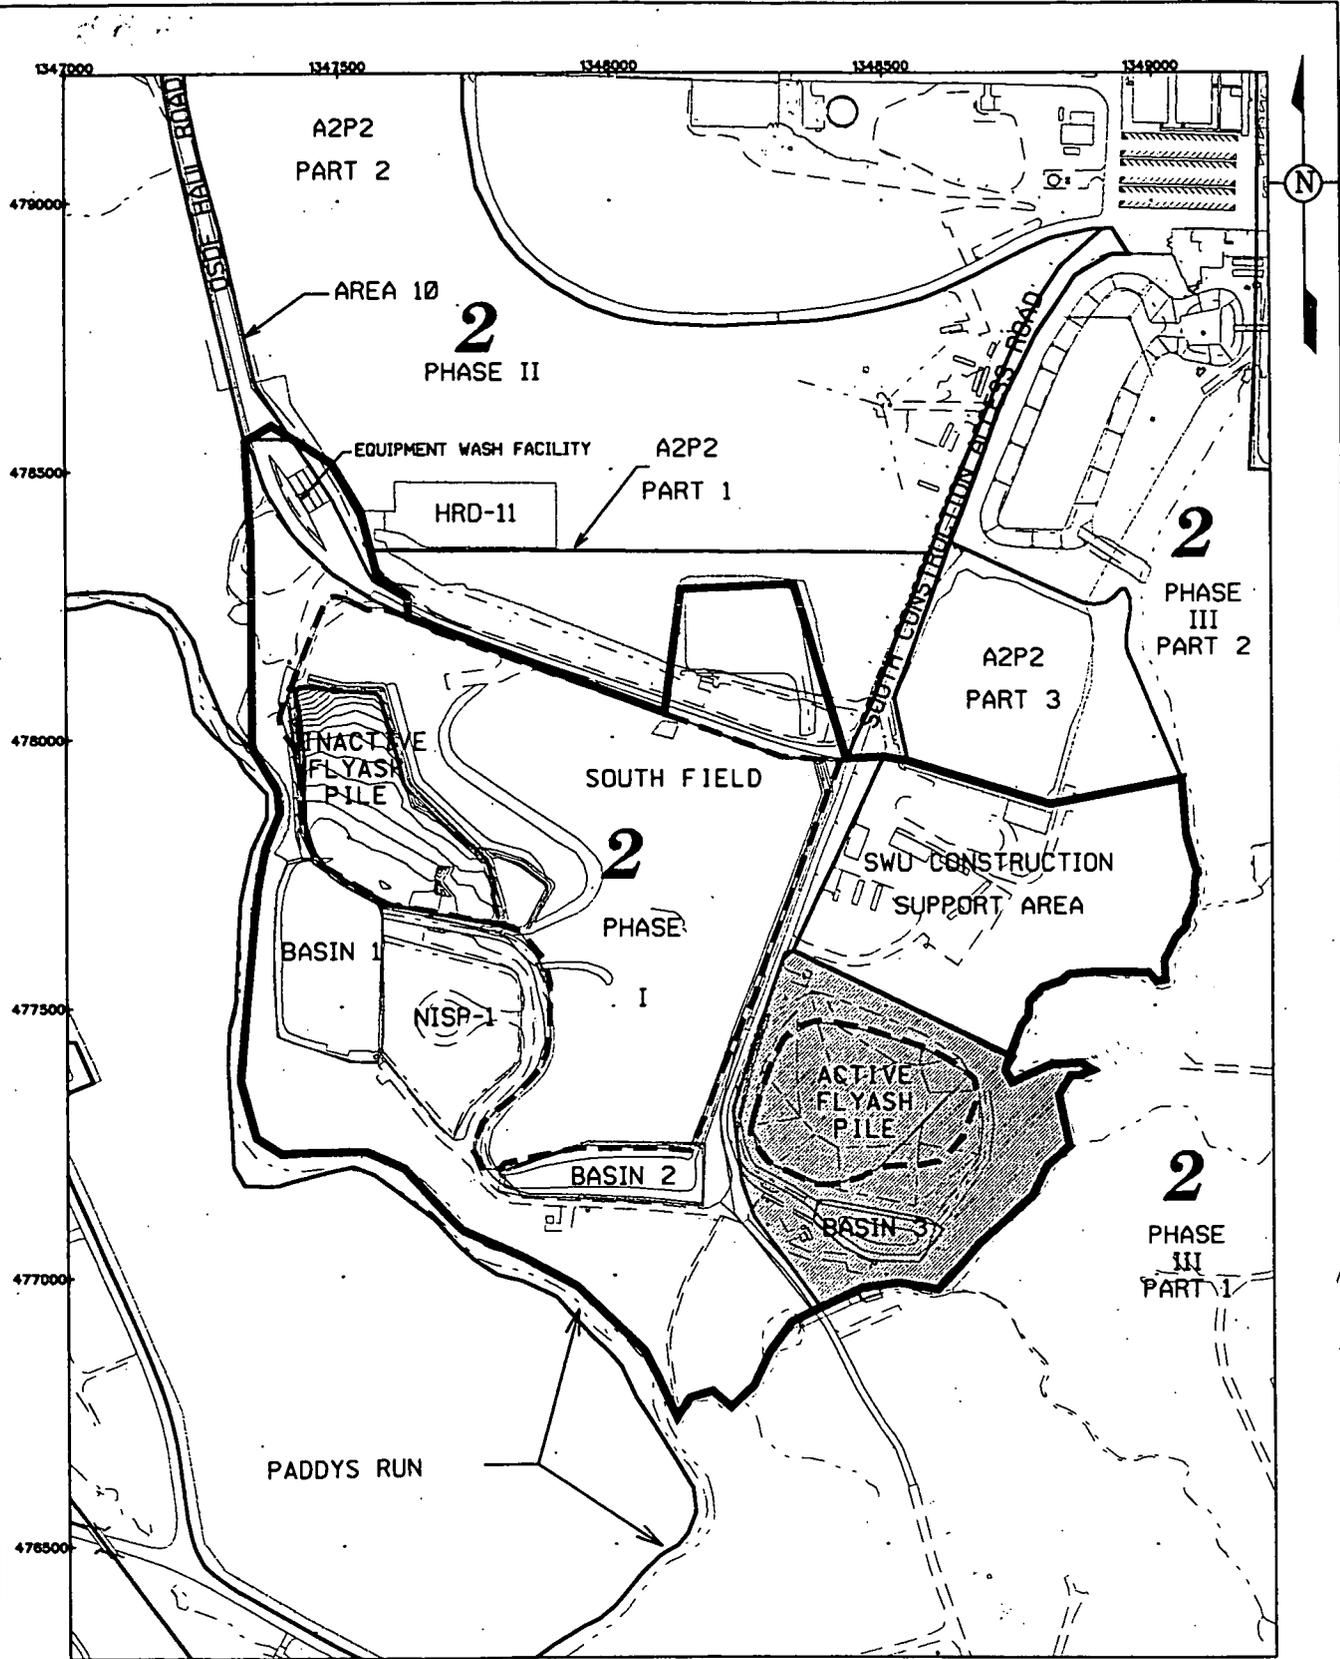

- LEGEND:**
- - - OU2 FRL
 - ▨ AFP CERTIFICATION AREA
 - A2P1 BOUNDARY



DRAFT

FIGURE 1-1. A2P1 MODIFIED BOUNDARY MAP
 (EXCLUDES CONSTRUCTION SUPPORT AREA AND UTILITY CORRIDOR) 00008

2.0 CERTIFICATION SAMPLING PROGRAM

2.1 CERTIFICATION DESIGN

Details and logic of the certification design for the A2PI AFP area are described in the A2PI AFP CDL. The certification design and sampling strategy follows Section 3.4 of the SEP. Seven Group 1 CUs (which can be as large as 62,500 square feet) are identified and depicted in Figure 2-1. The A2PI AFP CDL certification units (CUs) consist of the following:

- Two Group 1 CUs with the Operable Unit (OU) 2 total uranium FRL: two for the footprint of the former AFP (A2P1-AFP-C-5 and -6)
- Five Group 1 CUs with the OU5 total uranium FRL:
 - Footprint soils of site preparation Ditches 9 and 10 and Basin 3 (A2P1-AFP-C-3)
 - Soils south of Basin 3 extending to the SSOD (A2PI-AFP-C-1)
 - Adjacent perimeter soils which extend to the upper bank of the SSOD (A2P1-AFP-C-2, -4 and -7).

The CU boundary adjacent to the SSOD and the unnamed tributaries and extends only partially down the side banks to allow for potential backup during extreme rain events and flooding. The SSOD stream beds and lower side banks are excluded from this certification event and will be certified at a later date with the dirty corridors.

If the excavation footprint is modified, either from the design and/or due to elevated precertification scanning results, the CU designs will be re-evaluated. Any CU changes deemed necessary based on this evaluation will be documented in the final version of the PSP.

2.2 CU SAMPLING

Certification sampling consists of the collection of randomly selected physical soil samples within each CU per Section 3.4.2.1 in the SEP. In order to determine which samples to analyze while still providing sufficient area coverage, each CU is divided into quadrants, with each quadrant containing four sample locations. Three of the four samples from each quadrant are then randomly selected for analysis, resulting in a total of 12 samples analyzed per CU. The twelve samples to be collected for each CU are identified in Appendix B.

1 Appendix B includes a list of archive samples. The archive sample locations will be placed in the field,
2 but samples will not be collected unless analysis is needed. If archived samples are to be collected and
3 analyzed, a Variance/Field Change Notice (V/FCN) will be generated to document the request.
4 Figure 2-2 and Appendix B list all the samples per CU including coordinates and analytical disposition.
5 See Table 3-1 for Target Analyte List (TAL) parameters.

6 7 2.3 SURVEYING

8 The NAD83 State Planar coordinates have been determined for each sample location listed in
9 Appendix B. Before collection, sample locations will be identified and flagged using standard land
10 surveying methods. The elevation of the sample surface will be collected during placement of the
11 sample flag. If surface features prevent collection of soil samples at the planned location, the sample
12 location may be field adjusted to accommodate safe and reasonable sample locations but may not cross
13 CU boundaries. Any sample location moved more than 3 feet from the planned location must be
14 approved by the regulatory agencies and documented in a V/FCN.

15 16 2.4 PHYSICAL SOIL SAMPLE COLLECTION

17 All soil samples will be collected using a 3-inch by 6-inch long diameter plastic or stainless steel liner
18 and will be sealed using plastic end caps, as identified in procedure SMPL-01. A variety of sampling
19 equipment and methods will potentially be utilized for sampling locations depending on the surface
20 conditions. More specifically, the surface soil sampling locations in areas covered by grass will be
21 sampled using a 3-inch diameter plastic or stainless steel liner or hand auger. For surface soil sample
22 locations in any gravel areas, either a Geoprobe® core sampler (Macro-core tool) or hand auger will be
23 used to penetrate the gravel to reach the original surface soil. At the discretion of the Field Sampling
24 Lead, samples may be collected using other methods with concurrence from the Characterization Lead as
25 specified in SMPL-01.

26
27 Before collecting the soil cores, the field sampling technician will remove all surface vegetation within a
28 6-inch radius of the points to be sampled using a blue nitrile glove or stainless steel trowel, taking care
29 not to remove any of the surface soil. Regardless of the sample collection apparatus, the surface soil
30 samples will be collected from the 0 to 6-inch interval at each location. If a sample point is located
31 within the footprint of a gravel/paved pad or road, the sample will be taken to a depth of 6 inches below
32 the gravel/asphalt base. For duplicate samples to meet the quality control requirements, twice the sample

1 volume will be collected at those sample locations (identified in Appendix B). These duplicate soil
2 samples will be collocated within a 1-foot radius and not composited. All samples, including duplicates,
3 will be assigned a unique sample identification number as identified in Section 2.3.2 and Appendix B.
4

5 If surface or subsurface obstacles prevent sample collection at any of the original locations identified in
6 Appendix B, the location may be moved up to 3 feet in radius from the original location. The distance
7 and direction moved will be noted on the Field Activity Log (FAL). If any certification sampling
8 location is moved, it must remain within the boundary of the same sub-CU. Customer sample numbers
9 and Fernald Analytical Customer Tracking System (FACTS) identification numbers will be assigned to
10 all samples collected. The sample labels will be completed with sample collection information, and
11 technicians will complete a FAL, Sample Collection Log, and Chain of Custody/Request for Analysis;
12 this documentation is to be completed in the field prior to submitting the samples.
13

14 All samples collected from one CU (including duplicate samples) will be batched and submitted to the
15 Sample Processing Laboratory (SPL) on one Chain of Custody form as one analytical release. Water
16 Quality Control (QC) samples will be listed on a separate Chain of Custody. If collected, archive
17 samples (see Appendix B) will be kept under the Chain of Custody of the field crew and will not be
18 submitted to the SPL unless directed in a V/FCN. Upon completion of sample collection, boreholes will
19 be collapsed.
20

21 2.4.1 Equipment Decontamination

22 Decontamination is performed to protect worker health and safety and to prevent the introduction of
23 contaminants from sampling equipment to subsequent soil samples. Field technicians will ensure that
24 sampling equipment has been decontaminated prior to transport to the field sampling site.

25 Decontamination is only necessary in the field when sampling equipment is reused. Push tubes and core
26 tube end caps require decontamination prior to use. If an alternate sampling method is used, equipment
27 will be decontaminated between collection of sample intervals and again after the sampling performed
28 under this PSP is completed. Equipment that comes into contact with the sample will be decontaminated
29 at Level II (Section K.11 of the SCQ) in the field. Clean disposable wipes may be used to replace air
30 drying of the equipment.

1 **2.4.2 Certification Physical Sample Identification**

2 Each certification soil sample will be assigned a unique sample identification code, as follows:

3
4 *A2P1-AFP-C-CU-Location-Suite-QC*, where:

5
6 A2P1 = Sample collected from A2PI (Note that the number "1" is used in place of the
7 roman numeral "I" in the ID number for data management purposes)
8 C = Certification Sample
9 CU = Certification unit
10 Location = Sample location number within each CU (1 through 16)
11 Suite = "RM", for radiological and metals, "V" for archive
12 QC = Quality control sample, if applicable. A "D" indicates a duplicate sample,
13 "X" indicates a rinsate, "Y" indicates a container blank sample.
14

15 Therefore, a duplicate sample taken from the 15th sample location from within CU-1 would be identified
16 as A2P1-AFP-C-1-15-RM-D.


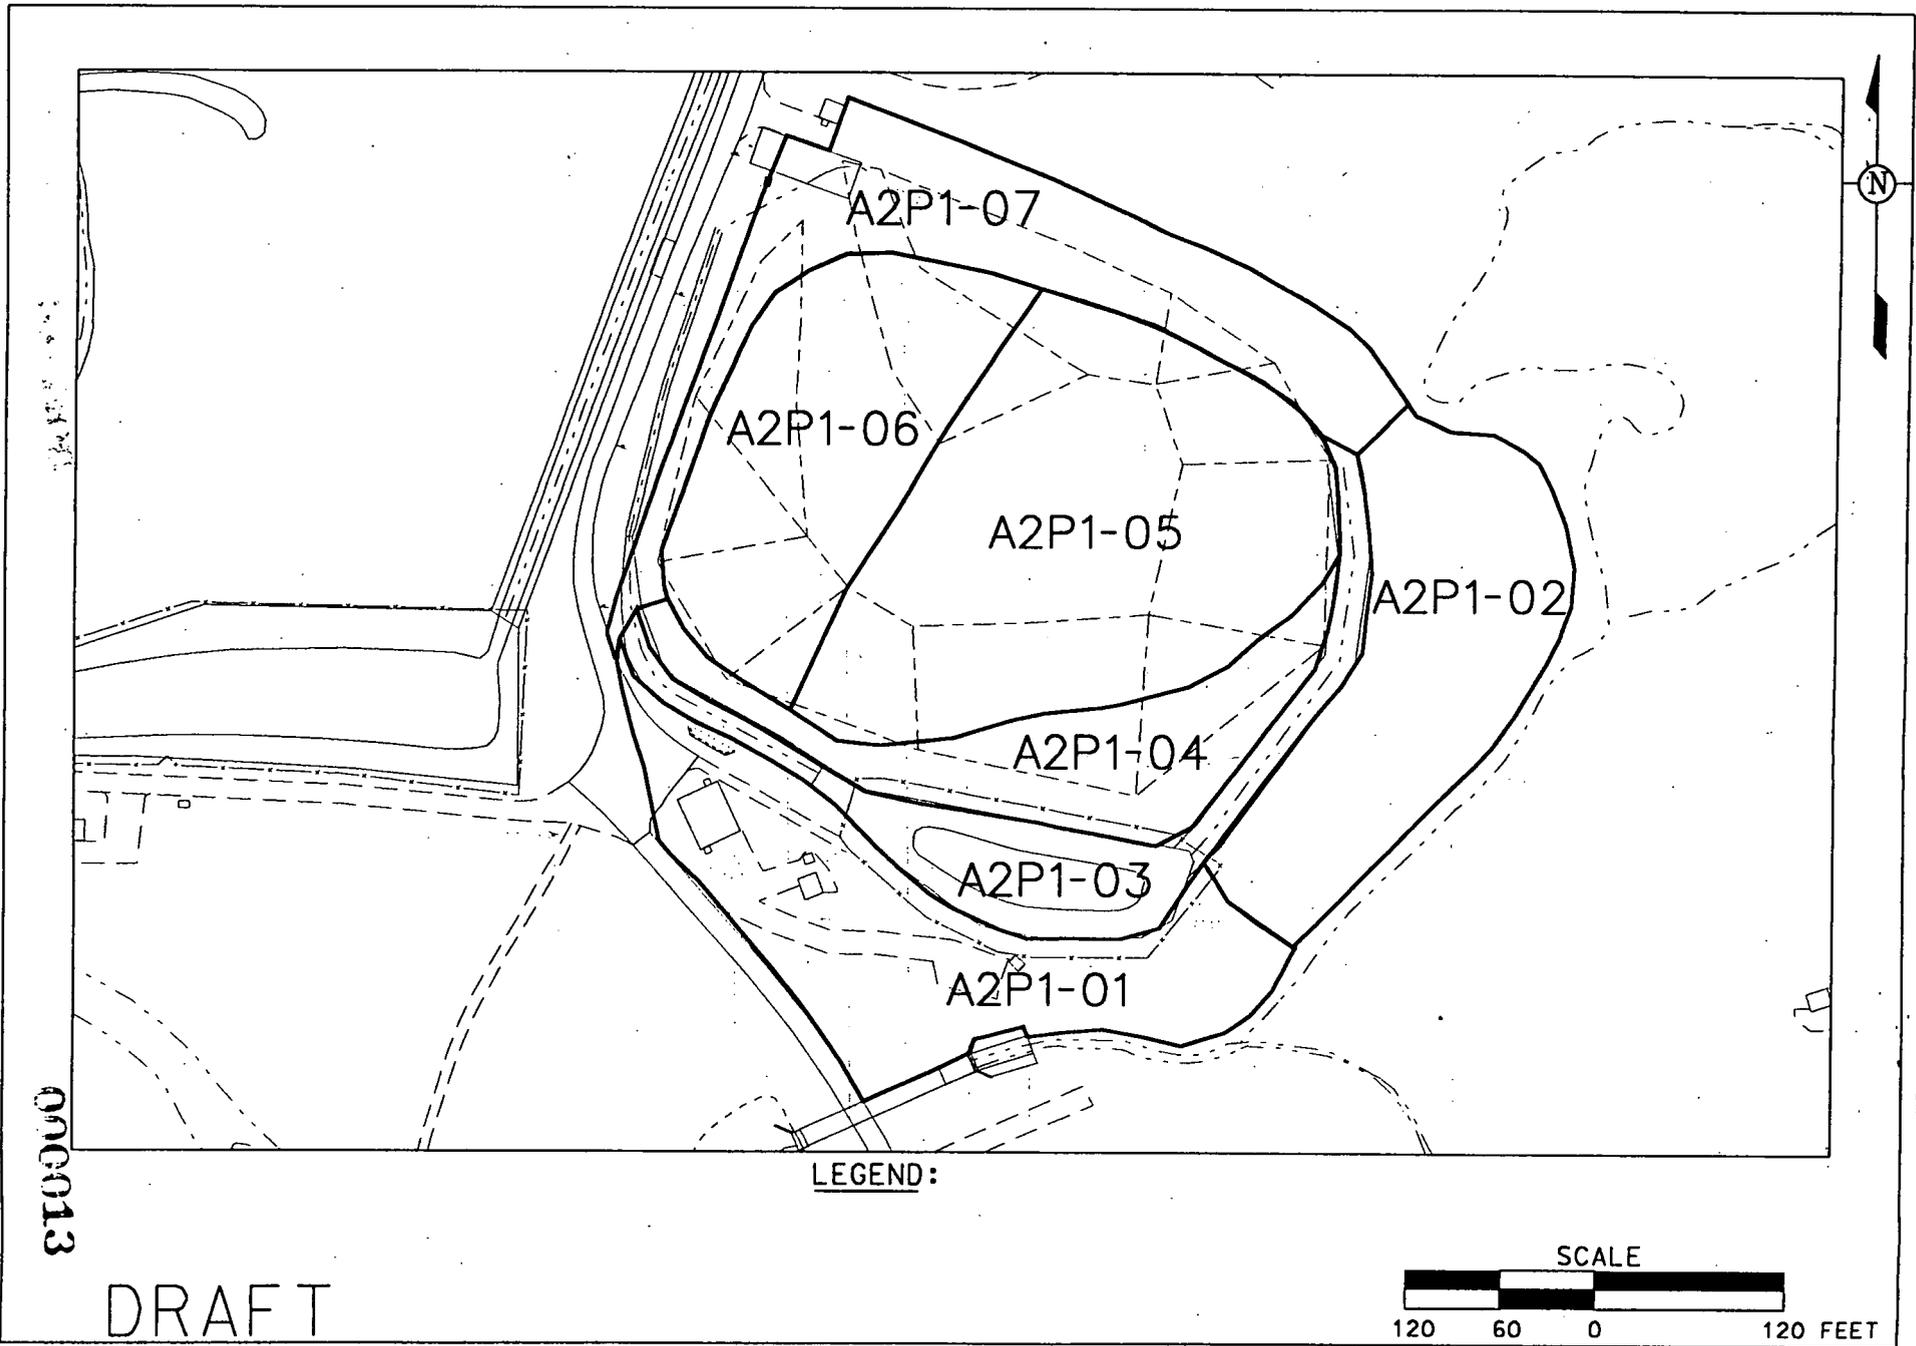


FIGURE 2-1. A2P1 AFP AREA CUS

000014

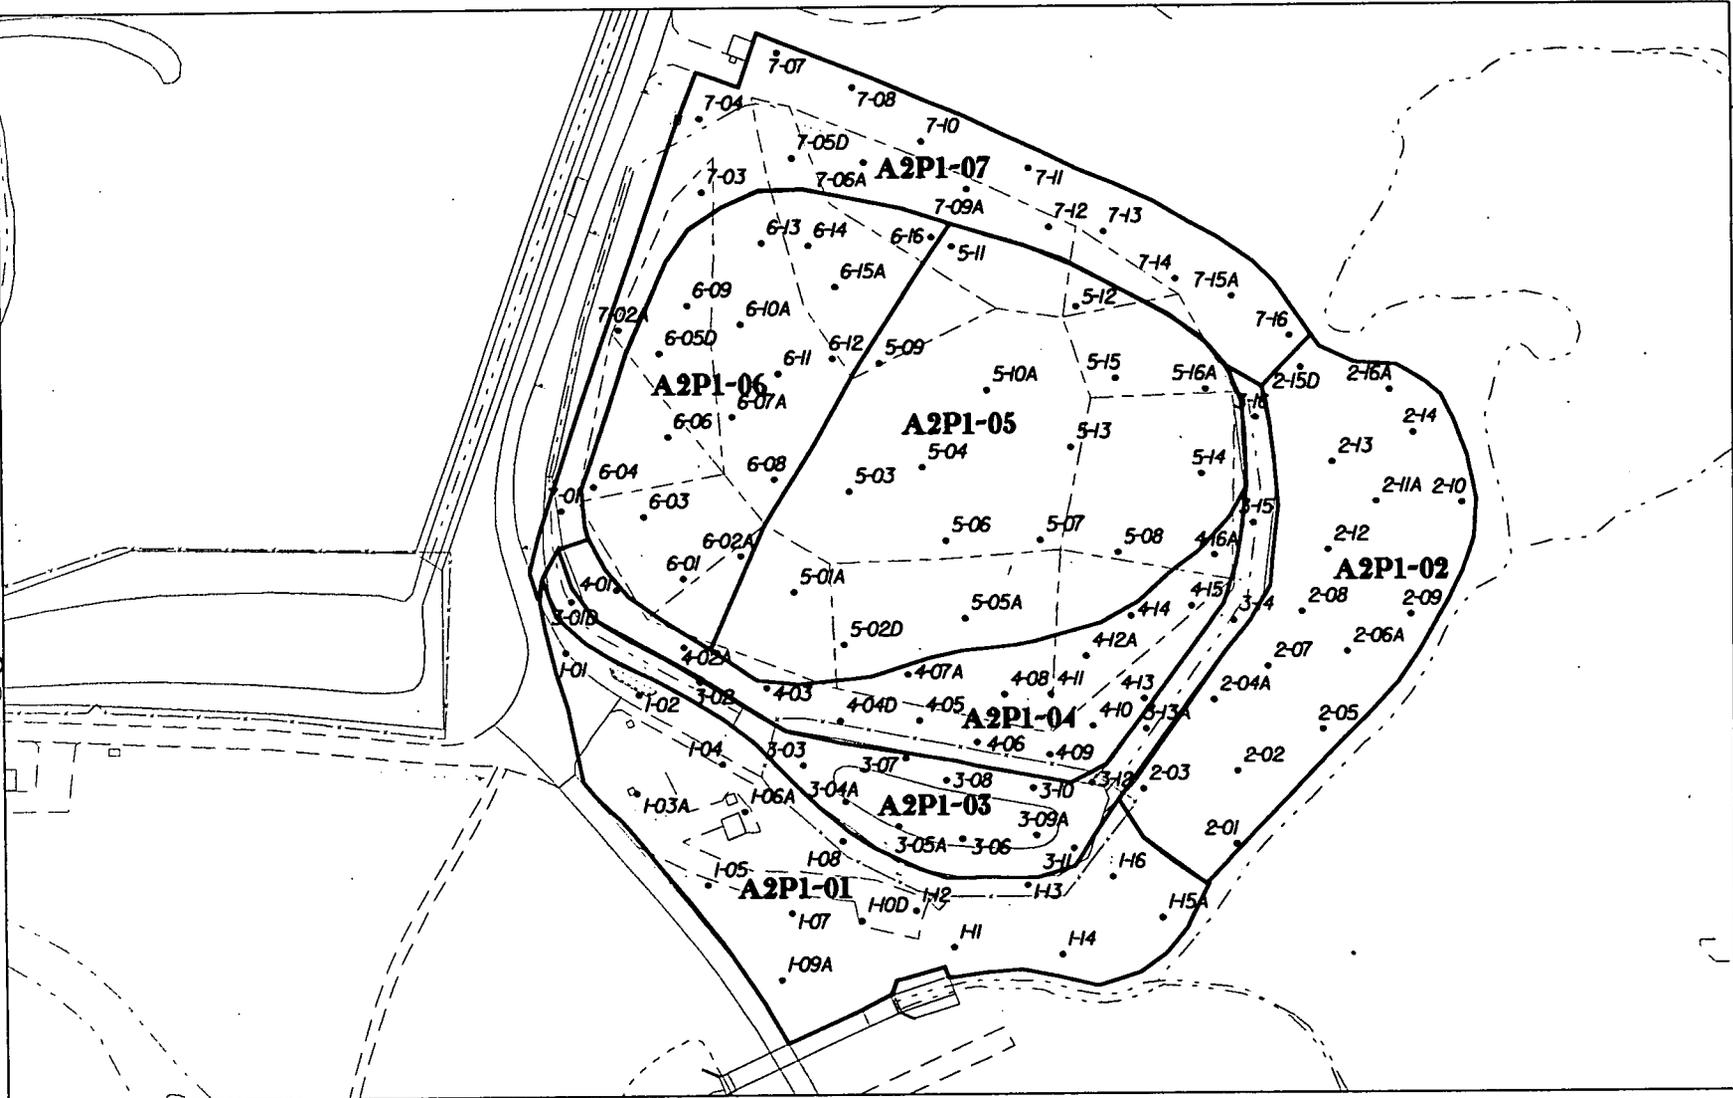

LEGEND:

• 1-09A SAMPLE LOCATION

SCALE



DRAFT

3.0 CERTIFICATION SAMPLE ANALYSIS

The necessary volume of all samples collected will be prepared for the appropriate analytical method per requirements of the SCQ. Sampling and analytical requirements are listed in Table 3-1. The TAL is shown in Table 3-2.

If the Area Project Manager (APM) decides to analyze samples subject to methods not described in the SCQ, the APM shall ensure that:

- A variance is issued to include references confirming that the new method is sufficient to support data needs
- Variations from the SCQ methodology are documented in the PSP, or
- The APM may request data validation for affected samples or communicate to the lab that Data Qualifier Codes of J and R be attached to detected and non-detected constituents of concern, respectively.

TABLE 3-1
 SAMPLING AND ANALYTICAL REQUIREMENTS

Analyte	Method	Sample Matrix	Lab	ASL	Preserve	Holding Time	Container	Sample Mass
Total Uranium, Radium-226, Radium-228, Thorium-228, Thorium-232	Alpha or Gamma Spectroscopy	Solid	On-site or off-site	E ^a	None	12 months	Plastic or stainless steel core liner or glass or polyethylene sample container ^b	300 grams
Arsenic, Beryllium, Antimony, Cadmium, Molybdenum, Silver	ICP or ICP/MS	Solid	On-site or off-site	D	Cool, 4°C	6 months	Combine in rad container	20 grams
Total Uranium, Radium-226, Radium-228, Thorium-228, Thorium-232	Alpha or Gamma Spectroscopy	Liquid (rinstate/ container blank)	On-site or off-site	E ^a	HNO ₃ to pH<2	6 months	1 liter polyethylene	8 liters
Arsenic, Beryllium, Antimony, Cadmium, Molybdenum, Silver	ICP or ICP/MS	Solid	On-site or off-site	D	Cool, 4°C	6 months	500 ml polyethylene ^c	500 ml

^a The SCQ highest allowable minimum detectable concentration (HAMDC) for total uranium, thorium-228, and thorium-232 by gamma spectroscopy at Analytical Support Level (ASL) D is more stringent the minimum detectable concentration (MDC) needed for this certification. The MDC needed for this certification event is 10 percent of the FRL. Thus, the data deliverable for total uranium, thorium-228, and thorium-232 analysis by gamma spectroscopy will be identical in specifications for ASL D except for the HAMDC. As a result, the total uranium, thorium-228, and thorium-232 gamma spectroscopy data are considered ASL E.

^b Soil samples for metals analysis can not be submitted in stainless steel liners. The SCQ specifies glass containers with teflon lined caps; however, polyethylene containers may also be used as allowed by Contract Laboratory Program (CLP) procedure ILMO4.0.

^c The SCQ specifies collection of 1-liter samples for metals analysis; however, this volume is adequate for field QC since laboratory QC is not required.

1
2
3
4
5
6
7
8

TABLE 3-2
A2PI AFP CERTIFICATION SAMPLING
TARGET ANALYTE LIST

TAL 20402-PSP-0003-A
Alpha or Gamma Spectroscopy Method
(ASL D, E*)

Analyte	FRL/BTV Limit	MDC
Total Uranium	82/10 mg/kg	8/1 mg/kg
Thorium-228	1.7 pCi/g	.17 pCi/g
Thorium-232	1.5 pCi/g	.15 pCi/g
Radium-226	1.7pCi/g	.17 pCi/g
Radium-228	1.8 pCi/g	.18 pCi/g
Arsenic	12 mg/kg	3.44 mg/kg
Beryllium	1.5 mg/kg	0.15 mg/kg
Antimony	10 mg/kg (BTV)	2.34 mg/kg
Cadmium	5 mg/kg (BTV)	0.5 mg/kg
Molybdenum	10 mg/kg (BTV)	1.0 mg/kg
Silver	10 mg/kg (BTV)	1 mg/kg

9
10
11
12
13
14
15
16
17

* The SCQ HAMDC for total uranium, thorium-228, and thorium-232 by gamma spectroscopy at ASL D is more stringent the MDC needed for this certification. The MDC needed for this certification event is 10 percent of the FRL. Thus, the data deliverable for total uranium, thorium-228, and thorium-232 analysis by gamma spectroscopy will be identical in specifications for ASL D except for the HAMDC. As a result, the total uranium, thorium-228, and thorium-232 gamma spectroscopy data are considered ASL E. The 1 mg/kg MDC is for CUs A2P1-AFP-5 and -6 (OU2 area CUs). The 8 mg/kg MDC is for the other CUs.

4.0 QUALITY ASSURANCE/QUALITY CONTROL REQUIREMENTS

4.1 FIELD QUALITY CONTROL SAMPLES, ANALYTICAL REQUIREMENTS AND DATA VALIDATION

The field quality control, analytical, and data validation requirements are as follows:

- Field quality control requirements include one duplicate for each CU, as noted in Appendix B and further described in Section 2.4. Two container blanks will be collected - one before sample collection begins and one at the conclusion of sample collection - for the push tubes and end caps. If an alternate sample collection method is used, one rinsate sample will be collected at a minimum frequency of one per 20 certification samples where reusable equipment (e.g., hand augers) is used for collection. All field QC samples will be analyzed per TAL 20402-PSP-0003-A.
- All analyses will be performed at ASL D with an exception for total uranium, thorium-228 and thorium-232. The analytical package for total uranium, thorium-228 and thorium-232 analysis by gamma spectroscopy will be identical in specifications for ASL D except for the HAMDC. As a result, the total uranium, thorium-228 and thorium-232 gamma spectroscopy data are considered ASL E.
- All field data will be validated. An ASL D analytical package will be provided for ten percent of the samples at a minimum and an ASL B package for 90 percent or less of the samples. At a minimum, 10 percent of the analytical data will be validated to ASL D and ninety percent to ASL B. This will be obtained by validating the first CU submitted to the lab to ASL D. If any result is rejected, all data from the laboratory with the rejected result will then be validated to determine the integrity of the results from that laboratory. This change will be documented in a variance to this PSP.

Once all data are validated as required, results will be entered into the Sitewide Environmental Database (SED) and a statistical analysis will be performed to evaluate the pass/fail criteria for the each CU. The statistical approach is discussed in Section 3.4.3 and Appendix G of the SEP. This work is being performed per the requirements as stated in DQO SL-052 (Appendix A).

4.2 PROJECT-SPECIFIC PROCEDURES, DOCUMENTS AND MANUALS

To ensure consistency and data integrity, field activities in support of the PSP will follow the requirements and responsibilities outlined in the procedures and guidance documents referenced below.

- ADM-02, Field Project Prerequisites
- EQT-33, Real Time Differential Global Positioning System Operation
- Sitewide CERCLA Quality Assurance Project Plan (SCQ)
- SMPL-01, Solids Sampling
- SMPL-21, Collection of Field Quality Control Samples

- 1 • S.P. 766-S-1000, Shipping Samples to Offsite Laboratories
- 2 • Trimble Pathfinder Pro-XL GPS Operation Manual
- 3 • Sitewide Excavation Plan (SEP)
- 4 • Certification Design Letter for A2PI AFP

5

6 4.3 INDEPENDENT ASSESSMENT

7 Independent assessment may be performed by the FEMP Quality Assurance (QA) organization by
8 conducting a surveillance, consisting of monitoring/observing ongoing project activities and work areas
9 to verify conformance to specified requirements. Surveillances will be planned and documented in
10 accordance with Section 12.3 of the SCQ.

11

12 4.4 IMPLEMENTATION OF CHANGES

13 Before implementation changes, the Field Sampling Lead will be informed of the proposed changes.
14 Once the Field Sampling Lead has obtained written or verbal approval (electronic mail is acceptable)
15 from the APM, QA, and the Characterization Lead for the changes to the PSP, the changes may be
16 implemented. Changes to the PSP will noted in the applicable field activity logs and on a V/FCN. QA
17 must receive the completed V/FCN, which includes the signatures of the Characterization Lead,
18 Sampling Manager, APM, and QA within seven working days of implementation of the change.

5.0 HEALTH AND SAFETY

1
2
3 Technicians will conform to precautionary surveys performed by personnel representing the Utility
4 Engineer, Industrial Hygiene, and Radiological Control as applicable. All work performed on this
5 project will be performed in accordance to applicable Environmental Monitoring project procedures,
6 RM-0020 (Radiological Control Requirements Manual), RM-0021 (Safety Performance Requirements
7 Manual), Fluor Fernald work permit, Radiological Work Permit (RWP), penetration permits, and other
8 applicable permits. All personnel in the performance of their assigned duties require concurrence with
9 applicable safety permits. A safety briefing will be conducted prior to the initiation of field activities.

10
11 **All emergencies shall be reported immediately on extension 911, or to the Site Communications**
12 **Center at 648-6511 (if using a cellular phone), or using a radio and contacting "CONTROL" on**
13 **Channel 11.**

6.0 DATA MANAGEMENT

A data management process will be implemented to collect and manage certification information collected during the investigation. As specified in Section 5.1 of the SCQ, daily activities will be recorded on the FAL, with sufficient detail to be able to reconstruct a particular situation without reliance on memory. Sample Collection Logs will be completed according to procedure ADM-02.

Electronically recorded data from the Geodimeter or Global Positioning System (GPS) will be downloaded to disks on a daily basis unless otherwise instructed. Survey team members will review the data for completeness and accuracy and then download it onto the Local Area Network (LAN). Once on the LAN, the Data Management Contact will perform an evaluation of the coordinate data. Once complete, the data will be sent to the loader, where it will be loaded onto the Oracle system and an error log will be generated. The data will then be made available to users through both the Geographical Information System (GIS) and Microsoft Access Software. Survey field team members will retain all downloaded data on disk for future reference and archive.

Field documentation, such as the FAL, Geodimeter Survey Files, the Sample Collection Log, and the Sample Request/Sample Analysis Chain of Custody Log will undergo an internal QA/QC review by the field team members. Copies will then be generated and delivered to the Data Management Contact, who will perform an evaluation of the data and create the appropriate links between the electronically recorded data and the paper-generated data. The paper-generated data will be sent to data entry personnel for input into the SED. Field logs may be completed in the field and maintained in loose-leaf form. The QA validation team will validate field packages.

Analytical data from on-site and/or off-site laboratories will be reported in preliminary form to the Characterization Lead on at least a weekly basis. This will be done by the laboratory contact as soon as the data are available in the FACTS database. Following required validation of the data for each sample release, the data from that release will be reported to the Characterization Lead in a summary data report format. All analytical data will be entered into the SED with the appropriate qualifier.

All records associated with this PSP should reference the PSP number and eventually be forwarded to Engineering/Construction Document Control to be placed in the project file.

APPENDIX A

DATA QUALITY OBJECTIVES SL-052, REV. 3

Control Number _____

Fernald Environmental Management Project

Data Quality Objectives


Title: Sitewide Certification Sampling and Analysis

Number: SL-052

Revision: 3

Effective Date: March 13, 2000

Contact Name: Mike Rolfes

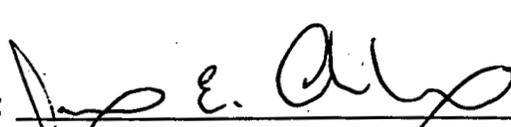Approval: 
 James Chambers
 DQO Coordinator

Date: 3/13/00

Approval: 
 J.D. Chiou
 SCEP Project Director

Date: 3/13/00

Rev. #	0	1	2	3			
Effective Date:	4/28/99	6/10/99	2/3/00	3/13/00			

DATA QUALITY OBJECTIVES Sitewide Certification Sampling and Analysis

Members of Data Quality Objectives (DQO) Scoping Team

The members of the scoping team included individuals with expertise in QA, analytical methods, field sampling, statistics, laboratory analytical methods and data management.

Conceptual Model of the Site

Soil sampling was conducted at the Fernald Environmental Management Project (FEMP) during the Operable Unit 5 (OU5) Remedial Investigation/Feasibility Study (RI/FS). Final Remediation Levels (FRLs) for constituents of concern (COCs), along with the extent of soil contaminated above the FRLs, were identified in the OU5 Record of Decision (ROD). Actual soil remediation activities now fall under the guidance of the final Sitewide Excavation Plan (SEP).

As outlined in the SEP, the FEMP has been divided into individual Remediation Areas (or phased areas within a Remediation Area) to sequentially carry out soil remedial activities. Under the strategy identified in the SEP, pre-design investigations are first conducted to better define the limits of soil excavation requirements. Following any necessary excavation, pre-certification real-time scanning activities are conducted to evaluate residual patterns of soil contamination. Pre-certification scan data should provide a level of assurance that the FRLs will be achieved. When pre-certification data indicate that remediation goals are likely to be met, they are used to define certification units (CUs) within the Remediation Area of interest. Table 2-9 of the final SEP identifies a list of area-specific COCs (ASCOCs) for each Remediation Area at the FEMP. Based on existing data and production knowledge, a subset of these ASCOCs are conservatively identified within each CU as potentially present in the CU. This suite of CU-specific COCs is the subset of the ASCOCs to be evaluated against the FRLs within that CU. At a minimum, the five primary radiological COCs (total uranium, radium-226, radium-228, thorium-228, thorium-232) will be retained as CU-specific COCs for certification of each CU.

Delineation and justification for the final CU boundaries, along with each corresponding suite of CU-specific ASCOCs is documented in a Certification Design Letter. Upon approval of the Certification Design Letter by the EPA, certification activities can begin. Section 3.4 of the final SEP presents the general certification strategy.

1.0 Statement of Problem

FEMP soil and potentially impacted adjacent off-property soil must be certified on a CU by CU basis for compliance with the FRLs of all CU-specific ASCOCs. The appropriate sampling, analytical and information management criteria must be developed to provide the required qualified data necessary to demonstrate attainment of certification statistical criteria. For every area undergoing certification, a sampling plan must be in place that will direct soil samples to be collected which are representative of the CU-specific COC concentrations within the framework of the certification approach identified in the final SEP. The appropriate analytical methodologies must be selected to provide the required data.

Exposure to Soil

The cleanup standards, or FRLs, were developed for a final site land use as an undeveloped park. Under this exposure scenario, receptors could be directly exposed to contaminated soil through dermal contact, external radiation, incidental ingestion, and/or inhalation of fugitive dust while visiting the park. Exposure to contaminated soil by the modeled receptor is expected to occur at random locations within the boundaries of the FEMP and would not be limited to any single area. Some soil FRLs were developed based on the modeled cross-media impact potential of soil contamination to the underlying aquifer. In these instances, potential exposure to contaminants would be indirect through the groundwater pathway, and not directly linked to soil exposure. Off-site soil FRLs were established at more conservative levels than the on-property soil FRLs, based on an agricultural receptor. Benchmark Toxicity Values (BTVs) are also being considered in the cleanup process by assessing habitat impact of individual BTVs under post-remedial conditions.

Available Resources

Time: Certification sampling will be accomplished by the field sampling team prior to interim or final regrading or release of soil for construction activities. The certification sampling schedule must allow sufficient time, in the event additional remediation is required, to demonstrate certification of FRLs prior to permanent construction or regrading. Certification sampling will have to be completed and analytical results validated and statistical analysis completed prior to submission of a Certification Report to the regulatory agencies.

Project Constraints: Certification sampling and analytical testing must be performed with existing manpower, materials and equipment to support the certification effort. Remediation areas are prioritized for certification sampling and analysis according to the date required for initiation of sequential construction activities in those areas. Fluor Daniel Fernald (FDF) and DOE must demonstrate post-remedial compliance with the CU-specific COC FRLs to release the designated Remediation Area for

planned interim grading, eventual restoration under the Natural Resources Restoration Plan (NRRP), and other final land use activities.

2.0 Identify the Decision

Decision

Demonstrate within each CU if all CU-specific COCs pass the certification criteria. These criteria are as follows: 1) The average concentration of each CU-specific COC is below the FRL and within the agreed upon confidence limits (95% for primary ASCOCs and 90% for secondary ASCOCs); and 2) the hot-spot criteria, that no result for any CU-specific COC is more than two times the associated soil FRL. The certification criteria are discussed in greater detail in Section 3.4.4 of the final SEP.

Possible Results

1. The average concentration of each CU-specific COC is demonstrated to be below the FRLs within the confidence level, with no single result for any CU-specific COC greater than two times the associated FRL. The CU can then be certified as attaining remediation goals.
2. The average concentration of at least one CU-specific COC is demonstrated to be above the FRL at the given confidence level. The CU will fail certification and require additional remedial action, per Section 3.4.5 of the final SEP.
3. If a result(s) of one or more CU-specific COC is demonstrated to be at or above two times the FRL, the CU will fail certification. The CU will fail certification and require additional remedial action per Section 3.4.5 of the final SEP. A combination of results 2 and 3 also constitutes certification failure.

3.0 Inputs That Affect the Decision

Required Information

Certification data will be obtained through physical soil sampling. Based on the certification analytical results, the average concentrations of each CU-specific COC with specified confidence levels will be calculated using the statistical methods identified in Appendix G of the final SEP.

Source of Information

Per the SEP, analysis of certification samples for each CU-specific COC will be conducted at analytical support level (ASL) D in accordance with methods and QA/QC standards in the FEMP Sitewide CERCLA Quality Assurance Project Plan [SCQ].

Contaminant-Specific Action Levels

The cleanup levels are the soil FRLs published in the OU5 and OU2 RODs. BTVs being considered in the remediation process are discussed for consideration during certification in Appendix C of the NRRP.

Methods of Sampling and Analysis

Physical soil samples will be collected in accordance with the applicable site sampling procedures. Per the SEP, laboratory analysis will be conducted at ASL D using QA/QC protocols specified in the SCQ. Full raw data deliverables will be required from the laboratory to allow for appropriate data validation. For FEMP-approved on- and off-site laboratories, the analytical method used will meet the required precision, accuracy and detection capabilities necessary to achieve FRL analyte ranges.

4.0 The Boundaries of the Situation

Spatial Boundaries

Domain of the Decision: The boundaries of this certification DQO extend to all surface, stockpile and fill soil in areas that are undergoing certification as part of FEMP remediation.

Population of Soil: Soil includes all excavated surfaces, undisturbed relatively unimpacted native soil, and sub-surface intervals (stockpile or fill areas only) in areas undergoing certification sampling and analysis.

Scale of Decision Making

Based on considerations of the final certification units and the COC evaluation process, the CU-specific COCs are determined. The area undergoing certification will be evaluated on a CU basis, based on physical sample results, as to whether it has passed or failed the criteria for attainment of certification (final SEP Section 3.4.4).

Temporal Boundaries

Time frame: Certification sampling must be performed in time to sequentially release certified areas for scheduled interim grading, restoration, and other final land use activities. Certification sampling data received from the laboratory will be validated and statistically evaluated. Certification results and findings will be documented in Certification Reports, which must be submitted to and approved by the regulatory agencies prior to release of the areas for scheduled interim grading, restoration, and other final land use activities.

Practical Considerations: Some areas undergoing remediation will not be accessible for certification sampling until decontamination/demolition and remedial excavation activities are complete. Other areas, such as wood lots, that are relatively uncontaminated and not planned for excavation, may require preparation, such as cutting of grass or removal of undergrowth prior to certification sampling, thus requiring coordination with FEMP Maintenance personnel.

5.0 Decision Rule

Successful certification of soil within the boundaries of a certification unit (CU) demonstrates that the certified soil (surface or subsurface) has concentrations of CU-specific COC(s) that meet the established criteria for attainment of Certification.

Parameters of Interest

The parameters of interest are the individual and average surface soil concentrations of CU-specific COCs and confidence limits on the calculated average within a CU. OU2 and OU5 ROD identify all applicable soil FRLs. The SEP identifies the ASCOCs, a subset of which will be used to establish CU-specific COCs within each Remediation Area undergoing certification sampling and analysis.

Action Levels

The applicable action levels are the on- and off-property soil FRLs published in the OU5 or OU2 ROD for each ASCOC.

Decision Rules

If the average concentration for each CU-specific COC is demonstrated to be below the FRLs within the agreed upon confidence level (95% for primary COCs; 90% for secondary COCs), and no analytical result exceeds two times the soil FRL, then the CU can be certified as complying with the cleanup criteria. If a CU does not meet the FRLs within the agreed upon confidence level for one or more CU-specific COCs, or one or more analytical results for one or more CU-specific COCs is greater than two times the associated soil FRL, then the CU fails certification and requires further assessment as per the SEP.

DQO #: SL-052, Rev. 3
Effective Date: March 3, 2000

6.0 Limits on Decision Errors

Types of Decision Errors and Consequences

Definition

Decision Error 1: This decision error occurs when the decision maker decides that a CU has met the certification criteria, when in reality, the certification criteria have not been met. This situation could result in an increased risk to human health and the environment. In addition, this type of error could result in regulatory fees and penalties.

Decision Error 2: This decision error occurs when the decision maker decides a CU does not meet the certification criteria, when actually, the certification criteria have been met. This error would result in unnecessary added costs due to the excavation of soil containing COC concentrations below their FRLs, and an increased volume of soil assigned to the OSDF. In addition, unnecessary delays in the remediation schedule may result.

True State of Nature for the Decision Errors

The true state of nature for Decision Error 1 is that the certification criteria are not met (average CU-specific COC concentrations not below the FRL within the specified confidence limits; or a single sample result above two times the FRL). The true state of nature for Decision Error 2 is that certification criteria are met (average CU-specific COC concentrations are below the FRL within the specified confidence limits; and no result is above two times the FRL). Decision Error 1 is the more severe error due to the potential threat this poses to human health and the environment.

Null Hypothesis

H_0 : The average concentration of at least one CU-specific COC within a CU is equal to or greater than the associated FRL.

H_1 : The average concentration of all CU-specific COCs within a CU is less than the action levels.

False Positive and False Negative Errors

A false positive is Decision Error 1: less than or equal to five percent ($p = .05$) is considered the acceptable decision error in determination of compliance with FRLs for primary ASCOCs, while ten percent ($p = .10$) is acceptable for secondary ASCOCs.

A false negative is Decision Error 2: less than or equal to 20 percent is considered the acceptable decision error. This decision error is controlled through the determination of sample sizes (see Section G.1.4.1 of the final SEP).

7.0 Design for Obtaining Quality Data

Section 3.4.2 of the final SEP presents the specifics of the certification sampling design. The following text describes the general certification sampling design.

Soil Sample Locations

In order to select certification sampling locations, each CU is divided into 16 approximately equal sub-CUs. Certification sample locations are then generated by randomly selecting an easting and northing coordinate within the boundaries of each cell. Additional alternative sample locations are also generated in case the original random sample location fails the minimum distance criterion. The minimum distance criterion is defined as the minimum distance allowed between random sample locations in order to eliminate the chance of random sample points clustering within a small area. This clustering would tend to over emphasize a small area and, conversely, under represent a large area in certification determination. By not allowing sample locations to be too closely arranged, the sample locations are spread out and provide a more uniform coverage, thus reducing the possibility of large unsampled areas. The equation for determining minimum distance criterion is presented in Section 3.4.2.1 of the SEP.

In the event that the original random sample location failed the minimum distance criterion, the first alternate location was selected and all the locations were retested. This process continued until all 16 random locations passed the minimum distance criteria.

Each CU is also divided into four quadrants, each of which contains 4 sub-CUs and 4 sample locations. Three of the four locations per quadrant (12 per CU) are then selected for sample collection and analysis. The other one per quadrant (4 per CU) are designated as "archives", and samples will not be collected and analyzed unless need arises due to analytical or validation problems warrant. Per Section 3.4.2 of the SEP, as few as 8 samples may be collected from Group 2 CUs for analysis of secondary COCs.

Physical Samples

Physical soil certification samples will be collected from the surface according to SMPL-01 at locations identified in the PSP (generally 12 of the 16 locations per CU).

If stockpiled soil is to be certified, two CUs will be established, one for the stockpile and one for the underlying soil (i.e., the "footprint"). To certify the stockpile, samples will be collected from predetermined random intervals from within the stockpiled soil at each certification sampling location identified in the PSP. To certify the footprint, the first 6-inches of native soil present at each sampling location will also be collected for certification. If fill soil is to be certified, the strategy (surface or sampling at depth) will be based on results from the precertification scan of the fill area(s), as discussed in the Certification Design Letter and the certification PSP.

Laboratory Analysis

As defined in the PSP, a minimum of 8 to 12 samples per CU will be submitted to the on-site laboratory or a FDF approved off-site laboratory for analysis. All certification analyses will meet ASL D requirements per the SCQ except for the HAMDC. Samples will be analyzed for all CU-specific ASCOCs, with minimum detection levels set according to the SCQ and applicable project guidelines.

Validation

All field data will be validated. Also, a minimum of 10 percent of the analytical data from each laboratory will be subject to analytical validation to ASL D requirements in the SCQ, and will require an ASL D package. The remaining analytical data will be validated to a minimum of ASL B, and will require an ASL B package.

8.0 Use of Data to Test Null Hypothesis

Appendix G of the final SEP discusses in detail, the statistical evaluations of certification data used to determine attainment of certification criteria.

**Data Quality Objectives
Sitewide Certification Sampling and Analysis**

1A. Task Description:

1B. Project Phase: (Put an X in the appropriate selection.)

RI FS RD RA RvA Other (specify) _____

1C. DQO No.: SL-052, Rev. 2 DQO Reference No.: _____

2. Media Characterization: (Put an X in the appropriate selection.)

Air Biological Groundwater Sediment Soil
Waste Wastewater Surface Water Other (specify) _____

3. Data Use with Analytical Support Level (A-E): (Put an X in the appropriate Analytical Support Level selection(s) beside each applicable data use)

Site Characterization	Risk Assessment
A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/>	A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/>
Evaluation of Alternatives	Engineering Design
A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/>	A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/>
Monitoring During Remediation	Other
A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/>	A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input checked="" type="checkbox"/> E <input type="checkbox"/>

4A. Drivers: Remediation Area Remedial Action Work Plans, Applicable or Relevant and Appropriate Requirements (ARARs) and Operable Unit 2 and Operable Unit 5 Records of Decision (ROD), Sitewide Excavation Plan (SEP).

4B. Objective: Confirmation that remediation areas at the FEMP, or adjacent off-property areas, have met certification criteria on a CU by CU basis.

5. Site Information (Description):

The OU2 and OU5 RODs have identified areas at the FEMP that require soil remediation activities. The RODs specify that the soil in these areas will be demonstrated to be below the FRLs. Certification is necessary for all FEMP soil and some adjacent off-property soil to demonstrate that the residual soil does not contain COC contamination exceeding the FRL at a specified confidence level.

6A. Data Types with appropriate Analytical Support Level Equipment Selection and SCQ Reference: (Place an "X" to the right of the appropriate box or boxes selecting the type of analysis or analyses required. Then select the type of equipment to perform the analysis if appropriate. Please include a reference to the SCQ Section.)

- | | | |
|---|---|-------------------------------------|
| 1. pH <input type="checkbox"/> | 2. Uranium <input checked="" type="checkbox"/> * | 3. BTX <input type="checkbox"/> |
| Temperature <input type="checkbox"/> | Full Radiological <input checked="" type="checkbox"/> * | TPH <input type="checkbox"/> |
| Specific Conductance <input type="checkbox"/> | Metals <input checked="" type="checkbox"/> * | Oil/Grease <input type="checkbox"/> |
| Dissolved Oxygen <input type="checkbox"/> | Cyanide <input type="checkbox"/> | |
| Technetium-99 <input checked="" type="checkbox"/> * | Silica <input type="checkbox"/> | |
| 4. Cations <input type="checkbox"/> | 5. VOA <input checked="" type="checkbox"/> * | 6. Other (specify) |
| Anions <input type="checkbox"/> | BNA <input type="checkbox"/> | |
| TOC <input type="checkbox"/> | PEST <input checked="" type="checkbox"/> * | |
| TCLP <input type="checkbox"/> | PCB <input checked="" type="checkbox"/> * | |
| CEC <input type="checkbox"/> | COD <input type="checkbox"/> | |

* As identified in the area certification PSP

6.B. Equipment Selection and SCQ Reference:

Equipment Selection	Refer to SCQ Section
ASL A _____	SCQ Section _____
ASL B _____	SCQ Section _____
ASL C _____	SCQ Section _____
ASL D <u>Per SCQ and PSP</u>	SCQ Section <u>Appendix G, Tbls. 1&3</u>
ASL E <u>Per PSP</u>	SCQ Section <u>Appendix H (final)</u>

7A. Sampling Methods: (Put an X in the appropriate selection.)

- Biased Composite Grab Environmental Grid
 Intrusive Non-Intrusive Phased Source Random *

*Systematic random samples, selected one per cell and meeting the minimum distance criterion

7B. Sample Work Plan Reference: Project Specific Plan for the associated Remediation area Remedial Action Work Plan

Background samples: OU5 RI

7C. Sample Collection Reference: Associated PSP(s), SMPL-01

8. Quality Control Samples: (Put an X in the appropriate selection.)

8A. Field Quality Control Samples:

- | | | | |
|--------------------------|--|--------------------------------|--|
| Trip Blanks | <input checked="" type="checkbox"/> ¹ | Container Blanks | <input checked="" type="checkbox"/> |
| Field Blanks | <input checked="" type="checkbox"/> ² | Duplicate Samples | <input checked="" type="checkbox"/> |
| Equipment Rinsate Blanks | <input checked="" type="checkbox"/> | Split Samples | <input checked="" type="checkbox"/> ³ |
| Preservative Blanks | <input type="checkbox"/> | Performance Evaluation Samples | <input type="checkbox"/> |

Other (specify) _____

1) Collected for volatile organic sampling

2) As noted in the PSP

3) Split samples will be taken where required by the EPA

8B. Laboratory Quality Control Samples:

- | | | | |
|--------------|-------------------------------------|----------------------------|-------------------------------------|
| Method Blank | <input checked="" type="checkbox"/> | Matrix Duplicate/Replicate | <input checked="" type="checkbox"/> |
| Matrix Spike | <input checked="" type="checkbox"/> | Surrogate Spikes | <input checked="" type="checkbox"/> |
| Tracer Spike | <input checked="" type="checkbox"/> | Other (specify) _____ | |

9. Other: Please identify any other germane information that may impact the data quality or gathering of this particular objective, task, or data use.

Sample density will be dependent upon the CU size (Group 1 [250'x250'] or Group 2 [500'x500']), as determined by historical and pre-certification scan data.

APPENDIX B

A2PI AFP CU

SAMPLES/COORDINATES/IDENTIFICATION

13

**APPENDIX B
A2PI AFP AREA CERTIFICATION SAMPLES**

CERTIFICATION UNIT	SAMPLE ID	ANALYSIS	NORTHING	EASTING
A2P1-AFP-1-C	A2P1-AFP-1-C-01	TAL A	477183	1348238
A2P1-AFP-1-C	A2P1-AFP-1-C-02	TAL A	477156	1348285
A2P1-AFP-1-C	A2P1-AFP-1-C-03	ARCHIVE	477094	1348283
A2P1-AFP-1-C	A2P1-AFP-1-C-04	TAL A	477112	1348338
A2P1-AFP-1-C	A2P1-AFP-1-C-05	TAL A	477036	1348328
A2P1-AFP-1-C	A2P1-AFP-1-C-06	ARCHIVE	477082	1348352
A2P1-AFP-1-C	A2P1-AFP-1-C-07	TAL A	477018	1348382
A2P1-AFP-1-C	A2P1-AFP-1-C-08	TAL A	477063	1348415
A2P1-AFP-1-C	A2P1-AFP-1-C-09	ARCHIVE	476976	1348375
A2P1-AFP-1-C	A2P1-AFP-1-C-10	TAL A	477013	1348427
A2P1-AFP-1-C	A2P1-AFP-1-C-10-D	TAL A	477013	1348427
A2P1-AFP-1-C	A2P1-AFP-1-C-11	TAL A	476996	1348486
A2P1-AFP-1-C	A2P1-AFP-1-C-12	TAL A	477019	1348462
A2P1-AFP-1-C	A2P1-AFP-1-C-13	TAL A	477035	1348534
A2P1-AFP-1-C	A2P1-AFP-1-C-14	TAL A	476991	1348556
A2P1-AFP-1-C	A2P1-AFP-1-C-15	ARCHIVE	477014	1348621
A2P1-AFP-1-C	A2P1-AFP-1-C-16	TAL A	477040	1348589
A2P1-AFP-2-C	A2P1-AFP-2-C-01	TAL A	477060	1348669
A2P1-AFP-2-C	A2P1-AFP-2-C-02	TAL A	477106	1348670
A2P1-AFP-2-C	A2P1-AFP-2-C-03	TAL A	477095	1348609
A2P1-AFP-2-C	A2P1-AFP-2-C-04	ARCHIVE	477151	1348655
A2P1-AFP-2-C	A2P1-AFP-2-C-05	TAL A	477132	1348725
A2P1-AFP-2-C	A2P1-AFP-2-C-06	ARCHIVE	477181	1348741
A2P1-AFP-2-C	A2P1-AFP-2-C-07	TAL A	477172	1348690
A2P1-AFP-2-C	A2P1-AFP-2-C-08	TAL A	477206	1348712
A2P1-AFP-2-C	A2P1-AFP-2-C-09	TAL A	477204	1348782
A2P1-AFP-2-C	A2P1-AFP-2-C-10	TAL A	477274	1348815
A2P1-AFP-2-C	A2P1-AFP-2-C-11	ARCHIVE	477275	1348760
A2P1-AFP-2-C	A2P1-AFP-2-C-12	TAL A	477245	1348729
A2P1-AFP-2-C	A2P1-AFP-2-C-13	TAL A	477300	1348732
A2P1-AFP-2-C	A2P1-AFP-2-C-14	TAL A	477318	1348784
A2P1-AFP-2-C	A2P1-AFP-2-C-15	TAL A	477359	1348712
A2P1-AFP-2-C	A2P1-AFP-2-C-15-D	TAL A	477359	1348712
A2P1-AFP-2-C	A2P1-AFP-2-C-16	ARCHIVE	477345	1348769
A2P1-AFP-3-C	A2P1-AFP-3-C-01	TAL A	477215	1348242
A2P1-AFP-3-C	A2P1-AFP-3-C-01-D	TAL A	477215	1348242
A2P1-AFP-3-C	A2P1-AFP-3-C-02	TAL A	477164	1348324
A2P1-AFP-3-C	A2P1-AFP-3-C-03	TAL A	477111	1348390
A2P1-AFP-3-C	A2P1-AFP-3-C-04	ARCHIVE	477088	1348417
A2P1-AFP-3-C	A2P1-AFP-3-C-05	ARCHIVE	477072	1348451
A2P1-AFP-3-C	A2P1-AFP-3-C-06	TAL A	477064	1348492
A2P1-AFP-3-C	A2P1-AFP-3-C-07	TAL A	477115	1348456
A2P1-AFP-3-C	A2P1-AFP-3-C-08	TAL A	477101	1348482
A2P1-AFP-3-C	A2P1-AFP-3-C-09	ARCHIVE	477066	1348540
A2P1-AFP-3-C	A2P1-AFP-3-C-10	TAL A	477096	1348538

**APPENDIX B
A2P1 AFP AREA CERTIFICATION SAMPLES**

CERTIFICATION UNIT	SAMPLE ID	ANALYSIS	NORTHING	EASTING
A2P1-AFP-3-C	A2P1-AFP-3-C-11	TAL A	477058	1348564
A2P1-AFP-3-C	A2P1-AFP-3-C-12	TAL A	477099	1348576
A2P1-AFP-3-C	A2P1-AFP-3-C-13	ARCHIVE	477133	1348611
A2P1-AFP-3-C	A2P1-AFP-3-C-14	TAL A	477201	1348668
A2P1-AFP-3-C	A2P1-AFP-3-C-15	TAL A	477262	1348681
A2P1-AFP-3-C	A2P1-AFP-3-C-16	TAL A	477328	1348683
A2P1-AFP-4-C	A2P1-AFP-4-C-01	TAL A	477222	1348271
A2P1-AFP-4-C	A2P1-AFP-4-C-02	ARCHIVE	477186	1348314
A2P1-AFP-4-C	A2P1-AFP-4-C-03	TAL A	477160	1348367
A2P1-AFP-4-C	A2P1-AFP-4-C-04	TAL A	477139	1348414
A2P1-AFP-4-C	A2P1-AFP-4-C-04-D	TAL A	477139	1348414
A2P1-AFP-4-C	A2P1-AFP-4-C-05	TAL A	477139	1348465
A2P1-AFP-4-C	A2P1-AFP-4-C-06	TAL A	477125	1348502
A2P1-AFP-4-C	A2P1-AFP-4-C-07	ARCHIVE	477168	1348458
A2P1-AFP-4-C	A2P1-AFP-4-C-08	TAL A	477155	1348520
A2P1-AFP-4-C	A2P1-AFP-4-C-09	TAL A	477117	1348549
A2P1-AFP-4-C	A2P1-AFP-4-C-10	TAL A	477135	1348577
A2P1-AFP-4-C	A2P1-AFP-4-C-11	TAL A	477155	1348550
A2P1-AFP-4-C	A2P1-AFP-4-C-12	ARCHIVE	477179	1348573
A2P1-AFP-4-C	A2P1-AFP-4-C-13	TAL A	477152	1348610
A2P1-AFP-4-C	A2P1-AFP-4-C-14	TAL A	477204	1348602
A2P1-AFP-4-C	A2P1-AFP-4-C-15	TAL A	477210	1348641
A2P1-AFP-4-C	A2P1-AFP-4-C-16	ARCHIVE	477242	1348656
A2P1-AFP-5-C	A2P1-AFP-5-C-01	ARCHIVE	477220	1348385
A2P1-AFP-5-C	A2P1-AFP-5-C-02	TAL A	477187	1348417
A2P1-AFP-5-C	A2P1-AFP-5-C-02-D	TAL A	477187	1348417
A2P1-AFP-5-C	A2P1-AFP-5-C-03	TAL A	477283	1348421
A2P1-AFP-5-C	A2P1-AFP-5-C-04	TAL A	477298	1348468
A2P1-AFP-5-C	A2P1-AFP-5-C-05	ARCHIVE	477203	1348495
A2P1-AFP-5-C	A2P1-AFP-5-C-06	TAL A	477252	1348483
A2P1-AFP-5-C	A2P1-AFP-5-C-07	TAL A	477252	1348544
A2P1-AFP-5-C	A2P1-AFP-5-C-08	TAL A	477244	1348594
A2P1-AFP-5-C	A2P1-AFP-5-C-09	TAL A	477363	1348441
A2P1-AFP-5-C	A2P1-AFP-5-C-10	ARCHIVE	477346	1348510
A2P1-AFP-5-C	A2P1-AFP-5-C-11	TAL A	477436	1348488
A2P1-AFP-5-C	A2P1-AFP-5-C-12	TAL A	477398	1348568
A2P1-AFP-5-C	A2P1-AFP-5-C-13	TAL A	477310	1348564
A2P1-AFP-5-C	A2P1-AFP-5-C-14	TAL A	477293	1348648
A2P1-AFP-5-C	A2P1-AFP-5-C-15	TAL A	477353	1348593
A2P1-AFP-5-C	A2P1-AFP-5-C-16	ARCHIVE	477346	1348651
A2P1-AFP-6-C	A2P1-AFP-6-C-01	TAL A	477229	1348314
A2P1-AFP-6-C	A2P1-AFP-6-C-02	ARCHIVE	477243	1348351
A2P1-AFP-6-C	A2P1-AFP-6-C-03	TAL A	477268	1348289
A2P1-AFP-6-C	A2P1-AFP-6-C-04	TAL A	477287	1348257
A2P1-AFP-6-C	A2P1-AFP-6-C-05	TAL A	477370	1348300

**APPENDIX B
A2PI AFP AREA CERTIFICATION SAMPLES**

CERTIFICATION UNIT	SAMPLE ID	ANALYSIS	NORTHING	EASTING
A2P1-AFP-6-C	A2P1-AFP-6-C-05-D	TAL A	477370	1348300
A2P1-AFP-6-C	A2P1-AFP-6-C-06	TAL A	477318	1348305
A2P1-AFP-6-C	A2P1-AFP-6-C-07	ARCHIVE	477330	1348346
A2P1-AFP-6-C	A2P1-AFP-6-C-08	TAL A	477291	1348373
A2P1-AFP-6-C	A2P1-AFP-6-C-09	TAL A	477400	1348318
A2P1-AFP-6-C	A2P1-AFP-6-C-10	ARCHIVE	477388	1348352
A2P1-AFP-6-C	A2P1-AFP-6-C-11	TAL A	477357	1348376
A2P1-AFP-6-C	A2P1-AFP-6-C-12	TAL A	477366	1348411
A2P1-AFP-6-C	A2P1-AFP-6-C-13	TAL A	477439	1348366
A2P1-AFP-6-C	A2P1-AFP-6-C-14	TAL A	477437	1348396
A2P1-AFP-6-C	A2P1-AFP-6-C-15	ARCHIVE	477411	1348413
A2P1-AFP-6-C	A2P1-AFP-6-C-16	TAL A	477442	1348475
A2P1-AFP-7-C	A2P1-AFP-7-C-01	TAL A	477272	1348236
A2P1-AFP-7-C	A2P1-AFP-7-C-02	ARCHIVE	477385	1348274
A2P1-AFP-7-C	A2P1-AFP-7-C-03	TAL A	477471	1348328
A2P1-AFP-7-C	A2P1-AFP-7-C-04	TAL A	477517	1348327
A2P1-AFP-7-C	A2P1-AFP-7-C-05	TAL A	477492	1348386
A2P1-AFP-7-C	A2P1-AFP-7-C-05-D	TAL A	477492	1348386
A2P1-AFP-7-C	A2P1-AFP-7-C-06	ARCHIVE	477489	1348432
A2P1-AFP-7-C	A2P1-AFP-7-C-07	TAL A	477558	1348377
A2P1-AFP-7-C	A2P1-AFP-7-C-08	TAL A	477536	1348425
A2P1-AFP-7-C	A2P1-AFP-7-C-09	ARCHIVE	477472	1348498
A2P1-AFP-7-C	A2P1-AFP-7-C-10	TAL A	477502	1348469
A2P1-AFP-7-C	A2P1-AFP-7-C-11	TAL A	477485	1348538
A2P1-AFP-7-C	A2P1-AFP-7-C-12	TAL A	477448	1348551
A2P1-AFP-7-C	A2P1-AFP-7-C-13	TAL A	477445	1348586
A2P1-AFP-7-C	A2P1-AFP-7-C-14	TAL A	477415	1348632
A2P1-AFP-7-C	A2P1-AFP-7-C-15	ARCHIVE	477404	1348668
A2P1-AFP-7-C	A2P1-AFP-7-C-16	TAL A	477379	1348705