


**PROJECT SPECIFIC PLAN FOR
CERTIFICATION SAMPLING OF THE
AREA 2, PHASE I FORMER INACTIVE FLYASH
PILE, SOUTH FIELD, CAROLINA AREA,
EAST-WEST CONSTRUCTION ROAD AND
EQUIPMENT WHEEL WASH FACILITY**

**FERNALD ENVIRONMENTAL MANAGEMENT PROJECT
FERNALD, OHIO**

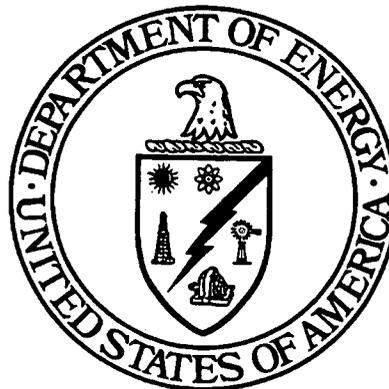

NOVEMBER 5, 2001

**U.S. DEPARTMENT OF ENERGY
FERNALD AREA OFFICE**

**20400-PSP-0004
REVISION 0**

000001

**PROJECT SPECIFIC PLAN FOR
CERTIFICATION SAMPLING OF THE
AREA 2, PHASE I FORMER INACTIVE FLYASH PILE,
SOUTH FIELD, CAROLINA AREA, EAST-WEST
CONSTRUCTION ROAD, AND EQUIPMENT
WHEEL WASH FACILITY**

Document Number 20400-PSP-0004

Revision 0

November 5, 2001

APPROVAL:



Jyh-Dong Chiu, Project Manager
Soil and Disposal Facility Project
11/5/01
Date



Frank Miller, Characterization Manager
Soil and Disposal Facility Project
11/5/01
Date



Tom Buhrlage, Environmental Monitoring
Aquifer Restoration Project
11/5/01
Date



Reinhard Friske, Quality Assurance
Maintenance and Infrastructure Support
11-5-01
Date

FERNALD ENVIRONMENTAL MANAGEMENT PROJECT

Fluor Fernald, Inc.
P.O. Box 538704
Cincinnati, Ohio 45253-8704

000002

TABLE OF CONTENTS

1.0	Introduction.....	1-1
1.1	Purpose.....	1-1
1.2	Scope.....	1-1
1.3	Key Personnel.....	1-2
2.0	Certification Sampling Program.....	2-1
2.1	Certification Design.....	2-1
2.2	CU Sampling.....	2-1
2.3	Surveying.....	2-2
2.4	Physical Soil Sample Collection.....	2-2
2.4.1	Equipment Decontamination.....	2-3
2.4.2	Certification Physical Sample Identification.....	2-4
3.0	Certification Sample Analysis.....	3-1
4.0	Quality Assurance/Quality Control Requirements.....	4-1
4.1	Field Quality Control Samples, Analytical Requirements and Data Validation.....	4-1
4.2	Project-Specific Procedures, Documents and Manuals.....	4-1
4.3	Independent Assessment.....	4-2
4.4	Implementation of Changes.....	4-2
5.0	Health and Safety.....	5-1
6.0	Data Management.....	6-1
Appendix A	Data Quality Objectives SL-052, Rev. 3	
Appendix B	A2PI IFP/SF/EWWF CU Samples/Coordinates/Identification	

LIST OF TABLES

Table 1-1	Key Personnel
Table 3-1	Sampling and Analytical Requirements for the On-Site Laboratory
Table 3-2	Sampling and Analytical Requirements for the Off-Site Laboratory
Table 3-3	A2PI IFP/SF Certification Sampling Target Analyte List

LIST OF FIGURES

Figure 1-1	A2PI Area
Figure 2-1	Area 2, Phase I CU Design
Figure 2-2	Area 2, Phase I CU Sample Locations

LIST OF ACRONYMS AND ABBREVIATIONS

A2PI	Area 2, Phase I
A2PII	Area 2, Phase II
AFP	Active Flyash Pile
APM	Area Project Manager
ASCOC	area-specific constituent of concern
ASL	analytical support level
BTV	benchmark toxicity value
CDL	Certification Design Letter
CERCLA	Comprehensive Environmental Response, Compensation and Liability Act
CLP	Contract Laboratory Program
CU	certification unit
DQO	Data Quality Objectives
EWWF	Equipment Wheel Wash Facility
FACTS	Fernald Analytical Customer Tracking System
FAL	Field Activity Log
FEMP	Fernald Environmental Management Project
FRL	final remediation level
GFAA	graphite-furnace atomic absorption spectrometry
GIS	Geographical Information System
GPS	Global Positioning System
HAMDC	highest allowable minimum detection concentration
ICP	inductively coupled plasma
IFP	Inactive Flyash Pile
LAN	Local Area Network
MDC	minimum detection concentration
mg/kg	milligrams per kilogram
NWU	Non-Waste Unit
OU	Operable Unit
PAH	polyaromatic hydrocarbon
PCB	polychlorinated biphenyl
pCi/g	picoCuries per gram
PSP	Project Specific Plan
QA/QC	Quality Assurance/Quality Control
RWP	Radiological Work Permit
SCQ	Sitewide CERCLA Quality Assurance Project Plan
SED	Sitewide Environmental Database
SEP	Sitewide Excavation Plan
SF	South Field
SPL	Sample Processing Laboratory
SSOD	Storm Sewer Outfall Ditch
TAL	Target Analyte List
V/FCN	Variance/Field Change Notice
VOA	volatile organic analysis
WAO	Waste Acceptance Operations

1.0 INTRODUCTION

1.1 PURPOSE

This Project Specific Plan (PSP) describes the certification sampling and analysis necessary to certify the the footprint of the former Area 2, Phase I (A2PI) Inactive Flyash Pile (IFP), South Field (SF), Carolina Area, East-West Construction Road, Equipment Wheel Wash Facility (EWWF); (herein referred to as the IFP/SF area). Certification demonstrates that risk-based, area-specific constituents of concern (ASCOCs) meet final remediation levels (FRLs). The A2PI IFP/SF certification area is approximately 26 acres and is located in the Southeast corner of the Fernald Environmental Management Project (FEMP) (see Figure 1-1).

A2PI consists of the Southern Waste Units [IFP, SF and Active Flyash Pile (AFP)], and the adjacent Non-Waste Unit (NWU) area as shown in Figure 1-1. A2PI certification is being performed in three phases with the first phase consisting of the AFP area east of the south construction access road, which is already certified. The second and third phase of certification is the IFP/SF area, which is the scope of this Certification Design Letter (CDL). The second phase consists of 20 certification units (CUs) sampled in 2001 after the remediated footprint is excavated and precertified and the third phase consists of the remaining four CUs, which will be sampled after the 2002 excavation season and precertification scanning is conducted.

The A2PI IFP/SF certification area is bounded to the north by an east-west ditch that runs just north of the East-West Construction Road, to the east by the South Access Construction Road and south by Paddys Run and the Storm Sewer Outfall Ditch (SSOD), and the west by Paddys Run and Area 2, Phase II (A2PII).

1.2 SCOPE

This PSP covers all physical sampling associated with A2PI IFP/SF area certification. The certification design is consistent with the CDL for A2PI IFP/SF area. All sampling and analysis activities will be as consistent with the Sitewide Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) Quality Assurance Project Plan (SCQ), Section 3.4 of the Sitewide Excavation Plan (SEP), and Data Quality Objectives (DQO) SL-052, Revision 3. DQO SL-052 is included as Appendix A of this PSP.

This CDL does not cover the certification sampling associated with the following:

- Utility corridor/North-South Access Road that splits the AFP and SF
- Soil beneath the basin transfer lines as well as the soil immediately adjacent to the Well House 16 and the injection/extraction well house (just west of former Basin 3).

The certification of this soil will be conducted as part of Area 10 certification.

1.3 KEY PERSONNEL

Key personnel responsible for performance of the project are listed in Table 1-1.

**TABLE 1-1
 KEY PERSONNEL**

Title	Primary	Alternate
DOE Contact	Rob Janke	Kathi Nickel
Area Project Manager	Jyh-Dong Chiou	Dave Russell
Characterization Manager	Frank Miller	Ana Madani
Field Sampling Lead	Tom Buhrlage	Jim Hey
Surveying Lead	Jim Schwing	Andy Clinton
WAO Contact	Linda Barlow	TBD
Laboratory Contact	Denise Arico	Brenda Collier
Data Validation Contact	Jim Chambers	Erik Corbin
Field Data Validation Contact	Andy Sandfoss	Jim Chambers
Data Management Contact	Ana Madani	Frank Miller
Quality Assurance Contact	Reinhard Friske	Mike Godber
FACTS/SED Database Contact	Krista Blades	TBD
Health and Safety Contact	Debra Grant	Jeff Middaugh

FACTS – Fernald Analytical Customer Tracking System


SED – Sitewide Environmental Database

WAO – Waste Acceptance Organization

v:\scj\31\rdgn\rdgn\c2p2-104a.dgn

STATE PLANNING COORDINATE SYSTEM 1927

05-NOV-2001

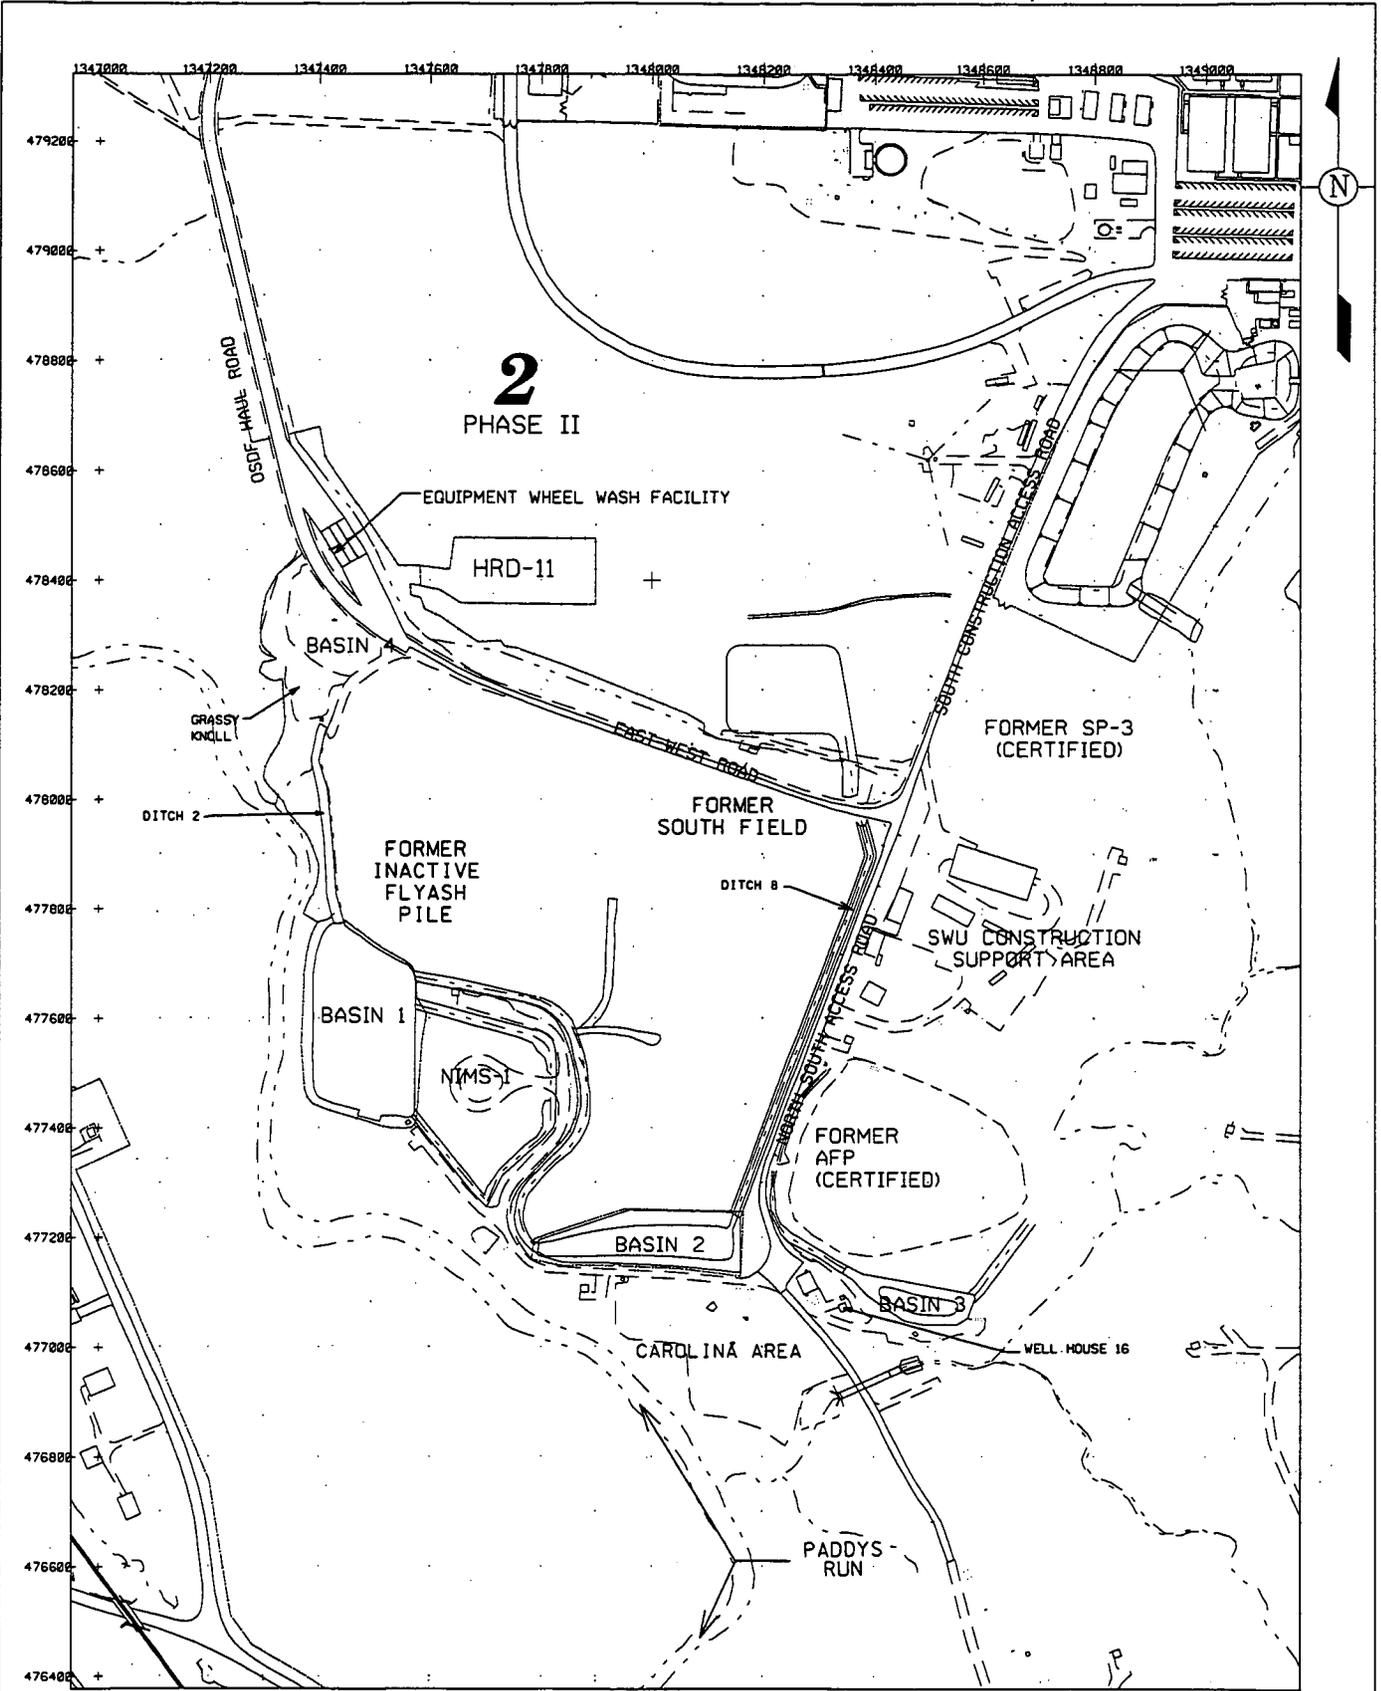

LEGEND:

— REMAINING A2PI CERTIFICATION BOUNDARY SCALE




FIGURE 1-1. A2PI CERTIFICATION AREA

2.0 CERTIFICATION SAMPLING PROGRAM

2.1 CERTIFICATION DESIGN

Details and logic of the certification design for the A2PI IFP/SF area are described in the A2PI IFP/SF CDL. The certification design and sampling strategy follows Section 3.4 of the SEP. Twenty-four Group 1 CUs, which can be as large as 62,500 square feet, are identified and depicted in Figure 2-1. The A2PI IFP/SF CDL CUs consist of the following:

Phase II

- Eleven Group 1 CUs with the Operable Unit (OU) 2 total uranium FRL:
 - IFP-C-1 through -4 – the footprint of the former IFP area
 - SF-C-1 through -7 – the footprint of the former SF area
- Nine Group 1 CUs with the OU5 total uranium FRL (the NWU area):
 - NWU-1 and -2 – footprint of the Non-Impacted Material Stockpile 1 and the turnaround area
 - NWU-3 and -4 – footprint of Basin 1
 - NWU-5 – Grassy Knoll area south of Basin 4
 - NWU-6 through -9 – Footprint and surrounding areas of Carolina and Perimeter Area excavations

Phase III

- Four Group 1 CUs with the OU5 total uranium FRL (the NWU area):
 - NWU-10 – Footprint of Basin 4
 - NWU-11 – Footprint of EWWF and the East-West Construction Haul Road
 - NWU-12 and -13 – Footprint of Ditch 1 and Basin 2.

2.2 CU SAMPLING

Certification sampling consists of the collection of randomly selected physical soil samples within each CU per Section 3.4.2.1 in the SEP. In order to determine which samples to analyze while still providing sufficient area coverage, each CU is divided into quadrants, with each quadrant containing four sample locations. Three of the four samples from each quadrant are then randomly selected for analysis, resulting in a total of 12 samples analyzed per CU. The 12 samples to be collected for each CU are identified in Appendix B.

Appendix B includes a list of archive samples. The archive sample locations will be placed in the field, but samples will not be collected unless analysis is needed. If archived samples are to be collected and analyzed, a Variance/Field Change Notice (V/FCN) will be generated to document the request.

Figure 2-2 and Appendix B list all the samples per CU including coordinates and Target Analyte List (TAL). Each sample will be submitted for the TAL parameters listed in Table 3-3.

2.3 SURVEYING

The NAD83 State Planar coordinates have been determined for each sample location listed in Appendix B. Before collection, sample locations will be identified and flagged using standard land surveying methods. Archive sample locations will not be identified and flagged. If an archive sample is required for collection, the surveying group will then identify and flag the location. The elevation of the sample surface will be collected during placement of the sample flag. If surface features prevent collection of soil samples at the planned location, the sample location may be field adjusted to accommodate safe and reasonable sample locations but may not cross CU boundaries. Any sample location moved more than 3 feet from the planned location must be approved by the regulatory agencies and documented in a V/FCN.

2.4 PHYSICAL SOIL SAMPLE COLLECTION

Soil samples will be collected using a 3-inch by 6-inch long diameter plastic or stainless steel core liner and will be sealed using plastic end caps, as identified in Procedure SMPL-01. A variety of sampling equipment and methods will potentially be utilized for sampling locations depending on the surface conditions. More specifically, the surface soil sampling locations in areas covered by grass will be sampled using a 3-inch diameter plastic or stainless steel liner or hand auger. At the discretion of the Field Sampling Lead, samples may be collected using other methods with concurrence from the Characterization Manager as specified in SMPL-01. The metals samples will be collected in the same push tube (core liner) as the radiological samples if plastic core liners are used. The metals samples may not be collected in metal or stainless steel liners.

Before collecting the soil cores, the field sampling technician will remove all surface vegetation within a 6-inch radius of the points to be sampled using a blue nitrile glove or stainless steel trowel, taking care not to remove any of the surface soil. Regardless of the sample collection apparatus, the surface soil samples will be collected from the 0 to 6-inch interval at each location. For samples that are required a

duplicate sample to meet the quality control requirements, twice the sample volume will be collected at those sample locations (identified in Appendix B). These duplicate soil samples will be collocated within a 1-foot radius and not composited. All samples, including duplicates, will be assigned a unique sample identification number as identified in Section 2.4.2 and Appendix B.

If surface or subsurface obstacles prevent sample collection at any of the original locations identified in Appendix B, the location may be moved up to 3 feet in radius from the original location. The distance and direction moved will be noted on the Field Activity Log (FAL). If any certification sampling location is moved, it must remain within the boundary of the same sub-CU. Customer sample numbers and FACTS identification numbers will be assigned to all samples collected. The sample labels will be completed with sample collection information, and technicians will complete a FAL, Sample Collection Log, and Chain of Custody/Request for Analysis; this documentation is to be completed in the field prior to submitting the samples.

All samples collected from one CU (including duplicate samples) will be batched and submitted to the Sample Processing Laboratory (SPL) on one Chain of Custody form as one analytical release. Water Quality Control (QC) samples will be listed on a separate Chain of Custody. If collected, archive samples (see Appendix B) will be kept under the Chain of Custody of the field crew and will not be submitted to the SPL unless directed in a V/FCN. Upon completion of sample collection, boreholes will be collapsed. If samples are submitted for off-site analysis, one alpha/beta screening sample will be collected per CU.

2.4.1 Equipment Decontamination

Decontamination is performed to protect worker health and safety and to prevent the introduction of contaminants from sampling equipment to subsequent soil samples. Field technicians will ensure that sampling equipment has been decontaminated prior to transport to the field sampling site.


Decontamination is only necessary in the field when sampling equipment is reused. Push tubes and core tube end caps require decontamination prior to use. If an alternate sampling method is used, equipment will be decontaminated between collection of sample intervals and again after the sampling performed under this PSP is completed. Equipment that comes into contact with the sample will be decontaminated at Level II (Section K.11 of the SCQ) in the field. Clean disposable wipes may be used to replace air drying of the equipment.

2.4.2 Certification Physical Sample Identification

Each certification soil sample will be assigned a unique sample identification code, as follows:

- A2P1 = Sample collected from A2PI (Note that the number "1" is used in place of the roman numeral "I" in the ID number for data management purposes)
- NWU = Non-Waste Unit area CU
- IFP = Inactive Flaysh Pile area CU
- SF = South Field area CU
- C = Certification Sample
- CU = Certification unit, sequential CU numbering within each specific area (i.e., NWU, IFP, and SF)
- Location = Sample location number within each CU (1 through 16)
- Suite = Suite Identifier
 - "R" for radiological
 - "M" for metals
 - "L" for volatiles
 - "P" for PCBs
 - "S" for semi-volatiles
 - "V" for archive
- QC = Quality control sample, if applicable.
 - "D" indicates a duplicate sample,
 - "X" indicates a rinsate
 - "Y" indicates a container blank sample.

Therefore, a duplicate sample taken for rads and metals from the 15th sample location from within the NWU CU-1 would be identified as A2P1-NWU-C-1-15-RM-D.

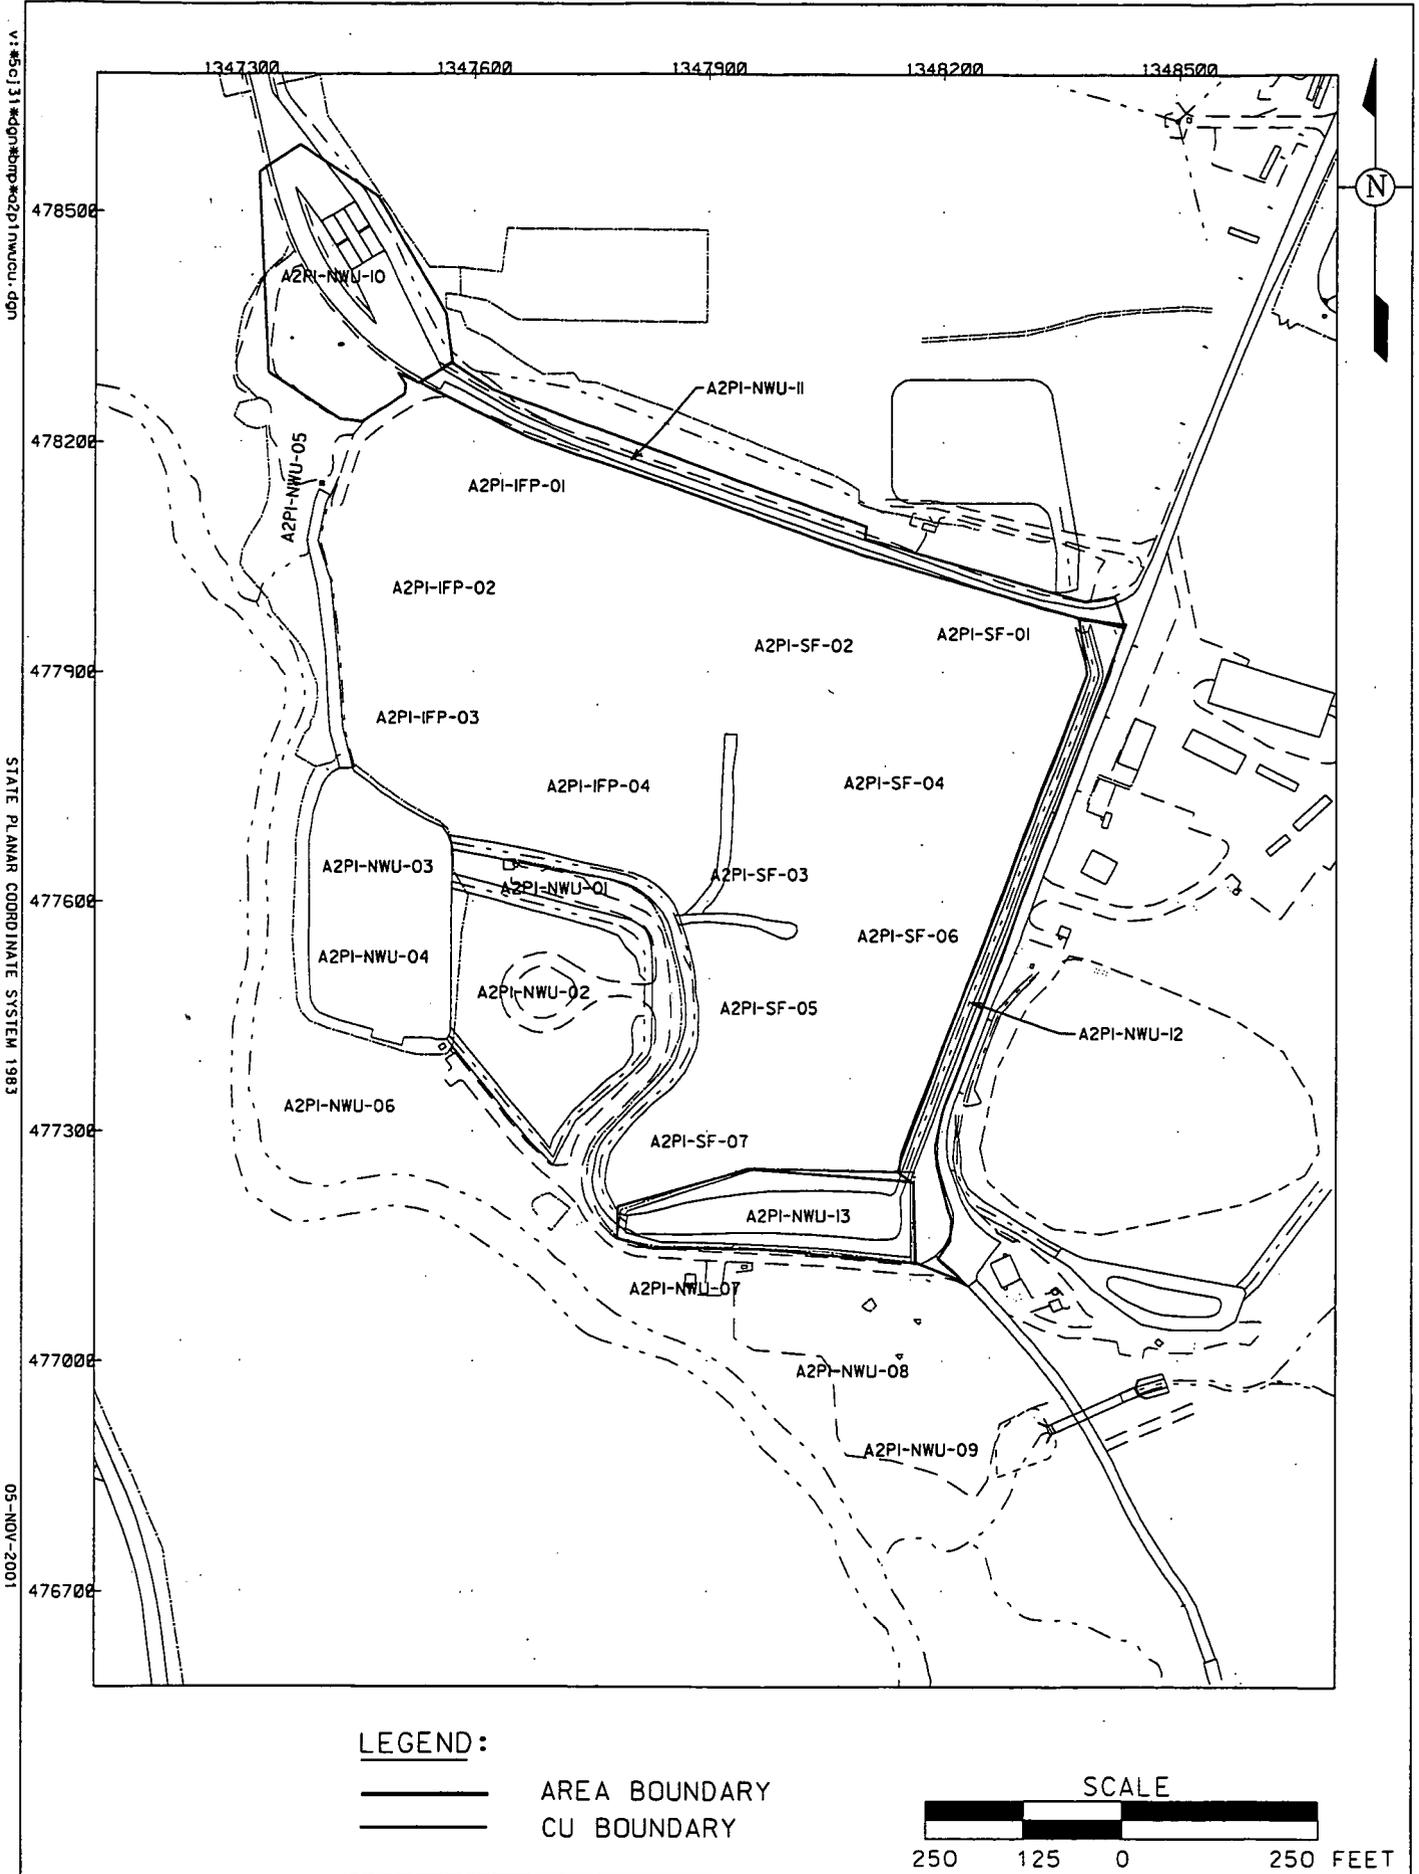

LEGEND:

- AREA BOUNDARY
- - - CU BOUNDARY

SCALE





FIGURE 2-1. AREA 2, PHASE I CU DESIGN

000012

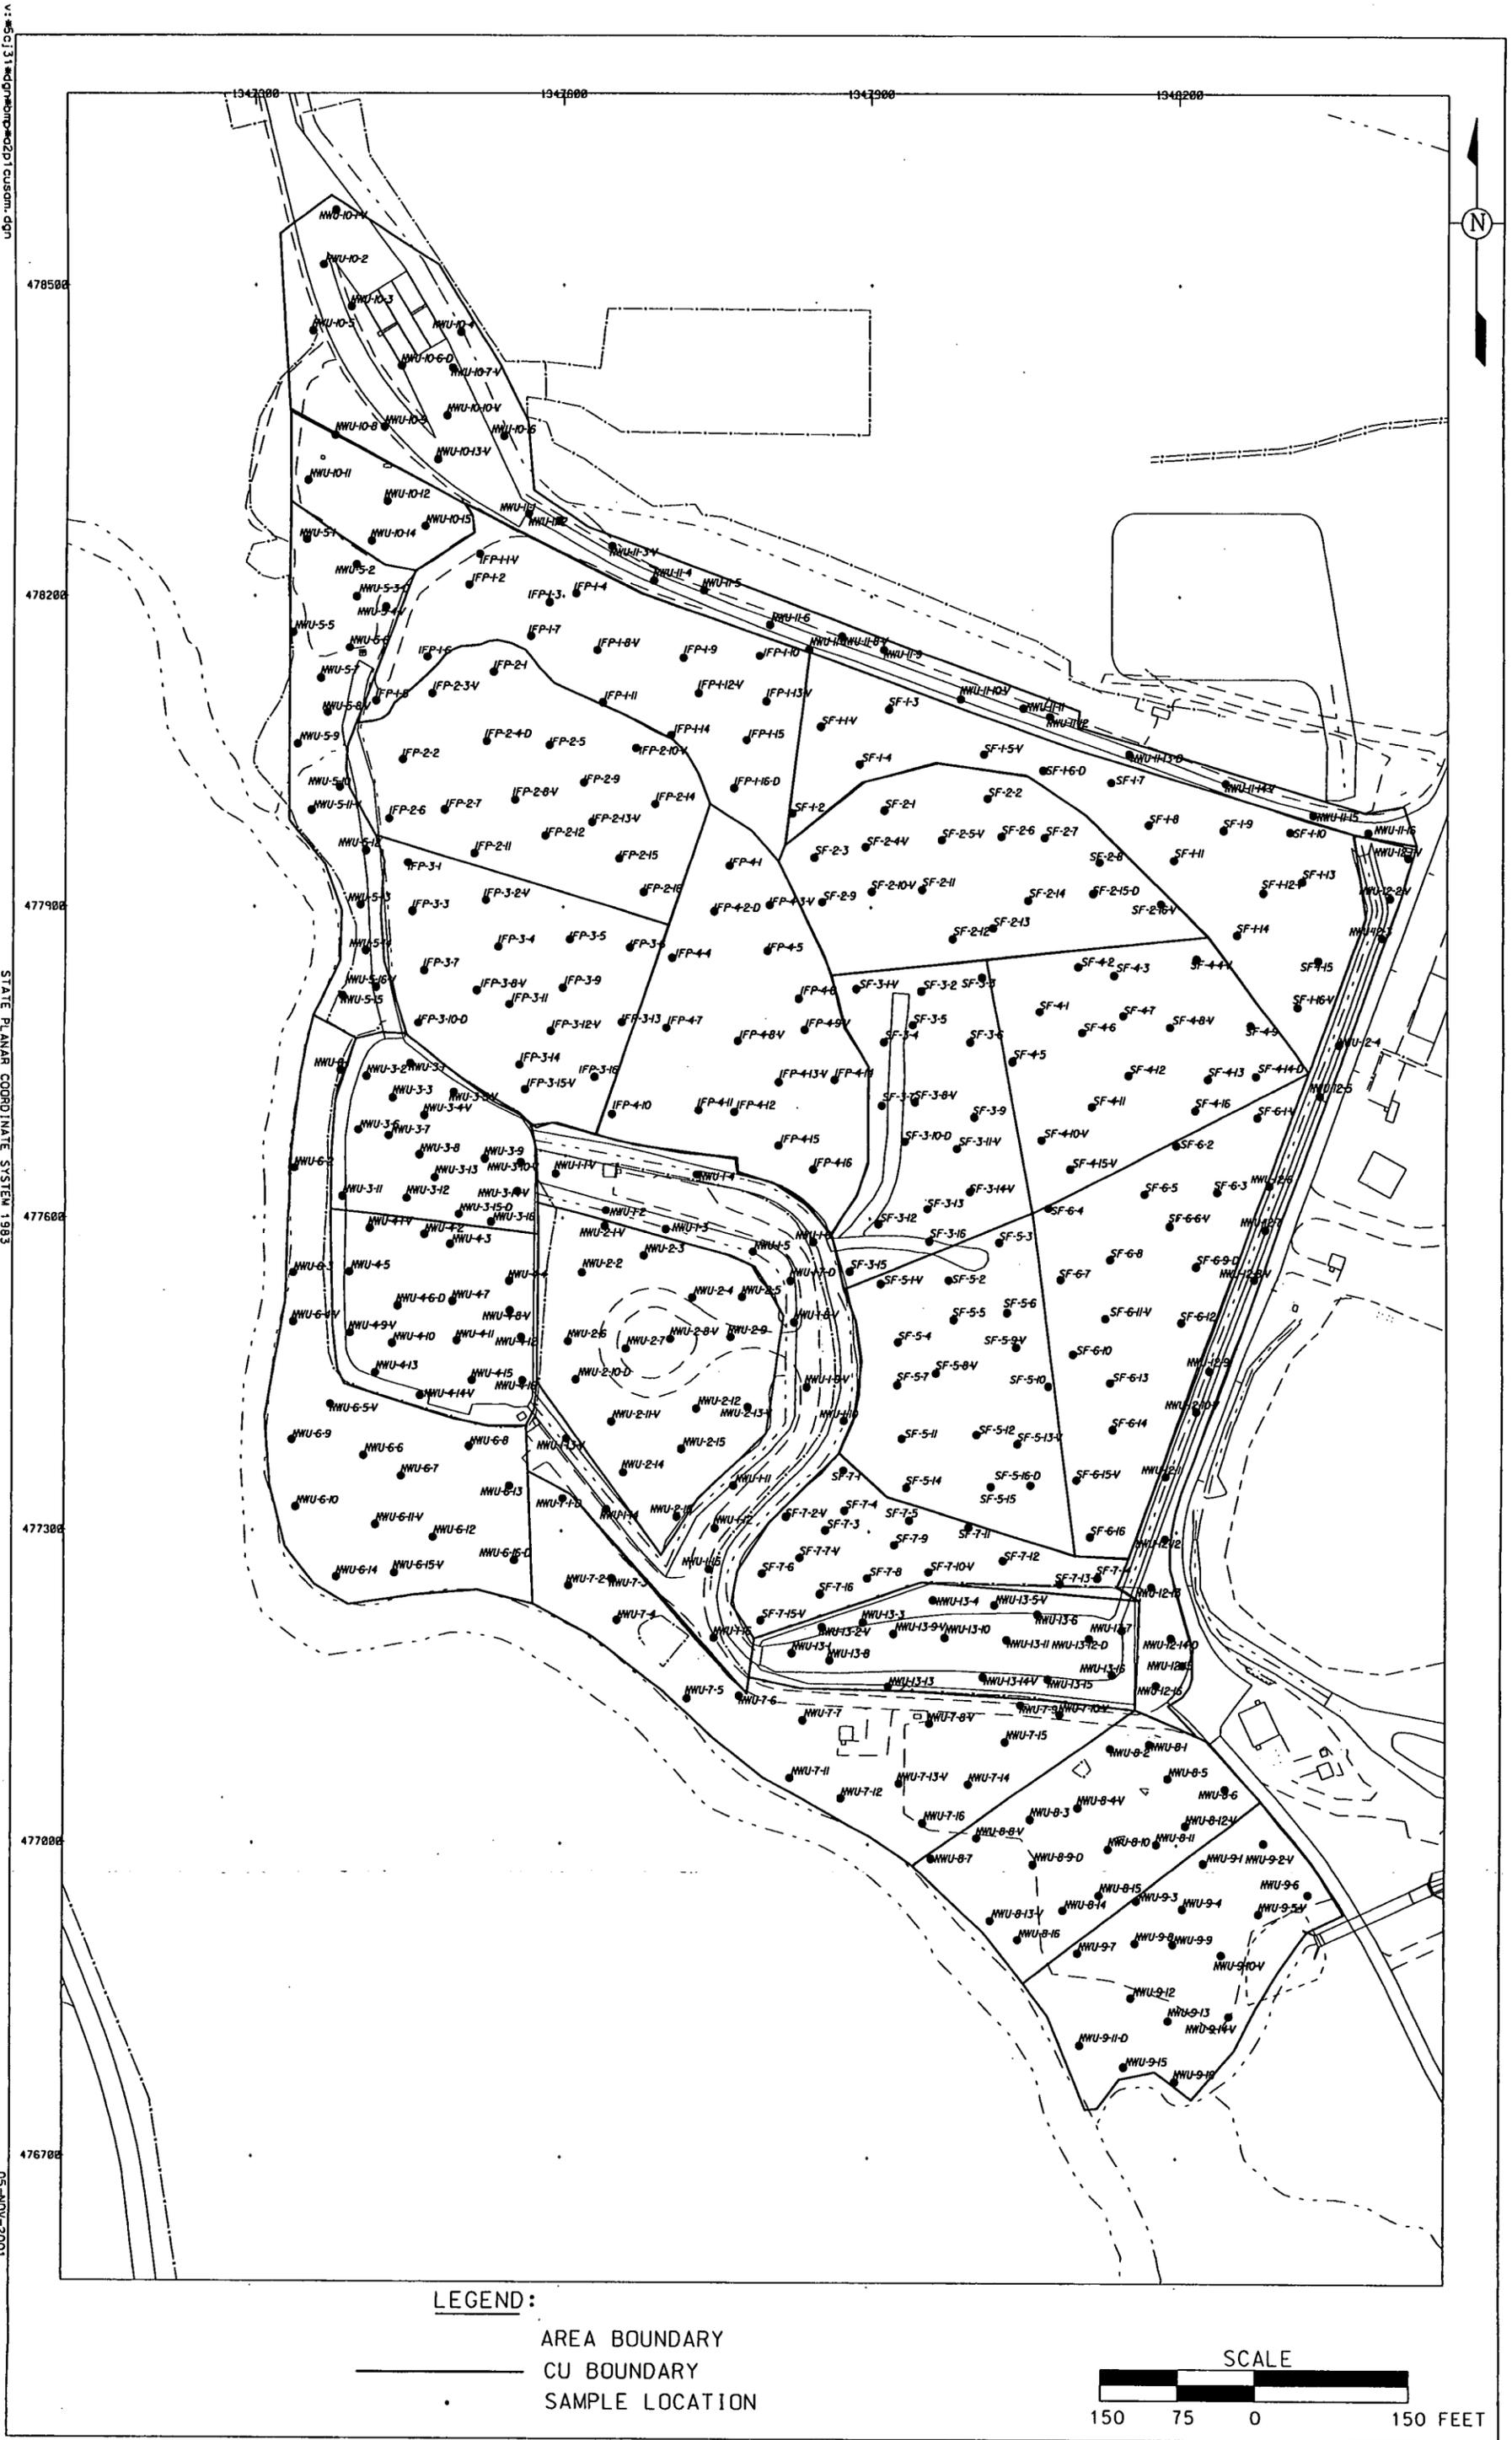

LEGEND:
 — AREA BOUNDARY
 — CU BOUNDARY
 • SAMPLE LOCATION

SCALE
 150 75 0 150 FEET

FIGURE 2-2. AREA 2, PHASE I CU SAMPLE LOCATIONS

STATE PLANNING COORDINATE SYSTEM 1983
 05-NOV-2001
 000013

3954

3.0 CERTIFICATION SAMPLE ANALYSIS

The necessary volume of all samples collected will be prepared for the appropriate analytical method per requirements of the SCQ. Sampling and analytical requirements are listed in Tables 3-1 and 3-2. The TALs are shown in Table 3-3.

If the Area Project Manager (APM) decides to analyze samples subject to methods not described in the SCQ, the APM shall ensure that:

- A variance is issued to include references confirming that the new method is sufficient to support data needs
- Variations from the SCQ methodology are documented in the PSP, or
- The APM may request data validation for affected samples or communicate to the lab that Data Qualifier Codes of J and R be attached to detected and non-detected constituents of concern, respectively.

**TABLE 3-1
 SAMPLING AND ANALYTICAL REQUIREMENTS FOR THE ON-SITE LABORATORY**

Analyte	Method	Sample Matrix	ASL	Preserve	Holding Time	Container	Sample Mass
Total Uranium, Radium-226, Radium-228, Thorium-228, Thorium-232, Thorium-230, Cesium-137	Alpha or Gamma Spectroscopy	Solid	E ^a	None	12 months	Plastic or stainless steel core liner or glass or polyethylene sample container	300 grams
Arsenic, Beryllium, Molybdenum, Lead	ICP or GFAA	Solid	D	Cool, 4° C	6 months	Collect in same core liner as rad sample ^b	20 grams
Total Uranium, Radium-226, Radium-228, Thorium-228, Thorium-232, Thorium-230, Cesium-137	Alpha or Gamma Spectroscopy	Liquid (rinsate/ container blank)	E ^a	HNO ₃ to pH<2	6 months	4 liter polyethylene	Two 4 liters
Arsenic, Beryllium, Molybdenum, Lead	ICP or GFAA	Liquid (rinsate/ container blank)	D	Cool, 4° C	6 months	1 liter polyethylene	1 liter

GFAA – graphite-furnace atomic absorption spectrometry
 ICP – inductively coupled plasma

- ^a The SCQ highest allowable minimum detectable concentration (HAMDC) for total uranium, thorium-228, and thorium-232 by gamma spectroscopy at Analytical Support Level (ASL) D is more stringent the minimum detectable concentration (MDC) needed for this certification. The MDC needed for this certification event is 10 percent of the FRL. Thus, the data deliverable for total uranium, thorium-228, and thorium-232 analysis by gamma spectroscopy will be identical in specifications for ASL D except for the HAMDC. As a result, the total uranium, thorium-228, and thorium-232 gamma spectroscopy data are considered ASL E.
- ^b Soil samples for metals analysis can not be collected or submitted in stainless steel liners. The SCQ specifies glass containers with teflon lined caps; however, polyethylene containers (core liners) may also be used as allowed by Contract Laboratory Program (CLP) procedure ILM04.0.

**TABLE 3-2
SAMPLING AND ANALYTICAL REQUIREMENTS FOR THE OFF-SITE LABORATORY**

Analyte	Sample Matrix	ASL	Preservative	Holding Time	Container*	Sample Mass
PAHs - Benzo(a)pyrene Dibenzo(a,h)anthracene Indeno(1,2,3-cd)pyrene	Solid	D	Cool, 4°C	14 days	Glass with teflon lined cap	100 grams
PAHs - Benzo(a)pyrene Dibenzo(a,h)anthracene Indeno(1,2,3-cd)pyrene	Liquid (rinsate/trip blanks)	D	Cool, 4°C	7 days	Amber glass with teflon-lined cap	1 liter
VOAs - Bromodichloromethane 1,1-dichloroethene	Solid	D	Cool, 4°C	14 days	60-ml glass with teflon lined septa	50 grams (no headspace)
VOAs - Bromodichloromethane 1,1-dichloroethene	Liquid (rinsate/ trip blanks)	D	Cool, 4°C H ₂ SO ₄ to pH<2	14 days	Three 40-ml glass with teflon lined septa	N/A
PCBs - Aroclor-1254 Aroclor-1260	Solid	D	Cool, 4°C	14 days	Glass with teflon lined cap	100 grams
PCBs - Aroclor-1254 Aroclor-1260	Liquid (rinsate)	D	Cool, 4°C	7 days	Amber glass with teflon lined cap	1 liter

VOA – volatile organic analysis

* Polyaromatic analysis (PAH) and polychlorinated biphenyl (PCB) samples may be submitted in the same container, provided the minimum sample mass is achieved for each analysis.

000016

**TABLE 3-3
 A2PI IFP/SF CERTIFICATION SAMPLING
 TARGET ANALYTE LIST**

**TAL 20400-PSP-0004-A
 (ASL D, E*)**

Analyte	FRL Limit	MDC
Total Uranium	82/10 mg/kg	8/1 mg/kg
Thorium-228	1.7 pCi/g	.17 pCi/g
Thorium-232	1.5 pCi/g	.15 pCi/g
Radium-226	1.7 pCi/g	.17 pCi/g
Radium-228	1.8 pCi/g	.18 pCi/g

mg/kg – milligrams per kilogram
 pCi/g – picoCuries per gram

* The SCQ HAMDC for total uranium, thorium-228, and thorium-232 by gamma spectroscopy at ASL D is more stringent the MDC needed for this certification. The MDC needed for this certification event is 10 percent of the FRL. Thus, the data deliverable for total uranium, thorium-228, and thorium-232 analysis by gamma spectroscopy will be identical in specifications for ASL D except for the HAMDC. As a result, the total uranium, thorium-228, and thorium-232 gamma spectroscopy data are considered ASL E. The 1 mg/kg MDC is for CUs IFP-1 through IFP-4 and SF-1 through SF-7 (OU2 area CUs). The 8 mg/kg MDC is for CUs NWU-1 through NWU-13.

**TAL 20400-PSP-0004-B
 (ASL D)**

Analyte	FRL Limit	MDC
Arsenic	12 mg/kg	3.44 mg/kg
Beryllium	1.5 mg/kg	0.15 mg/kg

**TAL 20400-PSP-0004-C
 (ASL D)**

Analyte	FRL/BTV Limit	MDC
Lead	400/200 mg/kg	4.0/2.0 mg/kg
Molybdenum	10 mg/kg (BTV)	1.0 mg/kg

BTV – benchmark toxicity level

TAL 20400-PSP-0004-D
(ASL D)

Analyte	FRL Limit	MDC
Aroclor-1254	.13 mg/kg	0.033 mg/kg
Aroclor-1260	.13 mg/kg	0.033mg/kg

TAL 20400-PSP-0004-E
(ASL D)

Analyte	FRL Limit	MDC
Dibenzo(a,h)anthracene	2.0 mg/kg	0.2 mg/kg
Benzo(a)pyrene	2.0 mg/kg	0.33 mg/kg
Indeno(1,2,3-cd)pyrene	20.0 mg/kg	2.0 mg/kg

Note: The MDCs for benzo(a)pyrene, aroclor-1254, aroclor-1260, and dieldrin are sufficient although they are higher than ten percent of the FRL MDC. In addition, dibenzo(a,h)anthracene will be analyzed by SW846 method 8310 since the CLP method cannot achieve an MDC less than the FRL.

TAL 20400-PSP-0004-F
(ASL D)

Analyte	FRL Limit	MDC
Bromodichloromethane	4.0 mg/kg	0.40 mg/kg
1,1-dichloroethene	0.41 mg/kg	0.041 mg/kg

TAL 20400-PSP-0004-G
(ASL D)

Analyte	FRL Limit	MDC
Thorium-230	6.97 pCi/g	0.697 pCi/g

TAL 20400-PSP-0004-H
(ASL D)

Analyte	FRL Limit	MDC
Thorium-230	6.97 pCi/g	0.697 pCi/g
Cesium-137	1.4 pCi/g	.140 pCi/g

4.0 QUALITY ASSURANCE/QUALITY CONTROL REQUIREMENTS

4.1 FIELD QUALITY CONTROL SAMPLES, ANALYTICAL REQUIREMENTS AND DATA VALIDATION

The field quality control, analytical and data validation requirements are as follows:

- Field quality control requirements include one duplicate for each CU, as noted in Appendix B and further described in Section 2.4. Two container blanks will be collected - one before sample collection begins and one at the conclusion of sample collection - for the push tubes and end caps. If an alternate sample collection method is used, one rinsate sample will be collected at a minimum frequency of one per 20 certification samples where reusable equipment (e.g., hand augers) is used for collection. All field QC samples will be analyzed per TAL 20400-PSP-0004-A and -B.
- All analyses will be performed at ASL D with an exception for total uranium, thorium-228 and thorium-232. The analytical package for total uranium, thorium-228 and thorium-232 analysis by gamma spectroscopy will be identical in specifications for ASL D except for the HAMDC. As a result, the total uranium, thorium-228 and thorium-232 gamma spectroscopy data are considered ASL E.
- All field data will be validated. An ASL D analytical package will be provided for 10 percent of the samples at a minimum and an ASL B package for 90 percent or less of the samples. At a minimum, 10 percent of the analytical data will be validated to ASL D and ninety percent to ASL B. This will be obtained by three randomly selected CUs; A2P1-SF-C-3, A2P1-SF-C-8 and A2P1-NWU-C-11. If any result is rejected, all data from the laboratory with the rejected result will then be validated to determine the integrity of the results from that laboratory. This change will be documented in a variance to this PSP.

Once all data are validated as required, results will be entered into the SED and a statistical analysis will be performed to evaluate the pass/fail criteria for the each CU. The statistical approach is discussed in Section 3.4.3 and Appendix G of the SEP. This work is being performed per the requirements as stated in DQO SL-052 (Appendix A).

4.2 PROJECT-SPECIFIC PROCEDURES, DOCUMENTS AND MANUALS

To ensure consistency and data integrity, field activities in support of the PSP will follow the requirements and responsibilities outlined in the procedures and guidance documents referenced below.

- ADM-02, Field Project Prerequisites
- EQT-33, Real Time Differential Global Positioning System Operation
- Sitewide CERCLA Quality Assurance Project Plan (SCQ)
- SMPL-01, Solids Sampling

- SMPL-21, Collection of Field Quality Control Samples
- S.P. 766-S-1000, Shipping Samples to Offsite Laboratories
- Trimble Pathfinder Pro-XL GPS Operation Manual
- Sitewide Excavation Plan (SEP)
- Certification Design Letter for the A2PI Former IFP, SF, Carolina Area, East-West Construction Road, and EWWF

4.3 INDEPENDENT ASSESSMENT

Independent assessment may be performed by the FEMP Quality Assurance (QA) organization by conducting a surveillance, consisting of monitoring/observing ongoing project activities and work areas to verify conformance to specified requirements. Surveillances will be planned and documented in accordance with Section 12.3 of the SCQ.

4.4 IMPLEMENTATION OF CHANGES

Before implementation changes, the Field Sampling Lead will be informed of the proposed changes. Once the Field Sampling Lead has obtained written or verbal approval (electronic mail is acceptable) from the APM, QA, and the Characterization Lead for the changes to the PSP, the changes may be implemented. Changes to the PSP will noted in the applicable field activity logs and on a V/FCN. QA must receive the completed V/FCN, which includes the signatures of the Characterization Lead, Sampling Manager, APM, and QA within seven working days of implementation of the change. All significant field changes (sample moves greater than 3 feet, changes from SEP certification strategy, etc.) require Agency approval.

5.0 HEALTH AND SAFETY

Technicians will conform to precautionary surveys performed by personnel representing the Utility Engineer, Industrial Hygiene, and Radiological Control as applicable. All work performed on this project will be performed in accordance to applicable Environmental Monitoring project procedures, RM-0020 (Radiological Control Requirements Manual), RM-0021 (Safety Performance Requirements Manual), Fluor Fernald work permit, Radiological Work Permit (RWP), penetration permits, and other applicable permits. All personnel in the performance of their assigned duties require concurrence with applicable safety permits. A safety briefing will be conducted prior to the initiation of field activities.

All emergencies shall be reported immediately on extension 911, or to the Site Communications Center at 648-6511 (if using a cellular phone), or using a radio and contacting "CONTROL" on Channel 11.

6.0 DATA MANAGEMENT

A data management process will be implemented to collect and manage certification information collected during the investigation. As specified in Section 5.1 of the SCQ, daily activities will be recorded on the FAL, with sufficient detail to be able to reconstruct a particular situation without reliance on memory. Sample Collection Logs will be completed according to procedure ADM-02.

Electronically recorded data from the Geodimeter or Global Positioning System (GPS) will be downloaded to disks on a daily basis unless otherwise instructed. Survey team members will review the data for completeness and accuracy and then download it onto the Local Area Network (LAN). Once on the LAN, the Data Management Contact will perform an evaluation of the coordinate data. Once complete, the data will be sent to the loader, where it will be loaded onto the Oracle system and an error log will be generated. The data will then be made available to users through both the Geographical Information System (GIS) and Microsoft® Access Software. Survey field team members will retain all downloaded data on disk for future reference and archive.

Field documentation, such as the FAL, Geodimeter Survey Files, the Sample Collection Log, and the Sample Request/Sample Analysis Chain of Custody Log will undergo an internal QA/QC review by the field team members. Copies will then be generated and delivered to the Data Management Contact, who will perform an evaluation of the data and create the appropriate links between the electronically recorded data and the paper-generated data. The paper-generated data will be sent to data entry personnel for input into the SED. Field logs may be completed in the field and maintained in loose-leaf form. The QA validation team will validate field packages.

Analytical data from on-site and/or off-site laboratories will be reported in preliminary form to the Characterization Lead on at least a weekly basis. This will be done by the laboratory contact as soon as the data are available in the FACTS database. Following required validation of the data for each sample release, the data from that release will be reported to the Characterization Lead in a summary data report format. All analytical data will be entered into the SED with the appropriate qualifier.

All records associated with this PSP should reference the PSP number and eventually be forwarded to Engineering/Construction Document Control to be placed in the project file.

APPENDIX A

DATA QUALITY OBJECTIVES SL-052, REV. 3

DQO #: SL-052, Rev. 3
Effective Date: March 3, 2000

Control Number _____

Fernald Environmental Management Project

Data Quality Objectives

Title: Sitewide Certification Sampling and Analysis

Number: SL-052


Revision: 3

Effective Date: March 13, 2000

Contact Name: Mike Rolfes

Approval: 
James Chambers
DQO Coordinator

Date: 3/13/00

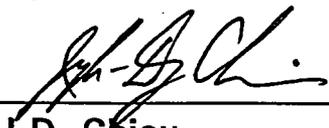Approval: 
J.D. Chiou
SCEP Project Director

Date: 3/13/00

Rev. #	0	1	2	3			
Effective Date:	4/28/99	6/10/99	2/3/00	3/13/00			

DATA QUALITY OBJECTIVES Sitewide Certification Sampling and Analysis

Members of Data Quality Objectives (DQO) Scoping Team

The members of the scoping team included individuals with expertise in QA, analytical methods, field sampling, statistics, laboratory analytical methods and data management.

Conceptual Model of the Site

Soil sampling was conducted at the Fernald Environmental Management Project (FEMP) during the Operable Unit 5 (OU5) Remedial Investigation/Feasibility Study (RI/FS). Final Remediation Levels (FRLs) for constituents of concern (COCs), along with the extent of soil contaminated above the FRLs, were identified in the OU5 Record of Decision (ROD). Actual soil remediation activities now fall under the guidance of the final Sitewide Excavation Plan (SEP).

As outlined in the SEP, the FEMP has been divided into individual Remediation Areas (or phased areas within a Remediation Area) to sequentially carry out soil remedial activities. Under the strategy identified in the SEP, pre-design investigations are first conducted to better define the limits of soil excavation requirements. Following any necessary excavation, pre-certification real-time scanning activities are conducted to evaluate residual patterns of soil contamination. Pre-certification scan data should provide a level of assurance that the FRLs will be achieved. When pre-certification data indicate that remediation goals are likely to be met, they are used to define certification units (CUs) within the Remediation Area of interest. Table 2-9 of the final SEP identifies a list of area-specific COCs (ASCOCs) for each Remediation Area at the FEMP. Based on existing data and production knowledge, a subset of these ASCOCs are conservatively identified within each CU as potentially present in the CU. This suite of CU-specific COCs is the subset of the ASCOCs to be evaluated against the FRLs within that CU. At a minimum, the five primary radiological COCs (total uranium, radium-226, radium-228, thorium-228, thorium-232) will be retained as CU-specific COCs for certification of each CU.

Delineation and justification for the final CU boundaries, along with each corresponding suite of CU-specific ASCOCs is documented in a Certification Design Letter. Upon approval of the Certification Design Letter by the EPA, certification activities can begin. Section 3.4 of the final SEP presents the general certification strategy.

000026

000000

1.0 Statement of Problem

FEMP soil and potentially impacted adjacent off-property soil must be certified on a CU by CU basis for compliance with the FRLs of all CU-specific ASCOCs. The appropriate sampling, analytical and information management criteria must be developed to provide the required qualified data necessary to demonstrate attainment of certification statistical criteria. For every area undergoing certification, a sampling plan must be in place that will direct soil samples to be collected which are representative of the CU-specific COC concentrations within the framework of the certification approach identified in the final SEP. The appropriate analytical methodologies must be selected to provide the required data.

Exposure to Soil

The cleanup standards, or FRLs, were developed for a final site land use as an undeveloped park. Under this exposure scenario, receptors could be directly exposed to contaminated soil through dermal contact, external radiation, incidental ingestion, and/or inhalation of fugitive dust while visiting the park. Exposure to contaminated soil by the modeled receptor is expected to occur at random locations within the boundaries of the FEMP and would not be limited to any single area. Some soil FRLs were developed based on the modeled cross-media impact potential of soil contamination to the underlying aquifer. In these instances, potential exposure to contaminants would be indirect through the groundwater pathway, and not directly linked to soil exposure. Off-site soil FRLs were established at more conservative levels than the on-property soil FRLs, based on an agricultural receptor. Benchmark Toxicity Values (BTVs) are also being considered in the cleanup process by assessing habitat impact of individual BTVs under post-remedial conditions.

Available Resources

Time: Certification sampling will be accomplished by the field sampling team prior to interim or final regrading or release of soil for construction activities. The certification sampling schedule must allow sufficient time, in the event additional remediation is required, to demonstrate certification of FRLs prior to permanent construction or regrading. Certification sampling will have to be completed and analytical results validated and statistical analysis completed prior to submission of a Certification Report to the regulatory agencies.

Project Constraints: Certification sampling and analytical testing must be performed with existing manpower, materials and equipment to support the certification effort.

Remediation areas are prioritized for certification sampling and analysis according to the date required for initiation of sequential construction activities in those areas. Fluor Daniel Fernald (FDF) and DOE must demonstrate post-remedial compliance with the CU-specific COC FRLs to release the designated Remediation Area for

planned interim grading, eventual restoration under the Natural Resources Restoration Plan (NRRP), and other final land use activities.

2.0 Identify the Decision

Decision

Demonstrate within each CU if all CU-specific COCs pass the certification criteria. These criteria are as follows: 1) The average concentration of each CU-specific COC is below the FRL and within the agreed upon confidence limits (95% for primary ASCOCs and 90% for secondary ASCOCs); and 2) the hot-spot criteria, that no result for any CU-specific COC is more than two times the associated soil FRL. The certification criteria are discussed in greater detail in Section 3.4.4 of the final SEP.

Possible Results

1. The average concentration of each CU-specific COC is demonstrated to be below the FRLs within the confidence level, with no single result for any CU-specific COC greater than two times the associated FRL. The CU can then be certified as attaining remediation goals.
2. The average concentration of at least one CU-specific COC is demonstrated to be above the FRL at the given confidence level. The CU will fail certification and require additional remedial action, per Section 3.4.5 of the final SEP.
3. If a result(s) of one or more CU-specific COC is demonstrated to be at or above two times the FRL, the CU will fail certification. The CU will fail certification and require additional remedial action per Section 3.4.5 of the final SEP. A combination of results 2 and 3 also constitutes certification failure.

3.0 Inputs That Affect the Decision

Required Information

Certification data will be obtained through physical soil sampling. Based on the certification analytical results, the average concentrations of each CU-specific COC with specified confidence levels will be calculated using the statistical methods identified in Appendix G of the final SEP.

Source of Information

Per the SEP, analysis of certification samples for each CU-specific COC will be conducted at analytical support level (ASL) D in accordance with methods and QA/QC standards in the FEMP Sitewide CERCLA Quality Assurance Project Plan [SQ].

Contaminant-Specific Action Levels

The cleanup levels are the soil FRLs published in the OU5 and OU2 RODs. BTVs being considered in the remediation process are discussed for consideration during certification in Appendix C of the NRRP.

Methods of Sampling and Analysis

Physical soil samples will be collected in accordance with the applicable site sampling procedures. Per the SEP, laboratory analysis will be conducted at ASL D using QA/QC protocols specified in the SCQ. Full raw data deliverables will be required from the laboratory to allow for appropriate data validation. For FEMP-approved on- and off-site laboratories, the analytical method used will meet the required precision, accuracy and detection capabilities necessary to achieve FRL analyte ranges.

4.0 The Boundaries of the Situation

Spatial Boundaries

Domain of the Decision: The boundaries of this certification DQO extend to all surface, stockpile and fill soil in areas that are undergoing certification as part of FEMP remediation.

Population of Soil: Soil includes all excavated surfaces, undisturbed relatively unimpacted native soil, and sub-surface intervals (stockpile or fill areas only) in areas undergoing certification sampling and analysis.

Scale of Decision Making

Based on considerations of the final certification units and the COC evaluation process, the CU-specific COCs are determined. The area undergoing certification will be evaluated on a CU basis, based on physical sample results, as to whether it has passed or failed the criteria for attainment of certification (final SEP Section 3.4.4).

Temporal Boundaries

Time frame: Certification sampling must be performed in time to sequentially release certified areas for scheduled interim grading, restoration, and other final land use activities. Certification sampling data received from the laboratory will be validated and statistically evaluated. Certification results and findings will be documented in Certification Reports, which must be submitted to and approved by the regulatory agencies prior to release of the areas for scheduled interim grading, restoration, and other final land use activities.

Practical Considerations: Some areas undergoing remediation will not be accessible for certification sampling until decontamination/demolition and remedial excavation activities are complete. Other areas, such as wood lots, that are relatively uncontaminated and not planned for excavation, may require preparation, such as cutting of grass or removal of undergrowth prior to certification sampling, thus requiring coordination with FEMP Maintenance personnel.

5.0 Decision Rule

Successful certification of soil within the boundaries of a certification unit (CU) demonstrates that the certified soil (surface or subsurface) has concentrations of CU-specific COC(s) that meet the established criteria for attainment of Certification.

Parameters of Interest

The parameters of interest are the individual and average surface soil concentrations of CU-specific COCs and confidence limits on the calculated average within a CU. OU2 and OU5 ROD identify all applicable soil FRLs. The SEP identifies the ASCOCs, a subset of which will be used to establish CU-specific COCs within each Remediation Area undergoing certification sampling and analysis.

Action Levels

The applicable action levels are the on- and off-property soil FRLs published in the OU5 or OU2 ROD for each ASCOC.

Decision Rules

If the average concentration for each CU-specific COC is demonstrated to be below the FRLs within the agreed upon confidence level (95% for primary COCs; 90% for secondary COCs), and no analytical result exceeds two times the soil FRL, then the CU can be certified as complying with the cleanup criteria. If a CU does not meet the FRLs within the agreed upon confidence level for one or more CU-specific COCs, or one or more analytical results for one or more CU-specific COCs is greater than two times the associated soil FRL, then the CU fails certification and requires further assessment as per the SEP.

6.0 Limits on Decision Errors

Types of Decision Errors and Consequences

Definition

Decision Error 1: This decision error occurs when the decision maker decides that a CU has met the certification criteria, when in reality, the certification criteria have not been met. This situation could result in an increased risk to human health and the environment. In addition, this type of error could result in regulatory fees and penalties.

Decision Error 2: This decision error occurs when the decision maker decides a CU does not meet the certification criteria, when actually, the certification criteria have been met. This error would result in unnecessary added costs due to the excavation of soil containing COC concentrations below their FRLs, and an increased volume of soil assigned to the OSDF. In addition, unnecessary delays in the remediation schedule may result.

True State of Nature for the Decision Errors

The true state of nature for Decision Error 1 is that the certification criteria are not met (average CU-specific COC concentrations not below the FRL within the specified confidence limits; or a single sample result above two times the FRL). The true state of nature for Decision Error 2 is that certification criteria are met (average CU-specific COC concentrations are below the FRL within the specified confidence limits, and no result is above two times the FRL). Decision Error 1 is the more severe error due to the potential threat this poses to human health and the environment.

Null Hypothesis

H_0 : The average concentration of at least one CU-specific COC within a CU is equal to or greater than the associated FRL.

H_1 : The average concentration of all CU-specific COCs within a CU is less than the action levels.

False Positive and False Negative Errors

A false positive is Decision Error 1: less than or equal to five percent ($p = .05$) is considered the acceptable decision error in determination of compliance with FRLs for primary ASCOCs, while ten percent ($p = .10$) is acceptable for secondary ASCOCs.

A false negative is Decision Error 2: less than or equal to 20 percent is considered the acceptable decision error. This decision error is controlled through the determination of sample sizes (see Section G.1.4.1 of the final SEP).

7.0 Design for Obtaining Quality Data

Section 3.4.2 of the final SEP presents the specifics of the certification sampling design. The following text describes the general certification sampling design.

Soil Sample Locations

In order to select certification sampling locations, each CU is divided into 16 approximately equal sub-CUs. Certification sample locations are then generated by randomly selecting an easting and northing coordinate within the boundaries of each cell. Additional alternative sample locations are also generated in case the original random sample location fails the minimum distance criterion. The minimum distance criterion is defined as the minimum distance allowed between random sample locations in order to eliminate the chance of random sample points clustering within a small area. This clustering would tend to over emphasize a small area and, conversely, under represent a large area in certification determination. By not allowing sample locations to be too closely arranged, the sample locations are spread out and provide a more uniform coverage, thus reducing the possibility of large unsampled areas. The equation for determining minimum distance criterion is presented in Section 3.4.2.1 of the SEP.

In the event that the original random sample location failed the minimum distance criterion, the first alternate location was selected and all the locations were retested. This process continued until all 16 random locations passed the minimum distance criteria.

Each CU is also divided into four quadrants, each of which contains 4 sub-CUs and 4 sample locations. Three of the four locations per quadrant (12 per CU) are then selected for sample collection and analysis. The other one per quadrant (4 per CU) are designated as "archives", and samples will not be collected and analyzed unless need arises due to analytical or validation problems warrant. Per Section 3.4.2 of the SEP, as few as 8 samples may be collected from Group 2 CUs for analysis of secondary COCs.

Physical Samples

Physical soil certification samples will be collected from the surface according to SMPL-01 at locations identified in the PSP (generally 12 of the 16 locations per CU).

000032

000032

If stockpiled soil is to be certified, two CUs will be established, one for the stockpile and one for the underlying soil (i.e., the "footprint"). To certify the stockpile, samples will be collected from predetermined random intervals from within the stockpiled soil at each certification sampling location identified in the PSP. To certify the footprint, the first 6-inches of native soil present at each sampling location will also be collected for certification. If fill soil is to be certified, the strategy (surface or sampling at depth) will be based on results from the precertification scan of the fill area(s), as discussed in the Certification Design Letter and the certification PSP.

Laboratory Analysis

As defined in the PSP, a minimum of 8 to 12 samples per CU will be submitted to the on-site laboratory or a FDF approved off-site laboratory for analysis. All certification analyses will meet ASL D requirements per the SCQ except for the HAMDC. Samples will be analyzed for all CU-specific ASCOCs, with minimum detection levels set according to the SCQ and applicable project guidelines.

Validation

All field data will be validated. Also, a minimum of 10 percent of the analytical data from each laboratory will be subject to analytical validation to ASL D requirements in the SCQ, and will require an ASL D package. The remaining analytical data will be validated to a minimum of ASL B, and will require an ASL B package.

8.0 Use of Data to Test Null Hypothesis

Appendix G of the final SEP discusses in detail, the statistical evaluations of certification data used to determine attainment of certification criteria.

Data Quality Objectives
Sitewide Certification Sampling and Analysis

1A. Task Description:

1B. Project Phase: (Put an X in the appropriate selection.)

RI FS RD RA RvA Other (specify) _____

1C. DQO No.: SL-052, Rev. 2 DQO Reference No.: _____

2. Media Characterization: (Put an X in the appropriate selection.)

Air Biological Groundwater Sediment Soil
Waste Wastewater Surface Water Other (specify) _____

3. Data Use with Analytical Support Level (A-E): (Put an X in the appropriate Analytical Support Level selection(s) beside each applicable data use)

Site Characterization	Risk Assessment
A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/>	A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/>
Evaluation of Alternatives	Engineering Design
A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/>	A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/>
Monitoring During Remediation	Other
A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/>	A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input checked="" type="checkbox"/> E <input type="checkbox"/>

4A. Drivers: Remediation Area Remedial Action Work Plans, Applicable or Relevant and Appropriate Requirements (ARARs) and Operable Unit 2 and Operable Unit 5 Records of Decision (ROD), Sitewide Excavation Plan (SEP).

4B. Objective: Confirmation that remediation areas at the FEMP, or adjacent off-property areas, have met certification criteria on a CU by CU basis.

5. Site Information (Description):

The OU2 and OU5 RODs have identified areas at the FEMP that require soil remediation activities. The RODs specify that the soil in these areas will be demonstrated to be below the FRLs. Certification is necessary for all FEMP soil and some adjacent off-property soil to demonstrate that the residual soil does not contain COC contamination exceeding the FRL at a specified confidence level.

6A. Data Types with appropriate Analytical Support Level Equipment Selection and SCQ Reference: (Place an "X" to the right of the appropriate box or boxes selecting the type of analysis or analyses required. Then select the type of equipment to perform the analysis if appropriate. Please include a reference to the SCQ Section.)

- | | | | | | |
|----------------------|-------------------------------------|-------------------|-------------------------------------|--------------------|--------------------------|
| 1. pH | <input type="checkbox"/> | 2. Uranium | <input checked="" type="checkbox"/> | 3. BTX | <input type="checkbox"/> |
| Temperature | <input type="checkbox"/> | Full Radiological | <input checked="" type="checkbox"/> | TPH | <input type="checkbox"/> |
| Specific Conductance | <input type="checkbox"/> | Metals | <input checked="" type="checkbox"/> | Oil/Grease | <input type="checkbox"/> |
| Dissolved Oxygen | <input type="checkbox"/> | Cyanide | <input type="checkbox"/> | | |
| Technetium-99 | <input checked="" type="checkbox"/> | Silica | <input type="checkbox"/> | | |
| 4. Cations | <input type="checkbox"/> | 5. VOA | <input checked="" type="checkbox"/> | 6. Other (specify) | |
| Anions | <input type="checkbox"/> | BNA | <input type="checkbox"/> | | |
| TOC | <input type="checkbox"/> | PEST | <input checked="" type="checkbox"/> | | |
| TCLP | <input type="checkbox"/> | PCB | <input checked="" type="checkbox"/> | | |
| CEC | <input type="checkbox"/> | COD | <input type="checkbox"/> | | |

* As identified in the area certification PSP

6.B. Equipment Selection and SCQ Reference:

Equipment Selection	Refer to SCQ Section
ASL A _____	SCQ Section _____
ASL B _____	SCQ Section _____
ASL C _____	SCQ Section _____
ASL D <u>Per SCQ and PSP</u>	SCQ Section <u>Appendix G, Tbls. 1&3</u>
ASL E <u>Per PSP</u>	SCQ Section <u>Appendix H (final)</u>

7A. Sampling Methods: (Put an X in the appropriate selection.)

- Biased Composite Grab Environmental Grid
 Intrusive Non-Intrusive Phased Source Random

* Systematic random samples, selected one per cell and meeting the minimum distance criterion

7B. Sample Work Plan Reference: Project Specific Plan for the associated Remediation area Remedial Action Work Plan

Background samples: OU5 RI

7C. Sample Collection Reference: Associated PSP(s), SMPL-01

8. Quality Control Samples: (Put an X in the appropriate selection.)

8A. Field Quality Control Samples:

Trip Blanks	<input checked="" type="checkbox"/> ¹	Container Blanks	<input checked="" type="checkbox"/>
Field Blanks	<input checked="" type="checkbox"/> ²	Duplicate Samples	<input checked="" type="checkbox"/>
Equipment Rinsate Blanks	<input checked="" type="checkbox"/>	Split Samples	<input checked="" type="checkbox"/> ³
Preservative Blanks	<input type="checkbox"/>	Performance Evaluation Samples	<input type="checkbox"/>

Other (specify) _____

1) Collected for volatile organic sampling

2) As noted in the PSP

3) Split samples will be taken where required by the EPA

8B. Laboratory Quality Control Samples:

Method Blank	<input checked="" type="checkbox"/>	Matrix Duplicate/Replicate	<input checked="" type="checkbox"/>
Matrix Spike	<input checked="" type="checkbox"/>	Surrogate Spikes	<input checked="" type="checkbox"/>
Tracer Spike	<input checked="" type="checkbox"/>	Other (specify) _____	

9. Other: Please identify any other germane information that may impact the data quality or gathering of this particular objective, task, or data use.

Sample density will be dependent upon the CU size (Group 1 [250'x250'] or Group 2 [500'x500']), as determined by historical and pre-certification scan data.

APPENDIX B

**A2PI IFP/SF/EWWF CU SAMPLES/
COORDINATES/IDENTIFICATION**

APPENDIX B
A2P1 IFP/SF/EWWF CU SAMPLES/COORDINATES/IDENTIFICATION

CERTIFICATION UNIT	SAMPLE ID	TAL	NORTHING	EASTING
A2P1-IFP-1	A2P1-IFP-C-1-1-X-V	A/B/D/E/F/G	478241.03	1347518.42
A2P1-IFP-1	A2P1-IFP-C-1-2-X	A/B/D/E/F/G	478211.27	1347508.13
A2P1-IFP-1	A2P1-IFP-C-1-3-X	A/B/D/E/F/G	478194.39	1347586.40
A2P1-IFP-1	A2P1-IFP-C-1-4-X	A/B/D/E/F/G	478202.84	1347612.42
A2P1-IFP-1	A2P1-IFP-C-1-5-X	A/B/D/E/F/G	478099.52	1347417.94
A2P1-IFP-1	A2P1-IFP-C-1-6-X	A/B/D/E/F/G	478141.38	1347467.70
A2P1-IFP-1	A2P1-IFP-C-1-7-X	A/B/D/E/F/G	478162.13	1347568.28
A2P1-IFP-1	A2P1-IFP-C-1-8-X-V	A/B/D/E/F/G	478148.32	1347633.06
A2P1-IFP-1	A2P1-IFP-C-1-9-X	A/B/D/E/F/G	478140.65	1347717.19
A2P1-IFP-1	A2P1-IFP-C-1-10-X	A/B/D/E/F/G	478142.78	1347791.44
A2P1-IFP-1	A2P1-IFP-C-1-11-X	A/B/D/E/F/G	478098.21	1347638.48
A2P1-IFP-1	A2P1-IFP-C-1-12-X-V	A/B/D/E/F/G	478107.06	1347732.09
A2P1-IFP-1	A2P1-IFP-C-1-13-X-V	A/B/D/E/F/G	478099.39	1347798.00
A2P1-IFP-1	A2P1-IFP-C-1-14-X	A/B/D/E/F/G	478066.54	1347705.28
A2P1-IFP-1	A2P1-IFP-C-1-15-X	A/B/D/E/F/G	478061.56	1347778.87
A2P1-IFP-1	A2P1-IFP-C-1-16-X	A/B/D/E/F/G	478015.10	1347766.78
A2P1-IFP-1	A2P1-IFP-C-1-16-X-D	A/B/D/E/F/G	478015.10	1347766.78
A2P1-IFP-2	A2P1-IFP-C-2-1-X	A/B/D/E/G	478126.99	1347532.12
A2P1-IFP-2	A2P1-IFP-C-2-2-X	A/B/D/E/G	478042.31	1347444.15
A2P1-IFP-2	A2P1-IFP-C-2-3-X-V	A/B/D/E/G	478106.63	1347472.46
A2P1-IFP-2	A2P1-IFP-C-2-4-X	A/B/D/E/G	478059.99	1347525.43
A2P1-IFP-2	A2P1-IFP-C-2-4-X-D	A/B/D/E/G	478059.99	1347525.43
A2P1-IFP-2	A2P1-IFP-C-2-5-X	A/B/D/E/G	478056.35	1347586.57
A2P1-IFP-2	A2P1-IFP-C-2-6-X	A/B/D/E/G	477985.48	1347430.89
A2P1-IFP-2	A2P1-IFP-C-2-7-X	A/B/D/E/G	477994.13	1347484.89
A2P1-IFP-2	A2P1-IFP-C-2-8-X-V	A/B/D/E/G	478003.74	1347553.24
A2P1-IFP-2	A2P1-IFP-C-2-9-X	A/B/D/E/G	478020.45	1347620.29
A2P1-IFP-2	A2P1-IFP-C-2-10-X-V	A/B/D/E/G	478053.48	1347671.01
A2P1-IFP-2	A2P1-IFP-C-2-11-X	A/B/D/E/G	477952.28	1347513.64
A2P1-IFP-2	A2P1-IFP-C-2-12-X	A/B/D/E/G	477969.38	1347582.72
A2P1-IFP-2	A2P1-IFP-C-2-13-X-V	A/B/D/E/G	477982.44	1347628.17
A2P1-IFP-2	A2P1-IFP-C-2-14-X	A/B/D/E/G	477999.73	1347689.86
A2P1-IFP-2	A2P1-IFP-C-2-15-X	A/B/D/E/G	477947.50	1347654.71
A2P1-IFP-2	A2P1-IFP-C-2-16-X	A/B/D/E/G	477914.87	1347678.54
A2P1-IFP-3	A2P1-IFP-C-3-1-X	A/B/D/E/G	477943.05	1347449.25
A2P1-IFP-3	A2P1-IFP-C-3-2-X-V	A/B/D/E/G	477906.78	1347524.96
A2P1-IFP-3	A2P1-IFP-C-3-3-X	A/B/D/E/G	477896.21	1347453.57
A2P1-IFP-3	A2P1-IFP-C-3-4-X	A/B/D/E/G	477862.24	1347537.05
A2P1-IFP-3	A2P1-IFP-C-3-5-X	A/B/D/E/G	477869.55	1347606.60
A2P1-IFP-3	A2P1-IFP-C-3-6-X	A/B/D/E/G	477861.69	1347665.42
A2P1-IFP-3	A2P1-IFP-C-3-7-X	A/B/D/E/G	477839.58	1347464.86
A2P1-IFP-3	A2P1-IFP-C-3-8-X-V	A/B/D/E/G	477821.15	1347516.29
A2P1-IFP-3	A2P1-IFP-C-3-9-X	A/B/D/E/G	477823.47	1347600.10
A2P1-IFP-3	A2P1-IFP-C-3-10-X	A/B/D/E/G	477789.27	1347459.62
A2P1-IFP-3	A2P1-IFP-C-3-10-X-D	A/B/D/E/G	477789.27	1347459.62
A2P1-IFP-3	A2P1-IFP-C-3-11-X	A/B/D/E/G	477807.91	1347548.05
A2P1-IFP-3	A2P1-IFP-C-3-12-X-V	A/B/D/E/G	477781.42	1347588.42
A2P1-IFP-3	A2P1-IFP-C-3-13-X	A/B/D/E/G	477790.27	1347657.67
A2P1-IFP-3	A2P1-IFP-C-3-14-X	A/B/D/E/G	477749.74	1347557.96

APPENDIX B
A2P1 IFP/SF/EWWF CU SAMPLES/COORDINATES/IDENTIFICATION

CERTIFICATION UNIT	SAMPLE ID	TAL	NORTHING	EASTING
A2P1-IFP-3	A2P1-IFP-C-3-15-X-V	A/B/D/E/G	477726.13	1347563.56
A2P1-IFP-3	A2P1-IFP-C-3-16-X	A/B/D/E/G	477738.23	1347631.31
A2P1-IFP-4	A2P1-IFP-C-4-1-X	A/B/D/E/G	477940.61	1347762.46
A2P1-IFP-4	A2P1-IFP-C-4-2-X	A/B/D/E/G	477896.45	1347747.66
A2P1-IFP-4	A2P1-IFP-C-4-2-X-D	A/B/D/E/G	477896.45	1347747.66
A2P1-IFP-4	A2P1-IFP-C-4-3-X-V	A/B/D/E/G	477902.41	1347801.53
A2P1-IFP-4	A2P1-IFP-C-4-4-X	A/B/D/E/G	477851.90	1347706.75
A2P1-IFP-4	A2P1-IFP-C-4-5-X	A/B/D/E/G	477858.64	1347799.83
A2P1-IFP-4	A2P1-IFP-C-4-6-X	A/B/D/E/G	477813.72	1347830.43
A2P1-IFP-4	A2P1-IFP-C-4-7-X	A/B/D/E/G	477784.90	1347701.19
A2P1-IFP-4	A2P1-IFP-C-4-8-X-V	A/B/D/E/G	477772.24	1347771.00
A2P1-IFP-4	A2P1-IFP-C-4-9-X-V	A/B/D/E/G	477783.19	1347836.09
A2P1-IFP-4	A2P1-IFP-C-4-10-X	A/B/D/E/G	477702.34	1347648.38
A2P1-IFP-4	A2P1-IFP-C-4-11-X	A/B/D/E/G	477706.38	1347732.88
A2P1-IFP-4	A2P1-IFP-C-4-12-X	A/B/D/E/G	477704.85	1347767.82
A2P1-IFP-4	A2P1-IFP-C-4-13-X-V	A/B/D/E/G	477733.66	1347811.00
A2P1-IFP-4	A2P1-IFP-C-4-14-X	A/B/D/E/G	477735.97	1347865.50
A2P1-IFP-4	A2P1-IFP-C-4-15-X	A/B/D/E/G	477672.22	1347810.84
A2P1-IFP-4	A2P1-IFP-C-4-16-X	A/B/D/E/G	477649.57	1347844.70
A2P1-SF-1	A2P1-SF-C-1-1-X-V	A/B/D/E/F/G	478074.63	1347851.21
A2P1-SF-1	A2P1-SF-C-1-2-X	A/B/D/E/F/G	477991.11	1347823.54
A2P1-SF-1	A2P1-SF-C-1-3-X	A/B/D/E/F/G	478091.92	1347917.49
A2P1-SF-1	A2P1-SF-C-1-4-X	A/B/D/E/F/G	478038.16	1347889.24
A2P1-SF-1	A2P1-SF-C-1-5-X-V	A/B/D/E/F/G	478047.97	1348010.39
A2P1-SF-1	A2P1-SF-C-1-6-X	A/B/D/E/F/G	478032.62	1348068.02
A2P1-SF-1	A2P1-SF-C-1-6-X-D	A/B/D/E/F/G	478032.62	1348068.02
A2P1-SF-1	A2P1-SF-C-1-7-X	A/B/D/E/F/G	478021.11	1348134.25
A2P1-SF-1	A2P1-SF-C-1-8-X	A/B/D/E/F/G	477980.42	1348170.63
A2P1-SF-1	A2P1-SF-C-1-9-X	A/B/D/E/F/G	477975.25	1348243.45
A2P1-SF-1	A2P1-SF-C-1-10-X	A/B/D/E/F/G	477973.72	1348308.22
A2P1-SF-1	A2P1-SF-C-1-11-X	A/B/D/E/F/G	477946.25	1348195.39
A2P1-SF-1	A2P1-SF-C-1-12-X-V	A/B/D/E/F/G	477914.78	1348282.18
A2P1-SF-1	A2P1-SF-C-1-13-X	A/B/D/E/F/G	477925.73	1348319.98
A2P1-SF-1	A2P1-SF-C-1-14-X	A/B/D/E/F/G	477874.46	1348256.70
A2P1-SF-1	A2P1-SF-C-1-15-X	A/B/D/E/F/G	477849.89	1348335.63
A2P1-SF-1	A2P1-SF-C-1-16-X-D	A/B/D/E/F/G	477806.11	1348315.52
A2P1-SF-2	A2P1-SF-C-2-1-X	A/B/C/D/E/F/G	477993.81	1347913.47
A2P1-SF-2	A2P1-SF-C-2-2-X	A/B/C/D/E/F/G	478005.54	1348013.91
A2P1-SF-2	A2P1-SF-C-2-3-X	A/B/C/D/E/F/G	477948.49	1347845.01
A2P1-SF-2	A2P1-SF-C-2-4-X-V	A/B/C/D/E/F/G	477958.68	1347894.97
A2P1-SF-2	A2P1-SF-C-2-5-X-V	A/B/C/D/E/F/G	477965.60	1347969.44
A2P1-SF-2	A2P1-SF-C-2-6-X	A/B/C/D/E/F/G	477969.07	1348027.53
A2P1-SF-2	A2P1-SF-C-2-7-X	A/B/C/D/E/F/G	477968.11	1348069.66
A2P1-SF-2	A2P1-SF-C-2-8-X	A/B/C/D/E/F/G	477944.51	1348122.93
A2P1-SF-2	A2P1-SF-C-2-9-X	A/B/C/D/E/F/G	477905.30	1347852.52
A2P1-SF-2	A2P1-SF-C-2-10-X-V	A/B/C/D/E/F/G	477915.29	1347901.08
A2P1-SF-2	A2P1-SF-C-2-11-X	A/B/C/D/E/F/G	477917.22	1347950.21
A2P1-SF-2	A2P1-SF-C-2-12-X	A/B/C/D/E/F/G	477870.38	1347980.19
A2P1-SF-2	A2P1-SF-C-2-13-X	A/B/C/D/E/F/G	477880.94	1348019.53

400010

000039

APPENDIX B

3954

A2P1 IFP/SF/EWWF CU SAMPLES/COORDINATES/IDENTIFICATION

CERTIFICATION UNIT	SAMPLE ID	TAL	NORTHING	EASTING
A2P1-SF-2	A2P1-SF-C-2-14-X	A/B/C/D/E/F/G	477907.06	1348053.53
A2P1-SF-2	A2P1-SF-C-2-15-X	A/B/C/D/E/F/G	477913.79	1348116.88
A2P1-SF-2	A2P1-SF-C-2-15-X-D	A/B/C/D/E/F/G	477913.79	1348116.88
A2P1-SF-2	A2P1-SF-C-2-16-X-V	A/B/C/D/E/F/G	477903.82	1348182.73
A2P1-SF-3	A2P1-SF-C-3-1-X-V	A/B/C/D/E/F/G	477822.75	1347886.59
A2P1-SF-3	A2P1-SF-C-3-2-X	A/B/C/D/E/F/G	477820.65	1347949.87
A2P1-SF-3	A2P1-SF-C-3-3-X	A/B/C/D/E/F/G	477833.52	1348009.08
A2P1-SF-3	A2P1-SF-C-3-4-X	A/B/C/D/E/F/G	477771.30	1347913.46
A2P1-SF-3	A2P1-SF-C-3-5-X	A/B/C/D/E/F/G	477788.01	1347941.34
A2P1-SF-3	A2P1-SF-C-3-6-X	A/B/C/D/E/F/G	477771.32	1347997.51
A2P1-SF-3	A2P1-SF-C-3-7-X	A/B/C/D/E/F/G	477711.21	1347911.61
A2P1-SF-3	A2P1-SF-C-3-8-X-V	A/B/C/D/E/F/G	477714.67	1347943.97
A2P1-SF-3	A2P1-SF-C-3-9-X	A/B/C/D/E/F/G	477699.90	1348001.92
A2P1-SF-3	A2P1-SF-C-3-10-X	A/B/C/D/E/F/G	477676.27	1347934.09
A2P1-SF-3	A2P1-SF-C-3-10-X-D	A/B/C/D/E/F/G	477676.27	1347934.09
A2P1-SF-3	A2P1-SF-C-3-11-X-V	A/B/C/D/E/F/G	477669.37	1347985.04
A2P1-SF-3	A2P1-SF-C-3-12-X	A/B/C/D/E/F/G	477595.25	1347908.60
A2P1-SF-3	A2P1-SF-C-3-13-X	A/B/C/D/E/F/G	477610.23	1347956.34
A2P1-SF-3	A2P1-SF-C-3-14-X	A/B/C/D/E/F/G	477627.52	1347997.86
A2P1-SF-3	A2P1-SF-C-3-15-X	A/B/C/D/E/F/G	477549.94	1347880.65
A2P1-SF-3	A2P1-SF-C-3-16-X	A/B/C/D/E/F/G	477579.13	1347958.31
A2P1-SF-4	A2P1-SF-C-4-1-X	A/B/C/D/E/F/G	477801.28	1348065.14
A2P1-SF-4	A2P1-SF-C-4-2-X	A/B/C/D/E/F/G	477843.86	1348102.63
A2P1-SF-4	A2P1-SF-C-4-3-X	A/B/C/D/E/F/G	477835.65	1348137.61
A2P1-SF-4	A2P1-SF-C-4-4-X-V	A/B/C/D/E/F/G	477851.03	1348217.76
A2P1-SF-4	A2P1-SF-C-4-5-X	A/B/C/D/E/F/G	477753.28	1348038.61
A2P1-SF-4	A2P1-SF-C-4-6-X	A/B/C/D/E/F/G	477780.74	1348106.31
A2P1-SF-4	A2P1-SF-C-4-7-X	A/B/C/D/E/F/G	477797.45	1348146.30
A2P1-SF-4	A2P1-SF-C-4-8-X-V	A/B/C/D/E/F/G	477786.13	1348191.68
A2P1-SF-4	A2P1-SF-C-4-9-X	A/B/C/D/E/F/G	477788.06	1348269.81
A2P1-SF-4	A2P1-SF-C-4-10-X-V	A/B/C/D/E/F/G	477677.83	1348067.36
A2P1-SF-4	A2P1-SF-C-4-11-X	A/B/C/D/E/F/G	477710.28	1348116.14
A2P1-SF-4	A2P1-SF-C-4-12-X	A/B/C/D/E/F/G	477740.43	1348151.66
A2P1-SF-4	A2P1-SF-C-4-13-X	A/B/C/D/E/F/G	477736.99	1348228.73
A2P1-SF-4	A2P1-SF-C-4-14-X	A/B/C/D/E/F/G	477739.88	1348275.27
A2P1-SF-4	A2P1-SF-C-4-14-X-D	A/B/C/D/E/F/G	477739.88	1348275.27
A2P1-SF-4	A2P1-SF-C-4-15-X-V	A/B/C/D/E/F/G	477650.00	1348095.26
A2P1-SF-4	A2P1-SF-C-4-16-X	A/B/C/D/E/F/G	477706.84	1348216.81
A2P1-SF-5	A2P1-SF-C-5-1-X-V	A/B/C/D/E/F/G	477538.23	1347910.96
A2P1-SF-5	A2P1-SF-C-5-2-X	A/B/C/D/E/F/G	477541.70	1347977.22
A2P1-SF-5	A2P1-SF-C-5-3-X	A/B/C/D/E/F/G	477577.99	1348026.54
A2P1-SF-5	A2P1-SF-C-5-4-X	A/B/C/D/E/F/G	477482.17	1347928.08
A2P1-SF-5	A2P1-SF-C-5-5-X	A/B/C/D/E/F/G	477504.26	1347982.26
A2P1-SF-5	A2P1-SF-C-5-6-X	A/B/C/D/E/F/G	477510.99	1348034.31
A2P1-SF-5	A2P1-SF-C-5-7-X	A/B/C/D/E/F/G	477441.47	1347927.50
A2P1-SF-5	A2P1-SF-C-5-8-X-V	A/B/C/D/E/F/G	477452.80	1347965.05
A2P1-SF-5	A2P1-SF-C-5-9-X-V	A/B/C/D/E/F/G	477477.39	1348043.35
A2P1-SF-5	A2P1-SF-C-5-10-X	A/B/C/D/E/F/G	477440.34	1348074.68
A2P1-SF-5	A2P1-SF-C-5-11-X	A/B/C/D/E/F/G	477389.64	1347932.07

**APPENDIX B
A2P1 IFP/SF/EWWF CU SAMPLES/COORDINATES/IDENTIFICATION**

CERTIFICATION UNIT	SAMPLE ID	TAL	NORTHING	EASTING
A2P1-SF-5	A2P1-SF-C-5-12-X	A/B/C/D/E/F/G	477393.68	1348005.10
A2P1-SF-5	A2P1-SF-C-5-13-X-V	A/B/C/D/E/F/G	477384.66	1348044.90
A2P1-SF-5	A2P1-SF-C-5-14-X	A/B/C/D/E/F/G	477342.22	1347936.63
A2P1-SF-5	A2P1-SF-C-5-15-X	A/B/C/D/E/F/G	477343.38	1348019.09
A2P1-SF-5	A2P1-SF-C-5-16-X	A/B/C/D/E/F/G	477344.92	1348057.79
A2P1-SF-5	A2P1-SF-C-5-16-X-D	A/B/C/D/E/F/G	477344.92	1348057.79
A2P1-SF-6	A2P1-SF-C-6-1-X-V	A/B/C/D/E/F/G	477699.94	1348276.99
A2P1-SF-6	A2P1-SF-C-6-2-X	A/B/C/D/E/F/G	477672.67	1348198.52
A2P1-SF-6	A2P1-SF-C-6-3-X	A/B/C/D/E/F/G	477627.37	1348238.55
A2P1-SF-6	A2P1-SF-C-6-4-X	A/B/C/D/E/F/G	477611.02	1348074.42
A2P1-SF-6	A2P1-SF-C-6-5-X	A/B/C/D/E/F/G	477625.43	1348168.15
A2P1-SF-6	A2P1-SF-C-6-6-X-V	A/B/C/D/E/F/G	477593.38	1348192.45
A2P1-SF-6	A2P1-SF-C-6-7-X	A/B/C/D/E/F/G	477542.48	1348086.23
A2P1-SF-6	A2P1-SF-C-6-8-X	A/B/C/D/E/F/G	477561.50	1348134.37
A2P1-SF-6	A2P1-SF-C-6-9-X	A/B/C/D/E/F/G	477554.98	1348217.98
A2P1-SF-6	A2P1-SF-C-6-9-X-D	A/B/C/D/E/F/G	477554.98	1348217.98
A2P1-SF-6	A2P1-SF-C-6-10-X	A/B/C/D/E/F/G	477470.87	1348098.68
A2P1-SF-6	A2P1-SF-C-6-11-X-V	A/B/C/D/E/F/G	477505.63	1348129.97
A2P1-SF-6	A2P1-SF-C-6-12-X	A/B/C/D/E/F/G	477501.80	1348203.86
A2P1-SF-6	A2P1-SF-C-6-13-X	A/B/C/D/E/F/G	477443.81	1348134.75
A2P1-SF-6	A2P1-SF-C-6-14-X	A/B/C/D/E/F/G	477398.69	1348137.56
A2P1-SF-6	A2P1-SF-C-6-15-X-V	A/B/C/D/E/F/G	477350.11	1348102.54
A2P1-SF-6	A2P1-SF-C-6-16-X	A/B/C/D/E/F/G	477295.59	1348115.79
A2P1-SF-7	A2P1-SF-C-7-1-X	A/B/D/E/F/G	477359.22	1347875.26
A2P1-SF-7	A2P1-SF-C-7-2-X-V	A/B/D/E/F/G	477314.17	1347819.36
A2P1-SF-7	A2P1-SF-C-7-3-X	A/B/D/E/F/G	477301.32	1347857.71
A2P1-SF-7	A2P1-SF-C-7-4-X	A/B/D/E/F/G	477319.94	1347876.34
A2P1-SF-7	A2P1-SF-C-7-5-X	A/B/D/E/F/G	477310.66	1347939.55
A2P1-SF-7	A2P1-SF-C-7-6-X	A/B/D/E/F/G	477259.45	1347796.17
A2P1-SF-7	A2P1-SF-C-7-7-X-V	A/B/D/E/F/G	477274.81	1347832.91
A2P1-SF-7	A2P1-SF-C-7-8-X	A/B/D/E/F/G	477255.05	1347898.83
A2P1-SF-7	A2P1-SF-C-7-9-X	A/B/D/E/F/G	477287.11	1347925.16
A2P1-SF-7	A2P1-SF-C-7-10-X-V	A/B/D/E/F/G	477261.20	1347958.57
A2P1-SF-7	A2P1-SF-C-7-11-X	A/B/D/E/F/G	477304.21	1347997.50
A2P1-SF-7	A2P1-SF-C-7-12-X	A/B/D/E/F/G	477272.35	1348031.12
A2P1-SF-7	A2P1-SF-C-7-13-X	A/B/D/E/F/G	477249.90	1348086.65
A2P1-SF-7	A2P1-SF-C-7-13-X-D	A/B/D/E/F/G	477249.90	1348086.65
A2P1-SF-7	A2P1-SF-C-7-14-X	A/B/D/E/F/G	477255.47	1348123.19
A2P1-SF-7	A2P1-SF-C-7-15-X-V	A/B/D/E/F/G	477214.71	1347795.09
A2P1-SF-7	A2P1-SF-C-7-16-X	A/B/D/E/F/G	477239.68	1347852.76
A2P1-NWU-1	A2P1-NWU-C-1-1-X-V	A/B	477644.54	1347593.16
A2P1-NWU-1	A2P1-NWU-C-1-2-X	A/B	477608.07	1347642.44
A2P1-NWU-1	A2P1-NWU-C-1-3-X	A/B	477590.22	1347700.96
A2P1-NWU-1	A2P1-NWU-C-1-4-X	A/B	477644.18	1347731.23
A2P1-NWU-1	A2P1-NWU-C-1-5-X	A/B	477568.93	1347786.09
A2P1-NWU-1	A2P1-NWU-C-1-6-X	A/B	477578.34	1347845.02
A2P1-NWU-1	A2P1-NWU-C-1-7-X	A/B	477540.90	1347823.01
A2P1-NWU-1	A2P1-NWU-C-1-7-X-D	A/B	477540.90	1347823.01
A2P1-NWU-1	A2P1-NWU-C-1-8-X-V	A/B	477501.74	1347826.69

APPENDIX B
A2P1 IFP/SF/EWWF CU SAMPLES/COORDINATES/IDENTIFICATION

CERTIFICATION UNIT	SAMPLE ID	TAL	NORTHING	EASTING
A2P1-NWU-1	A2P1-NWU-C-1-9-X-V	A/B	477439.15	1347839.10
A2P1-NWU-1	A2P1-NWU-C-1-10-X	A/B	477406.71	1347875.40
A2P1-NWU-1	A2P1-NWU-C-1-11-X	A/B	477344.30	1347767.95
A2P1-NWU-1	A2P1-NWU-C-1-12-X	A/B	477303.21	1347749.92
A2P1-NWU-1	A2P1-NWU-C-1-13-X-V	A/B	477389.01	1347604.86
A2P1-NWU-1	A2P1-NWU-C-1-14-X	A/B	477320.86	1347644.01
A2P1-NWU-1	A2P1-NWU-C-1-15-X	A/B	477263.47	1347744.48
A2P1-NWU-1	A2P1-NWU-C-1-16-X	A/B	477198.20	1347749.51
A2P1-NWU-2	A2P1-NWU-C-2-1-X-V	A/B	477592.90	1347641.30
A2P1-NWU-2	A2P1-NWU-C-2-2-X	A/B	477548.55	1347619.27
A2P1-NWU-2	A2P1-NWU-C-2-3-X	A/B	477564.88	1347679.53
A2P1-NWU-2	A2P1-NWU-C-2-4-X	A/B	477524.76	1347727.30
A2P1-NWU-2	A2P1-NWU-C-2-5-X	A/B	477525.34	1347775.75
A2P1-NWU-2	A2P1-NWU-C-2-6-X	A/B	477482.50	1347606.04
A2P1-NWU-2	A2P1-NWU-C-2-7-X	A/B	477475.60	1347662.50
A2P1-NWU-2	A2P1-NWU-C-2-8-X-V	A/B	477485.02	1347705.84
A2P1-NWU-2	A2P1-NWU-C-2-9-X	A/B	477487.14	1347764.70
A2P1-NWU-2	A2P1-NWU-C-2-10-X	A/B	477446.03	1347613.71
A2P1-NWU-2	A2P1-NWU-C-2-10-X-D	A/B	477446.03	1347613.71
A2P1-NWU-2	A2P1-NWU-C-2-11-X-V	A/B	477405.52	1347648.64
A2P1-NWU-2	A2P1-NWU-C-2-12-X	A/B	477418.59	1347731.29
A2P1-NWU-2	A2P1-NWU-C-2-13-X-V	A/B	477420.33	1347781.48
A2P1-NWU-2	A2P1-NWU-C-2-14-X	A/B	477356.76	1347660.45
A2P1-NWU-2	A2P1-NWU-C-2-15-X	A/B	477379.62	1347717.12
A2P1-NWU-2	A2P1-NWU-C-2-16-X	A/B	477313.96	1347712.75
A2P1-NWU-3	A2P1-NWU-C-3-1-X	A/B	477750.88	1347452.03
A2P1-NWU-3	A2P1-NWU-C-3-2-X	A/B	477738.58	1347409.45
A2P1-NWU-3	A2P1-NWU-C-3-3-X	A/B	477717.97	1347434.82
A2P1-NWU-3	A2P1-NWU-C-3-4-X-V	A/B	477700.77	1347465.54
A2P1-NWU-3	A2P1-NWU-C-3-5-X-V	A/B	477723.24	1347494.33
A2P1-NWU-3	A2P1-NWU-C-3-6-X	A/B	477686.94	1347401.38
A2P1-NWU-3	A2P1-NWU-C-3-7-X	A/B	477681.37	1347430.70
A2P1-NWU-3	A2P1-NWU-C-3-8-X	A/B	477662.95	1347460.70
A2P1-NWU-3	A2P1-NWU-C-3-9-X	A/B	477659.12	1347524.22
A2P1-NWU-3	A2P1-NWU-C-3-10-X-V	A/B	477655.86	1347559.28
A2P1-NWU-3	A2P1-NWU-C-3-11-X	A/B	477622.23	1347385.43
A2P1-NWU-3	A2P1-NWU-C-3-12-X	A/B	477620.52	1347447.82
A2P1-NWU-3	A2P1-NWU-C-3-13-X	A/B	477640.68	1347475.38
A2P1-NWU-3	A2P1-NWU-C-3-14-X-V	A/B	477627.25	1347555.81
A2P1-NWU-3	A2P1-NWU-C-3-15-X	A/B	477603.98	1347498.82
A2P1-NWU-3	A2P1-NWU-C-3-15-X-D	A/B	477603.98	1347498.82
A2P1-NWU-3	A2P1-NWU-C-3-16-X	A/B	477596.53	1347530.33
A2P1-NWU-4	A2P1-NWU-C-4-1-X-V	A/B	477590.37	1347412.32
A2P1-NWU-4	A2P1-NWU-C-4-2-X	A/B	477584.81	1347465.64
A2P1-NWU-4	A2P1-NWU-C-4-3-X	A/B	477575.60	1347490.65
A2P1-NWU-4	A2P1-NWU-C-4-4-X	A/B	477540.09	1347548.33
A2P1-NWU-4	A2P1-NWU-C-4-5-X	A/B	477548.70	1347392.74
A2P1-NWU-4	A2P1-NWU-C-4-6-X	A/B	477516.46	1347440.06
A2P1-NWU-4	A2P1-NWU-C-4-6-X-D	A/B	477516.46	1347440.06

**APPENDIX B
A2P1 IFP/SF/EWWF CU SAMPLES/COORDINATES/IDENTIFICATION**

CERTIFICATION UNIT	SAMPLE ID	TAL	NORTHING	EASTING
A2P1-NWU-4	A2P1-NWU-C-4-7-X	A/B	477520.69	1347493.18
A2P1-NWU-4	A2P1-NWU-C-4-8-X-V	A/B	477512.06	1347549.24
A2P1-NWU-4	A2P1-NWU-C-4-9-X-V	A/B	477490.53	1347393.84
A2P1-NWU-4	A2P1-NWU-C-4-10-X	A/B	477480.36	1347434.86
A2P1-NWU-4	A2P1-NWU-C-4-11-X	A/B	477483.06	1347497.39
A2P1-NWU-4	A2P1-NWU-C-4-12-X	A/B	477486.72	1347560.12
A2P1-NWU-4	A2P1-NWU-C-4-13-X	A/B	477452.33	1347418.38
A2P1-NWU-4	A2P1-NWU-C-4-14-X-V	A/B	477430.84	1347461.90
A2P1-NWU-4	A2P1-NWU-C-4-15-X	A/B	477445.24	1347512.41
A2P1-NWU-4	A2P1-NWU-C-4-16-X	A/B	477445.06	1347561.53
A2P1-NWU-5	A2P1-NWU-C-5-1-X	A/B	478255.21	1347350.13
A2P1-NWU-5	A2P1-NWU-C-5-2-X	A/B	478230.64	1347398.76
A2P1-NWU-5	A2P1-NWU-C-5-3-X	A/B	478199.54	1347399.06
A2P1-NWU-5	A2P1-NWU-C-5-3-X-D	A/B	478199.54	1347399.06
A2P1-NWU-5	A2P1-NWU-C-5-4-X-V	A/B	478189.94	1347427.52
A2P1-NWU-5	A2P1-NWU-C-5-5-X	A/B	478165.16	1347337.40
A2P1-NWU-5	A2P1-NWU-C-5-6-X	A/B	478150.39	1347392.26
A2P1-NWU-5	A2P1-NWU-C-5-7-X	A/B	478120.82	1347364.38
A2P1-NWU-5	A2P1-NWU-C-5-8-X-V	A/B	478088.37	1347370.89
A2P1-NWU-5	A2P1-NWU-C-5-9-X	A/B	478057.27	1347342.00
A2P1-NWU-5	A2P1-NWU-C-5-10-X	A/B	478016.00	1347382.95
A2P1-NWU-5	A2P1-NWU-C-5-11-X-V	A/B	477993.53	1347355.57
A2P1-NWU-5	A2P1-NWU-C-5-12-X	A/B	477954.76	1347408.25
A2P1-NWU-5	A2P1-NWU-C-5-13-X	A/B	477902.15	1347403.04
A2P1-NWU-5	A2P1-NWU-C-5-14-X	A/B	477858.57	1347408.31
A2P1-NWU-5	A2P1-NWU-C-5-15-X	A/B	477816.14	1347385.77
A2P1-NWU-5	A2P1-NWU-C-5-16-X-V	A/B	477824.02	1347418.34
A2P1-NWU-6	A2P1-NWU-C-6-1-X	A/B	477744.34	1347384.53
A2P1-NWU-6	A2P1-NWU-C-6-2-X	A/B	477650.06	1347339.18
A2P1-NWU-6	A2P1-NWU-C-6-3-X	A/B	477547.93	1347338.38
A2P1-NWU-6	A2P1-NWU-C-6-4-X-V	A/B	477501.27	1347338.81
A2P1-NWU-6	A2P1-NWU-C-6-5-X-V	A/B	477422.18	1347374.88
A2P1-NWU-6	A2P1-NWU-C-6-6-X	A/B	477373.04	1347407.15
A2P1-NWU-6	A2P1-NWU-C-6-7-X	A/B	477352.69	1347443.76
A2P1-NWU-6	A2P1-NWU-C-6-8-X	A/B	477381.89	1347509.75
A2P1-NWU-6	A2P1-NWU-C-6-9-X	A/B	477387.62	1347337.82
A2P1-NWU-6	A2P1-NWU-C-6-10-X	A/B	477322.54	1347341.43
A2P1-NWU-6	A2P1-NWU-C-6-11-X-V	A/B	477305.84	1347418.83
A2P1-NWU-6	A2P1-NWU-C-6-12-X	A/B	477293.76	1347475.03
A2P1-NWU-6	A2P1-NWU-C-6-13-X	A/B	477343.11	1347549.32
A2P1-NWU-6	A2P1-NWU-C-6-14-X	A/B	477255.15	1347381.03
A2P1-NWU-6	A2P1-NWU-C-6-15-X-V	A/B	477259.20	1347437.68
A2P1-NWU-6	A2P1-NWU-C-6-16-X	A/B	477271.69	1347554.44
A2P1-NWU-6	A2P1-NWU-C-6-16-X-D	A/B	477271.69	1347554.44
A2P1-NWU-7	A2P1-NWU-C-7-1-X	A/B	477331.22	1347601.48
A2P1-NWU-7	A2P1-NWU-C-7-1-X-D	A/B	477331.22	1347601.48
A2P1-NWU-7	A2P1-NWU-C-7-2-X-V	A/B	477247.32	1347607.31
A2P1-NWU-7	A2P1-NWU-C-7-3-X	A/B	477254.43	1347649.48
A2P1-NWU-7	A2P1-NWU-C-7-4-X	A/B	477214.69	1347654.64

APPENDIX B

A2PI IFP/SF/EWWF CU SAMPLES/COORDINATES/IDENTIFICATION

3954

CERTIFICATION UNIT	SAMPLE ID	TAL	NORTHING	EASTING
A2P1-NWU-7	A2P1-NWU-C-7-5-X	A/B	477139.83	1347723.52
A2P1-NWU-7	A2P1-NWU-C-7-6-X	A/B	477142.33	1347774.54
A2P1-NWU-7	A2P1-NWU-C-7-7-X	A/B	477118.73	1347836.39
A2P1-NWU-7	A2P1-NWU-C-7-8-X-V	A/B	477116.06	1347959.96
A2P1-NWU-7	A2P1-NWU-C-7-9-X	A/B	477134.12	1348048.91
A2P1-NWU-7	A2P1-NWU-C-7-10-X-V	A/B	477124.91	1348087.15
A2P1-NWU-7	A2P1-NWU-C-7-11-X	A/B	477063.62	1347824.01
A2P1-NWU-7	A2P1-NWU-C-7-12-X	A/B	477043.86	1347873.76
A2P1-NWU-7	A2P1-NWU-C-7-13-X-V	A/B	477058.46	1347930.47
A2P1-NWU-7	A2P1-NWU-C-7-14-X	A/B	477057.70	1347997.83
A2P1-NWU-7	A2P1-NWU-C-7-15-X	A/B	477098.79	1348033.62
A2P1-NWU-7	A2P1-NWU-C-7-16-X	A/B	477021.22	1347953.39
A2P1-NWU-8	A2P1-NWU-C-8-1-X	A/B	477096.90	1348174.11
A2P1-NWU-8	A2P1-NWU-C-8-2-X	A/B	477092.67	1348136.20
A2P1-NWU-8	A2P1-NWU-C-8-3-X	A/B	477024.69	1348057.96
A2P1-NWU-8	A2P1-NWU-C-8-4-X-V	A/B	477035.45	1348104.40
A2P1-NWU-8	A2P1-NWU-C-8-5-X	A/B	477063.69	1348191.96
A2P1-NWU-8	A2P1-NWU-C-8-6-X	A/B	477053.52	1348247.28
A2P1-NWU-8	A2P1-NWU-C-8-7-X	A/B	476986.47	1347961.58
A2P1-NWU-8	A2P1-NWU-C-8-8-X-V	A/B	477006.44	1348005.96
A2P1-NWU-8	A2P1-NWU-C-8-9-X	A/B	476981.30	1348060.78
A2P1-NWU-8	A2P1-NWU-C-8-9-X-D	A/B	476981.30	1348060.78
A2P1-NWU-8	A2P1-NWU-C-8-10-X	A/B	476995.90	1348133.90
A2P1-NWU-8	A2P1-NWU-C-8-11-X	A/B	477000.65	1348180.72
A2P1-NWU-8	A2P1-NWU-C-8-12-X-V	A/B	477019.15	1348208.99
A2P1-NWU-8	A2P1-NWU-C-8-13-X-V	A/B	476928.11	1348019.48
A2P1-NWU-8	A2P1-NWU-C-8-14-X	A/B	476938.11	1348090.14
A2P1-NWU-8	A2P1-NWU-C-8-15-X	A/B	476952.32	1348125.09
A2P1-NWU-8	A2P1-NWU-C-8-16-X	A/B	476909.50	1348046.21
A2P1-NWU-9	A2P1-NWU-C-9-1-X	A/B	476982.48	1348226.37
A2P1-NWU-9	A2P1-NWU-C-9-2-X-V	A/B	477001.88	1348284.58
A2P1-NWU-9	A2P1-NWU-C-9-3-X	A/B	476947.14	1348161.48
A2P1-NWU-9	A2P1-NWU-C-9-4-X	A/B	476939.66	1348206.33
A2P1-NWU-9	A2P1-NWU-C-9-5-X-V	A/B	476935.07	1348280.29
A2P1-NWU-9	A2P1-NWU-C-9-6-X	A/B	476953.32	1348328.04
A2P1-NWU-9	A2P1-NWU-C-9-7-X	A/B	476896.83	1348104.62
A2P1-NWU-9	A2P1-NWU-C-9-8-X	A/B	476906.25	1348160.46
A2P1-NWU-9	A2P1-NWU-C-9-9-X	A/B	476905.30	1348197.30
A2P1-NWU-9	A2P1-NWU-C-9-10-X-V	A/B	476895.32	1348244.29
A2P1-NWU-9	A2P1-NWU-C-9-11-X	A/B	476808.71	1348106.96
A2P1-NWU-9	A2P1-NWU-C-9-11-X-D	A/B	476808.71	1348106.96
A2P1-NWU-9	A2P1-NWU-C-9-12-X	A/B	476854.80	1348156.60
A2P1-NWU-9	A2P1-NWU-C-9-13-X	A/B	476832.73	1348192.84
A2P1-NWU-9	A2P1-NWU-C-9-14-X-V	A/B	476837.17	1348251.75
A2P1-NWU-9	A2P1-NWU-C-9-15-X	A/B	476788.18	1348149.74
A2P1-NWU-9	A2P1-NWU-C-9-16-X	A/B	476774.36	1348199.12
A2P1-NWU-10	A2P1-NWU-C-10-1-X-V	A/B	478572.18	1347377.36
A2P1-NWU-10	A2P1-NWU-C-10-2-X	A/B	478519.38	1347365.63
A2P1-NWU-10	A2P1-NWU-C-10-3-X	A/B	478479.45	1347392.76

**APPENDIX B
A2P1 IFP/SF/EWWF CU SAMPLES/COORDINATES/IDENTIFICATION**

CERTIFICATION UNIT	SAMPLE ID	TAL	NORTHING	EASTING
A2P1-NWU-10	A2P1-NWU-C-10-4-X	A/B	478455.28	1347499.50
A2P1-NWU-10	A2P1-NWU-C-10-5-X	A/B	478456.60	1347355.79
A2P1-NWU-10	A2P1-NWU-C-10-6-X	A/B	478422.63	1347441.68
A2P1-NWU-10	A2P1-NWU-C-10-6-X-D	A/B	478422.63	1347441.68
A2P1-NWU-10	A2P1-NWU-C-10-7-X-V	A/B	478420.72	1347491.41
A2P1-NWU-10	A2P1-NWU-C-10-8-X	A/B	478355.43	1347377.83
A2P1-NWU-10	A2P1-NWU-C-10-9-X	A/B	478363.31	1347425.59
A2P1-NWU-10	A2P1-NWU-C-10-10-X-V	A/B	478374.26	1347486.27
A2P1-NWU-10	A2P1-NWU-C-10-11-X	A/B	478312.23	1347351.18
A2P1-NWU-10	A2P1-NWU-C-10-12-X	A/B	478292.27	1347428.56
A2P1-NWU-10	A2P1-NWU-C-10-13-X-V	A/B	478332.41	1347477.45
A2P1-NWU-10	A2P1-NWU-C-10-14-X	A/B	478253.68	1347413.40
A2P1-NWU-10	A2P1-NWU-C-10-15-X	A/B	478268.28	1347465.42
A2P1-NWU-10	A2P1-NWU-C-10-16-X	A/B	478354.50	1347541.89
A2P1-NWU-11	A2P1-NWU-C-11-1-X	A/B	478280.01	1347566.07
A2P1-NWU-11	A2P1-NWU-C-11-2-X	A/B	478273.10	1347595.50
A2P1-NWU-11	A2P1-NWU-C-11-3-X-V	A/B	478248.73	1347647.42
A2P1-NWU-11	A2P1-NWU-C-11-4-X	A/B	478215.33	1347688.18
A2P1-NWU-11	A2P1-NWU-C-11-5-X	A/B	478205.93	1347737.01
A2P1-NWU-11	A2P1-NWU-C-11-6-X	A/B	478172.92	1347801.45
A2P1-NWU-11	A2P1-NWU-C-11-7-X	A/B	478149.31	1347839.75
A2P1-NWU-11	A2P1-NWU-C-11-8-X-V	A/B	478161.99	1347871.69
A2P1-NWU-11	A2P1-NWU-C-11-9-X	A/B	478148.94	1347912.68
A2P1-NWU-11	A2P1-NWU-C-11-10-X-V	A/B	478101.72	1347987.53
A2P1-NWU-11	A2P1-NWU-C-11-11-X	A/B	478093.09	1348048.48
A2P1-NWU-11	A2P1-NWU-C-11-12-X	A/B	478085.03	1348074.23
A2P1-NWU-11	A2P1-NWU-C-11-13-X	A/B	478048.19	1348151.62
A2P1-NWU-11	A2P1-NWU-C-11-13-X-D	A/B	478048.19	1348151.62
A2P1-NWU-11	A2P1-NWU-C-11-14-X-V	A/B	478020.35	1348245.51
A2P1-NWU-11	A2P1-NWU-C-11-15-X	A/B	477990.04	1348330.68
A2P1-NWU-11	A2P1-NWU-C-11-16-X	A/B	477973.54	1348384.05
A2P1-NWU-12	A2P1-NWU-C-12-1-X-V	A/B/H	477949.36	1348423.10
A2P1-NWU-12	A2P1-NWU-C-12-2-X-V	A/B/H	477909.79	1348405.54
A2P1-NWU-12	A2P1-NWU-C-12-3-X	A/B/H	477872.18	1348397.64
A2P1-NWU-12	A2P1-NWU-C-12-4-X	A/B/H	477769.46	1348355.53
A2P1-NWU-12	A2P1-NWU-C-12-5-X	A/B/H	477721.07	1348337.51
A2P1-NWU-12	A2P1-NWU-C-12-6-X	A/B/H	477633.71	1348289.29
A2P1-NWU-12	A2P1-NWU-C-12-7-X	A/B/H	477590.32	1348285.30
A2P1-NWU-12	A2P1-NWU-C-12-8-X-V	A/B/H	477542.71	1348274.43
A2P1-NWU-12	A2P1-NWU-C-12-9-X	A/B/H	477455.54	1348231.05
A2P1-NWU-12	A2P1-NWU-C-12-10-X-V	A/B/H	477416.37	1348218.68
A2P1-NWU-12	A2P1-NWU-C-12-11-X	A/B/H	477353.59	1348189.39
A2P1-NWU-12	A2P1-NWU-C-12-12-X	A/B/H	477293.69	1348189.24
A2P1-NWU-12	A2P1-NWU-C-12-13-X	A/B/H	477247.03	1348175.73
A2P1-NWU-12	A2P1-NWU-C-12-14-X	A/B/H	477198.65	1348194.91
A2P1-NWU-12	A2P1-NWU-C-12-14-X-D	A/B/H	477198.65	1348194.91
A2P1-NWU-12	A2P1-NWU-C-12-15-X	A/B/H	477172.54	1348206.36
A2P1-NWU-12	A2P1-NWU-C-12-16-X	A/B/H	477153.34	1348180.69

APPENDIX B
A2P1 IFP/SF/EWWF CU SAMPLES/COORDINATES/IDENTIFICATION

CERTIFICATION UNIT	SAMPLE ID	TAL	NORTHING	EASTING
A2P1-NWU-13	A2P1-NWU-C-13-1-X	A/B	477183.42	1347825.55
A2P1-NWU-13	A2P1-NWU-C-13-2-X-V	A/B	477208.76	1347854.81
A2P1-NWU-13	A2P1-NWU-C-13-3-X	A/B	477213.00	1347894.90
A2P1-NWU-13	A2P1-NWU-C-13-4-X	A/B	477234.52	1347963.18
A2P1-NWU-13	A2P1-NWU-C-13-5-X-V	A/B	477229.92	1348022.87
A2P1-NWU-13	A2P1-NWU-C-13-6-X	A/B	477221.09	1348064.83
A2P1-NWU-13	A2P1-NWU-C-13-7-X	A/B	477205.94	1348147.37
A2P1-NWU-13	A2P1-NWU-C-13-8-X	A/B	477176.71	1347862.49
A2P1-NWU-13	A2P1-NWU-C-13-9-X-V	A/B	477202.26	1347924.76
A2P1-NWU-13	A2P1-NWU-C-13-10-X	A/B	477198.62	1347974.76
A2P1-NWU-13	A2P1-NWU-C-13-11-X	A/B	477196.71	1348034.93
A2P1-NWU-13	A2P1-NWU-C-13-12-X	A/B	477197.87	1348115.13
A2P1-NWU-13	A2P1-NWU-C-13-12-X-D	A/B	477197.87	1348115.13
A2P1-NWU-13	A2P1-NWU-C-13-13-X	A/B	477151.76	1347919.69
A2P1-NWU-13	A2P1-NWU-C-13-14-X-V	A/B	477160.99	1348012.10
A2P1-NWU-13	A2P1-NWU-C-13-15-X	A/B	477159.08	1348075.30
A2P1-NWU-13	A2P1-NWU-C-13-16-X	A/B	477163.51	1348137.80