

Nevada
Environmental
Restoration
Project

DOE/NV--694-rev 1



Closure Report
for Corrective Action Unit 407:
Roller Coaster RADSAFE Area,
Tonopah Test Range, Nevada

UNCONTROLLED

Controlled Copy No.: _____

Revision: 1

December 2001

Environmental Restoration
Division

U.S. Department of Energy
Nevada Operations Office

DISCLAIMER STATEMENT

Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the U.S. Government or any agency thereof or its contractors or subcontractors.

AVAILABILITY STATEMENT

Available for sale to the public from—

U.S. Department of Commerce
National Technical Information Service
5285 Port Royal Road
Springfield, VA 22161
Phone: 800.553.6847
Fax: 703.605.6900
Email: orders@ntis.fedworld.gov
Online ordering: <http://www.ntis.gov/ordering.htm>

Available electronically at <http://www.doe.gov/bridge>

Available for a processing fee to U.S. Department of Energy and its contractors, in paper, from—

U.S. Department of Energy
Office of Scientific and Technical Information
P.O. Box 62
Oak Ridge, TN 37831-0062
Phone: 865.576.8401
Fax: 865.576.5728
Email: reports@adonis.osti.gov

**CLOSURE REPORT FOR
CORRECTIVE ACTION UNIT 407:
ROLLER COASTER RADSAFE AREA,
TONOPAH TEST RANGE, NEVADA**

**Prepared for
U. S. Department of Energy
Nevada Operations Office
Work Performed Under Contract No.
DE-AC08-96NV11718**

Controlled Copy No.: _____

Revision: 1

December 2001

UNCONTROLLED

THIS PAGE LEFT INTENTIONALLY BLANK

**CLOSURE REPORT FOR
CORRECTIVE ACTION UNIT 407:
ROLLER COASTER RADSAFE AREA,
TONOPAH TEST RANGE, NEVADA**

Approved by: Janet L. Appenzeller-Wing
Janet L. Appenzeller-Wing, Project Manager
Industrial Sites Project

Date: 12/12/01

Approved by: Runore C. Wycoff
Runore C. Wycoff, Division Director
Environmental Restoration Project

Date: 12/12/01

THIS PAGE INTENTIONALLY LEFT BLANK

TABLE OF CONTENTS

ACRONYMS AND ABBREVIATIONS	vii
EXECUTIVE SUMMARY	ix
1.0 INTRODUCTION	1
1.1 Purpose	1
1.2 Scope	1
1.3 Contents	4
2.0 CLOSURE ACTIVITIES	7
2.1 Description of Prior Corrective Action Activities	7
2.2 Description of Corrective Action Activities	7
2.2.1 Soil Removal Criteria	7
2.2.2 Removal of Surface Impacted Soils	8
2.2.3 Construction of Soil Cover	10
2.2.4 Fence Construction	10
2.2.5 Revegetation	10
2.3 Deviations from Closure Plan as Approved	10
2.4 Corrective Action Schedule as Completed	11
2.5 Site Plan	11
3.0 WASTE DISPOSITION	13
4.0 CLOSURE VERIFICATION RESULTS	15
4.1 Remaining Transuranic Waste at CAU 407	15
4.2 Land-Use Restrictions	16
5.0 CONCLUSIONS AND RECOMMENDATIONS	17
5.1 Conclusions	17
5.2 Inspections	17
5.3 Recommendations	18
6.0 REFERENCES	19
APPENDIX A - HISTORIC PHOTOS	
APPENDIX B - CAU 407 AS-BUILT DRAWINGS	
APPENDIX C - PROJECT PHOTOGRAPHS	
APPENDIX D - CERTIFICATE OF DISPOSAL	
APPENDIX E - STATISTICAL ANALYSIS OF CAU 407 CHARACTERIZATION SAMPLES	

TABLE OF CONTENTS (continued)

APPENDIX F - USE RESTRICTION FORM

APPENDIX G - CAU 407 INSPECTION CHECKLIST

APPENDIX H - COMMENT RESPONSE DOCUMENTATION

DISTRIBUTION LIST

FIGURES

Figure 1 - CAU 407 Site Location Map	2
Figure 2 - CAU 407 Site Vicinity Map	3
Figure 3 - Locations of Hot Spots Removed from CAU 407	9
Figure 4 - CAU 407 Schedule as Completed	12

TABLES

Table 1 - Sample Results for the High Activity Concrete	14
Table 2 - FIDLER Readings Before and After Hot Spot Removal	15

ACRONYMS AND ABBREVIATIONS

BN	Bechtel Nevada
CADD	Corrective Action Decision Document
CAP	Corrective Action Plan
CAU	Corrective Action Unit
cpm	counts per minute
CR	Closure Report
DOE/NV	U.S. Department of Energy, Nevada Operations Office
FFACO	Federal Facility Agreement and Consent Order
FIDLER	Field Instrument for the Detection of Low Energy Radiation
ft	feet
gal	gallon
km	kilometers
LLW	low-level waste
m	meter
mi	miles
NDEP	Nevada Division of Environmental Protection
NTS	Nevada Test Site
RCRSA	Roller Coaster RADSAFE Area
RWMS	Radioactive Waste Management Site
TRU	Transuranic
TTR	Tonopah Test Range

THIS PAGE INTENTIONALLY LEFT BLANK

EXECUTIVE SUMMARY

This closure report provides documentation for the closure of the Roller Coaster RADSAFE Area (RCRSA) Corrective Action Unit (CAU) 407. CAU 407 is located at the Tonopah Test Range (TTR), Nevada, approximately 225 kilometers (140 miles) northwest of Las Vegas, Nevada. The RCRSA was used during May and June of 1963 to decontaminate vehicles, equipment, and personnel from the Double Tracks and Clean Slate tests. The following is the scope of the closure actions implemented for CAU 407:

- Removal and disposal of surface soils which were over three times background for the area. Soils identified for removal were disposed of at the Area 5 Radioactive Waste Management Site at the Nevada Test Site (NTS). Excavated areas were backfilled with clean borrow soil located near the site.
- A soil cover was constructed over the waste disposal pit area, where subsurface Constituents of Concern remain.
- The site was fenced and posted as an "Underground Radioactive Material" area.
- During the hot spot removals, 4 pieces of concrete were uncovered. One piece had high levels of surface activity. This waste was shipped to the NTS for storage on the TRU pad in Area 5 until it can be disposed of at the Waste Isolation Pilot Project in Carlsbad, New Mexico.
- The cover was prepped and then seeded with plant species native to Area 3 of the TTR.

Based upon the completion of site activities, it is requested that a notice of completion be provided by the Nevada Division of Environmental Protection for CAU 407.

THIS PAGE INTENTIONALLY LEFT BLANK

1.0 INTRODUCTION

This closure report (CR) provides documentation for the closure of the Roller Coaster RADSAFE Area (RCRSA) Corrective Action Unit (CAU) 407 identified in the Federal Facility Agreement and Consent Order (FFACO) (Nevada Division of Environmental Protection [NDEP] et al., 1996).

CAU 407 is located at the Tonopah Test Range (TTR), Nevada. The TTR is approximately 225 kilometers (km) (140 miles [mi]) northwest of Las Vegas, Nevada (Figure 1). The RCRSA is located on the northeast corner of the intersection of Main Road and Browne's Lake Road, which is approximately 8 km (5 mi) south of Area 3 (Figure 1). The RCRSA was used during May and June of 1963 to decontaminate vehicles, equipment, and personnel from the Double Tracks and Clean Slate tests. Investigation of the RCRSA was conducted from June through November of 1998. A Corrective Action Decision Document (CADD) (U.S. Department of Energy, Nevada Operations Office [DOE/NV], 1999) was approved in October of 1999.

1.1 PURPOSE

The purpose of this CR is to:

- Document the closure activities as proposed in the Corrective Action Plan (CAP) (DOE/NV, 2000).
- Obtain a Notice of Completion from the NDEP.
- Recommend the movement of CAU 407 from Appendix III to Appendix IV of the FFACO.

1.2 SCOPE

The following is the scope of the closure actions implemented for CAU 407:

- Removal and disposal of surface soils which were over three times background for the area. Soils identified for removal were disposed of at the Area 5 Radioactive Waste Management Site (RWMS) at the Nevada Test Site (NTS). Excavated areas were backfilled with clean borrow soil located near the site.
- A soil cover was constructed over the waste disposal pit area, where subsurface constituents of concern remain (Figure 2).
- The site was fenced and posted as an "Underground Radioactive Material" area.

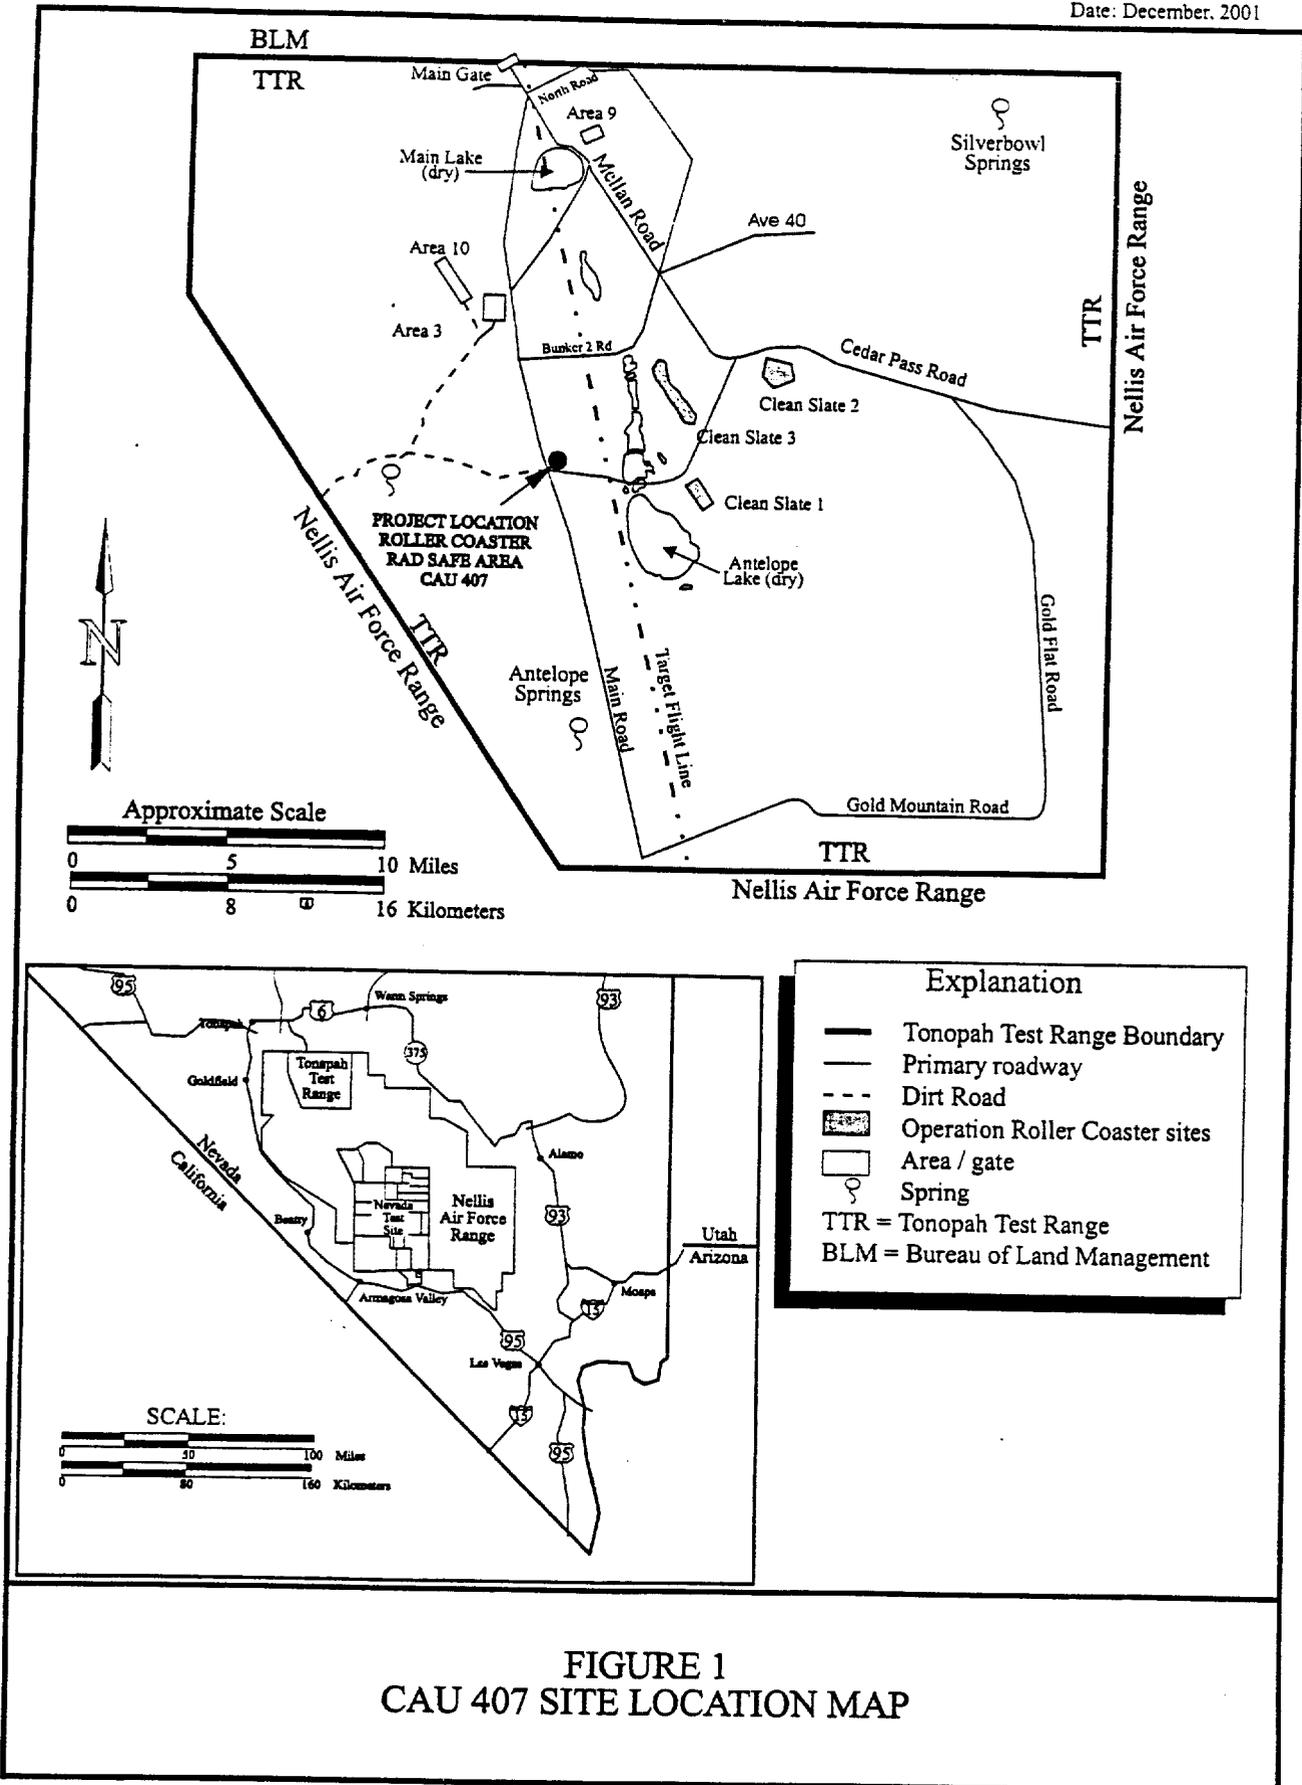


FIGURE 1
CAU 407 SITE LOCATION MAP

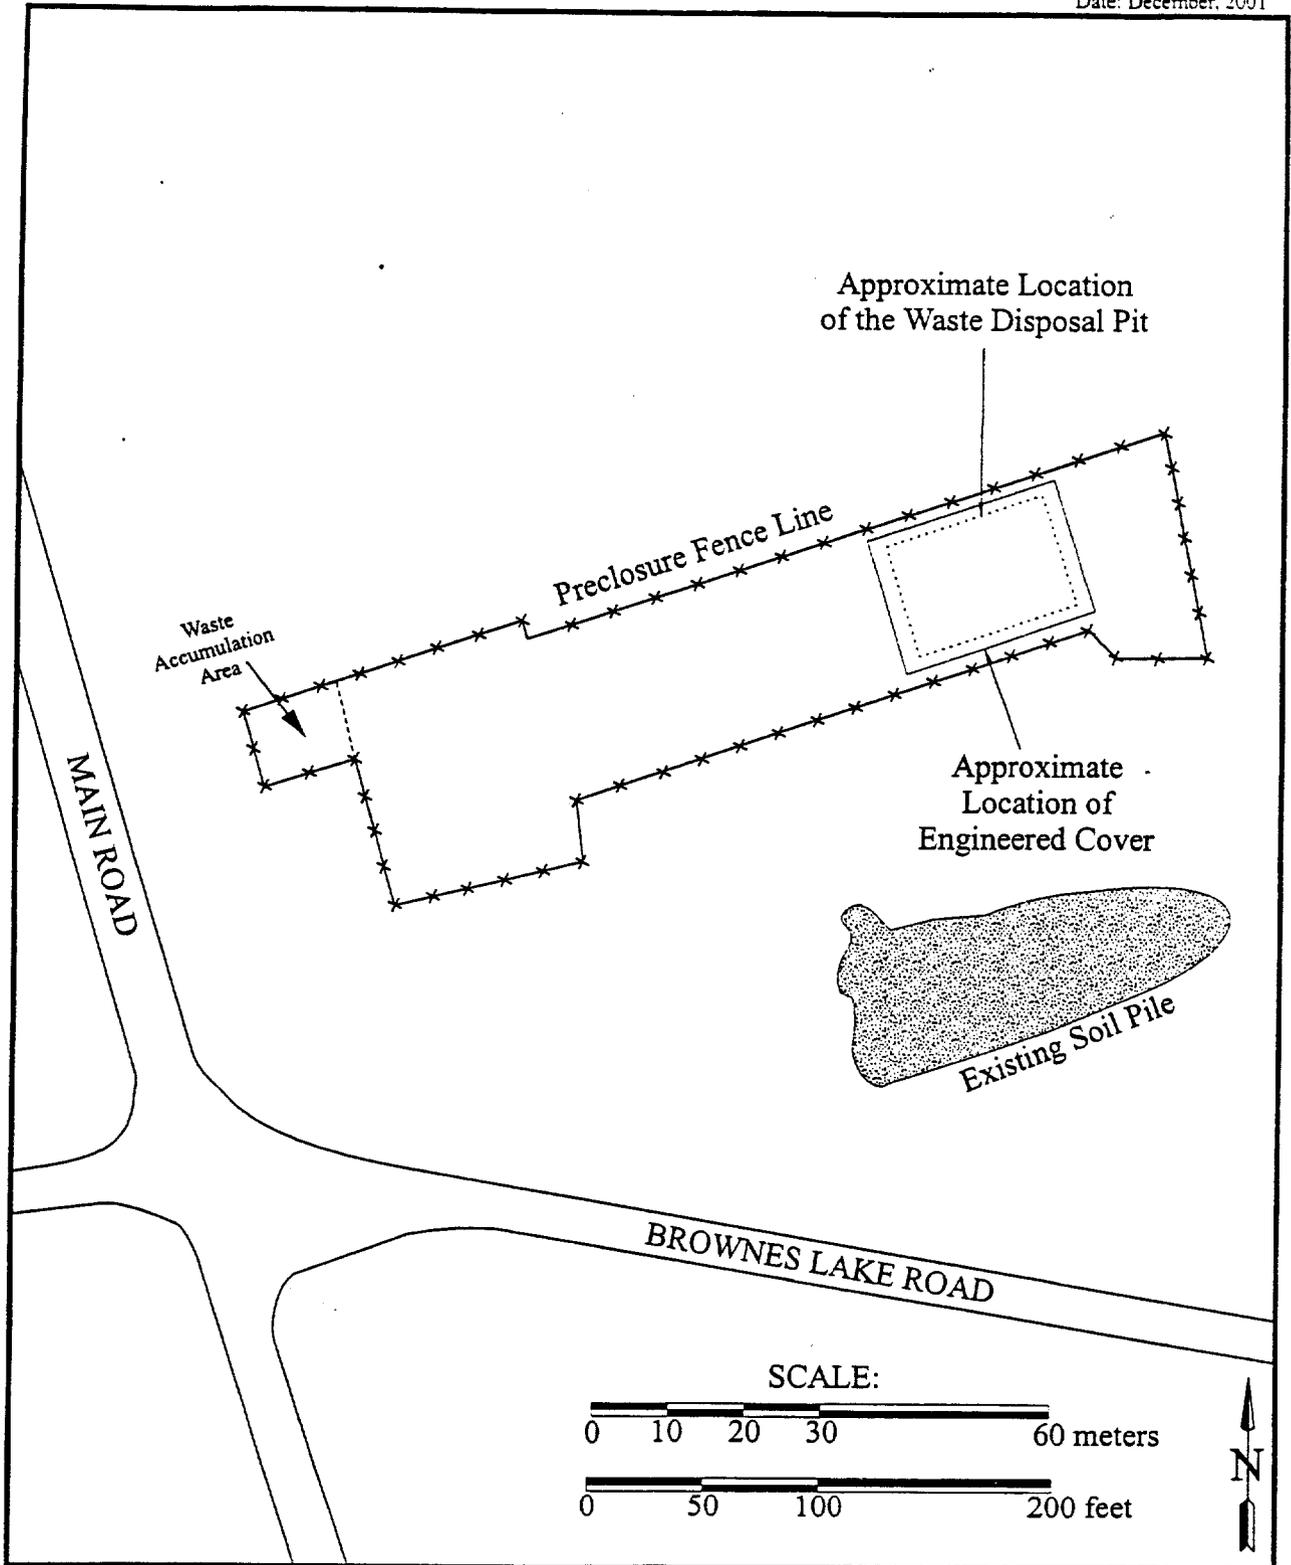


FIGURE 2
CAU 407 SITE VICINITY MAP

- During the hot spot removals, 4 pieces of concrete were uncovered. One piece had high levels of surface activity. After sampling, the concrete was identified as transuranic (TRU) waste. This waste was shipped to the NTS for storage on the TRU pad in Area 5 until it can be disposed of at the Waste Isolation Pilot Project in Carlsbad, New Mexico.
- The cover was prepped and then seeded with plant species native to Area 3 of the TTR.

Closure of CAU 407 was completed using an NDEP-approved CAP (DOE/NV, 2000).

1.3 CONTENTS

This CR is divided into the following sections:

- Section 1.0 - Introduction
- Section 2.0 - Closure Activities
- Section 3.0 - Waste Disposition
- Section 4.0 - Closure Verification Results
- Section 5.0 - Conclusions and Recommendations
- Section 6.0 - References

This report was developed using information and guidance from the following documents:

Bechtel Nevada, 1997, Bechtel Nevada Performance Management Plan, B-A20/96.01, Las Vegas, NV.

Bechtel Nevada, 1999. "Radioactive Waste Tracking, Handling, and Management at the NTS," OP-2151.304, Las Vegas, NV.

Bechtel Nevada, 1998. "General Radiological Control Technician Field Instructions" L-A14.107.H, Revision 1, Las Vegas, NV.

Nevada Division of Environmental Protection, U.S. Department of Energy, and U.S. Department of Defense. 1996. Federal Facility Agreement and Consent Order (FFACO) of 1996.

Nevada Division of Environmental Protection. 2000. Approval of Final Corrective Action Plan (CAP) Corrective Action Unit (CAU) 407, Roller Coaster RADSAFE Area, TTR Federal Facility Agreement and Consent Order (FFACO).

U.S. Department of Energy, Nevada Operations Office, 1998. Corrective Action Investigation Plan for the Roller Coaster RADS SAFE Area. Corrective Action Unit 407: Nevada Test Site, Nevada, Rev. 0, DOE/NV--503. Las Vegas, NV.

U.S. Department of Energy, Nevada Operations Office, 1999. Corrective Action Decision Document for Corrective Action Unit 407: Nevada Test Site, Nevada, Rev. 0, DOE/NV--567. Las Vegas, NV.

U.S. Department of Energy, Nevada Operations Office, 2000. Corrective Action Plan for Corrective Action Unit 407: Nevada Test Site, Nevada Rev.0, DOE/NV--614. Las Vegas, NV.

THIS PAGE INTENTIONALLY LEFT BLANK

2.0 CLOSURE ACTIVITIES

This section of the CR details the specific activities involved in the closure of CAU 407. Based on the site characterization results, the Corrective Action Decision Document for Corrective Action Unit 407: Nevada Test Site, Nevada (CADD) (DOE/NV, 1999) recommended removal of the impacted surface soils and construction of a soil cover over the portion of the site identified as the waste disposal pit. The approved corrective action alternative of close in place, after hot spot removal as specified in the CADD, was implemented.

2.1 DESCRIPTION OF PRIOR CORRECTIVE ACTION ACTIVITIES

In 1963 the Roller Coaster RADSAFE waste pit was excavated during follow up to the testing operations (Appendix A). During the excavation, plutonium-contaminated debris, soil, and a steel baseplate were removed from the waste pit and shipped to the Nevada Test Site.

Characterization activities for CAU 407 were conducted in June and July of 1998. This fieldwork had provisions to clear the "hot spots" of contamination. However, attempts were not completely successful and contamination remained at the surface. Additional "hot spot" removal activities were proposed in the CADD and implemented during the corrective action activities.

2.2 DESCRIPTION OF CORRECTIVE ACTION ACTIVITIES

Closure of CAU 407 was completed using the approved CAP for Corrective Action Unit 407: Roller Coaster RADSAFE Area, Tonopah Test Range, Nevada, Revision 0, dated May 2000 (DOE/NV, 2000). The CAP was based on the recommendations presented in the CADD. The CADD was developed from the results of the Corrective Action Investigation Plan (DOE/NV, 1998). Before the closure field activities began, the following prefield activities were completed:

- Preparation of National Environmental Policy Act documentation.
- Preparation of the Site-Specific Health & Safety Plan and Radiological Work Permit.
- Preparation of the Real-Estate/Operations Permit.
- Preparation of the Field Management Plan.

2.2.1 Soil Removal Criteria

The CAIP for CAU 407 originally specified that the PAL for on-site radiological (alpha and beta/gamma) screening was "two times the established daily background". A Record of Technical Change established radiological PALs for the CAU 407 CAIP as "the average activity of 20 background surface samples plus two times the standard deviation of the average activity."

This change was applied to all samples collected as part of the CAU 407 characterization process.

The CADD for CAU 407 tabulates the analytical results for the samples collected in Appendix A. These results are compared to the background concentrations in McArthur and Miller (1989) and U.S. Ecology and Atlan-Tech (1992). The CADD also states, in the evaluation of corrective action alternatives, that surface soils with "contamination greater than 2 to 3 times background or as determined by field screening, whichever is greater, would be excavated to a depth of 6 inches". The three times background criteria was applied only to the identification of "hot spots" based on in-situ soil screening measurements using the FIDLER.


The CAP for the closure of CAU 407 indicated that background readings would be established for the field screening instrumentation and that surface "hot spots" would be removed from areas where the readings exceeded three times the established background. This brought clarification to any ambiguity in the 2 to 3 times background recommendation in the CADD, as approved by the NDEP.

It should be noted that the identification of surface "hot spots" at three-times background, using a FIDLER survey instrument, has no relationship to the field screening levels, or PALs, used for site characterization.

2.2.2 Removal of Surface Impacted Soils

The site closure team re-identified the initial surface radiological survey "hot spots" as specified in the CAP. Of the 16 surface locations with elevated gross radiological activity readings identified in the CAP, seven locations were identified with activity readings which exceeded three times background as determined by the Field Instrument for the Detection of Low Energy Radiation (FIDLER). A one minute count established a background reading at 3,500 cpm at a location not impacted by human activity. Three times this value is 10,500 cpm which was used as the clean-up criteria for "hot spot" removal.

Soil was removed from the "hot spot" locations until the criterion of less than three times background was met. The locations of the soil removals are shown in Figure 3. FIDLER readings taken after "hot spot" removal confirmed that no surface soil activity remained that was greater than the three times background criterion. Excavated soil was managed as LLW. Impacted soil was placed into a 55-gallon (gal) drum following Bechtel Nevada (BN) Procedure OP-2151.304, "Radioactive Waste Tracking, Handling, and Management at the NTS," (BN, 1999) and stored temporarily in a waste management area prior to disposal at the Area 5 RWMS on the NTS. Excavations were backfilled with clean fill from a borrow source near the site.

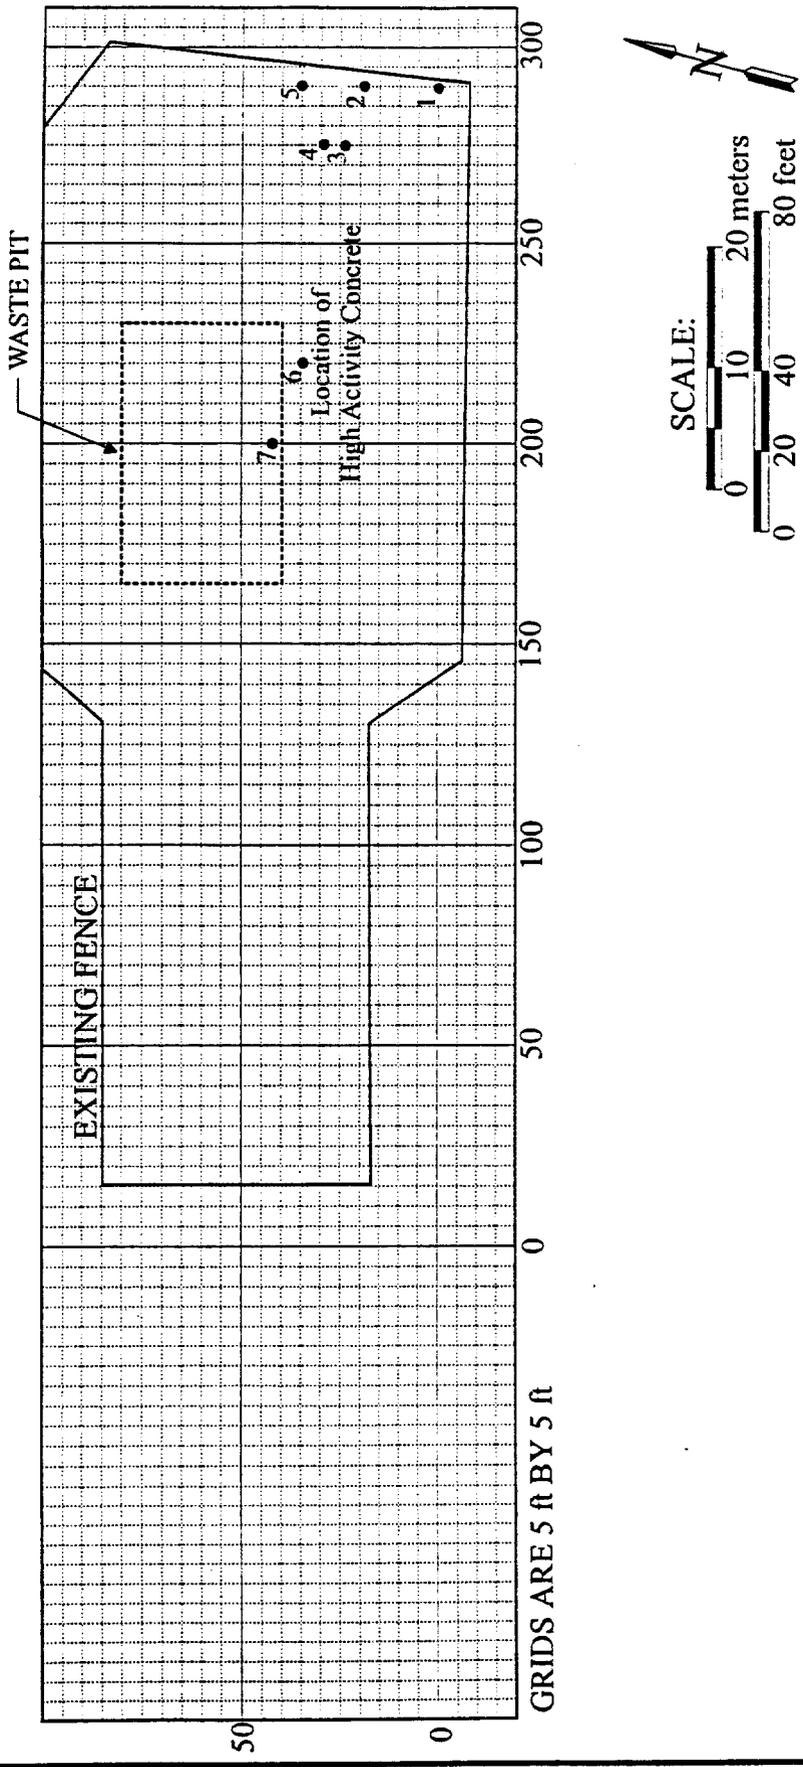

Background = 3,500 counts per minute using a FIDLER detector.

FIGURE 3
LOCATIONS OF HOT SPOTS REMOVED FROM CAU 407

During removal of impacted soils, 4 pieces of impacted concrete were discovered which had a high level of surface activity. These pieces of concrete were isolated for sampling and analysis (see Section 3.0 for analytical results). Sample results indicated that one of the concrete pieces had an activity which qualified it as transuranic (TRU) waste. This was previously identified as one of several "hot spots" located during the walkover radiological surveys of CAU 407. The impacted surface soils and debris have been removed and the area re-surveyed to confirm compliance with the CAP.

2.2.3 Construction of Soil Cover

The cover design was a 0.6-meters (m) (2-feet [ft]) thick monolayer of clean fill which was placed over the historic waste pit (Figure 2). The main purpose of this layer was to provide an additional level of protection to the hypothetical future land user from subsurface radionuclides which remain. As-built drawings of the engineered cover are located in Appendix A. Photos of cover construction are included in Appendix B.

2.2.4 Fence Construction

Following cover construction, the existing three-strand barbed wire fence was modified (Appendix A). The fence was modified to isolate the cover from intrusion. Additionally, the areas which still potentially contain subsurface radioactive soils were also isolated with fencing. Signs identifying the site as an "Underground Radioactive Material" area were posted on the fencing. The modified site fencing as-built drawing are presented in Appendix A.

2.2.5 Revegetation

The primary purpose of seeding the RCRSA cover was to restore the site back to the natural surrounding conditions. The revegetation activity was performed on October 24, 2000. The cover surface was ripped and disced to a depth of approximately 0.4 m (1.3 ft). After the seed mix was broadcast, straw was applied to the surface as mulch. The seed mixture consisted of a mixture of shallow rooting native species. The fall planting time allows for dormancy-breaking requirements to be met, and that the seed will be in the ground prior to the winter precipitation.

2.3 DEVIATIONS FROM CLOSURE PLAN AS APPROVED

The final CAP was approved by NDEP (NDEP, 2000) in May of 2000. The approved closure plan indicated that vegetation, including root balls, would be removed prior to cover construction. The project health physicist requested that the surface soils remain undisturbed to protect site workers from exposure to subsurface radioactivity. All vegetation was removed from the surface, however the root balls were left intact. The fence corners were secured with angle posts rather than excavating and pouring concrete footings at the health physicists request.

The fence design was also modified slightly from the approved closure plan. Although less than three times the back ground radioactivity, areas of elevated radioactivity remained to the east and west of the cover. The fence was extended to encompass these areas as a best management practice. The new fence dimensions are located in the as-built drawings (Appendix B). Additionally, the fence corner design and entrance gate design were modified. Cement footings for the barbed wire fencing and the chain-link fence increased costs unnecessarily. A simple barbed wire gate was constructed to allow access to the cover for maintenance purposes. The fence corners were secured with angle posts. The as-built drawings (Appendix B) show the modifications.

2.4 CORRECTIVE ACTION SCHEDULE AS COMPLETED

The corrective action began on July 10, 2000. Hot spots removal and cover construction were completed on July 13, 2000. Impacted surface soils were shipped to the Area 5 RWMS for disposal on July 18, 2000. Cover revegetation was completed on October 24, 2000. The concrete pieces were shipped to the Area 5 TRU pad for storage on March 6, 2001. Figure 4 provides a detailed schedule of closure activities as completed.

2.5 SITE PLAN

The final as-built drawings for the cover are located in Appendix B.

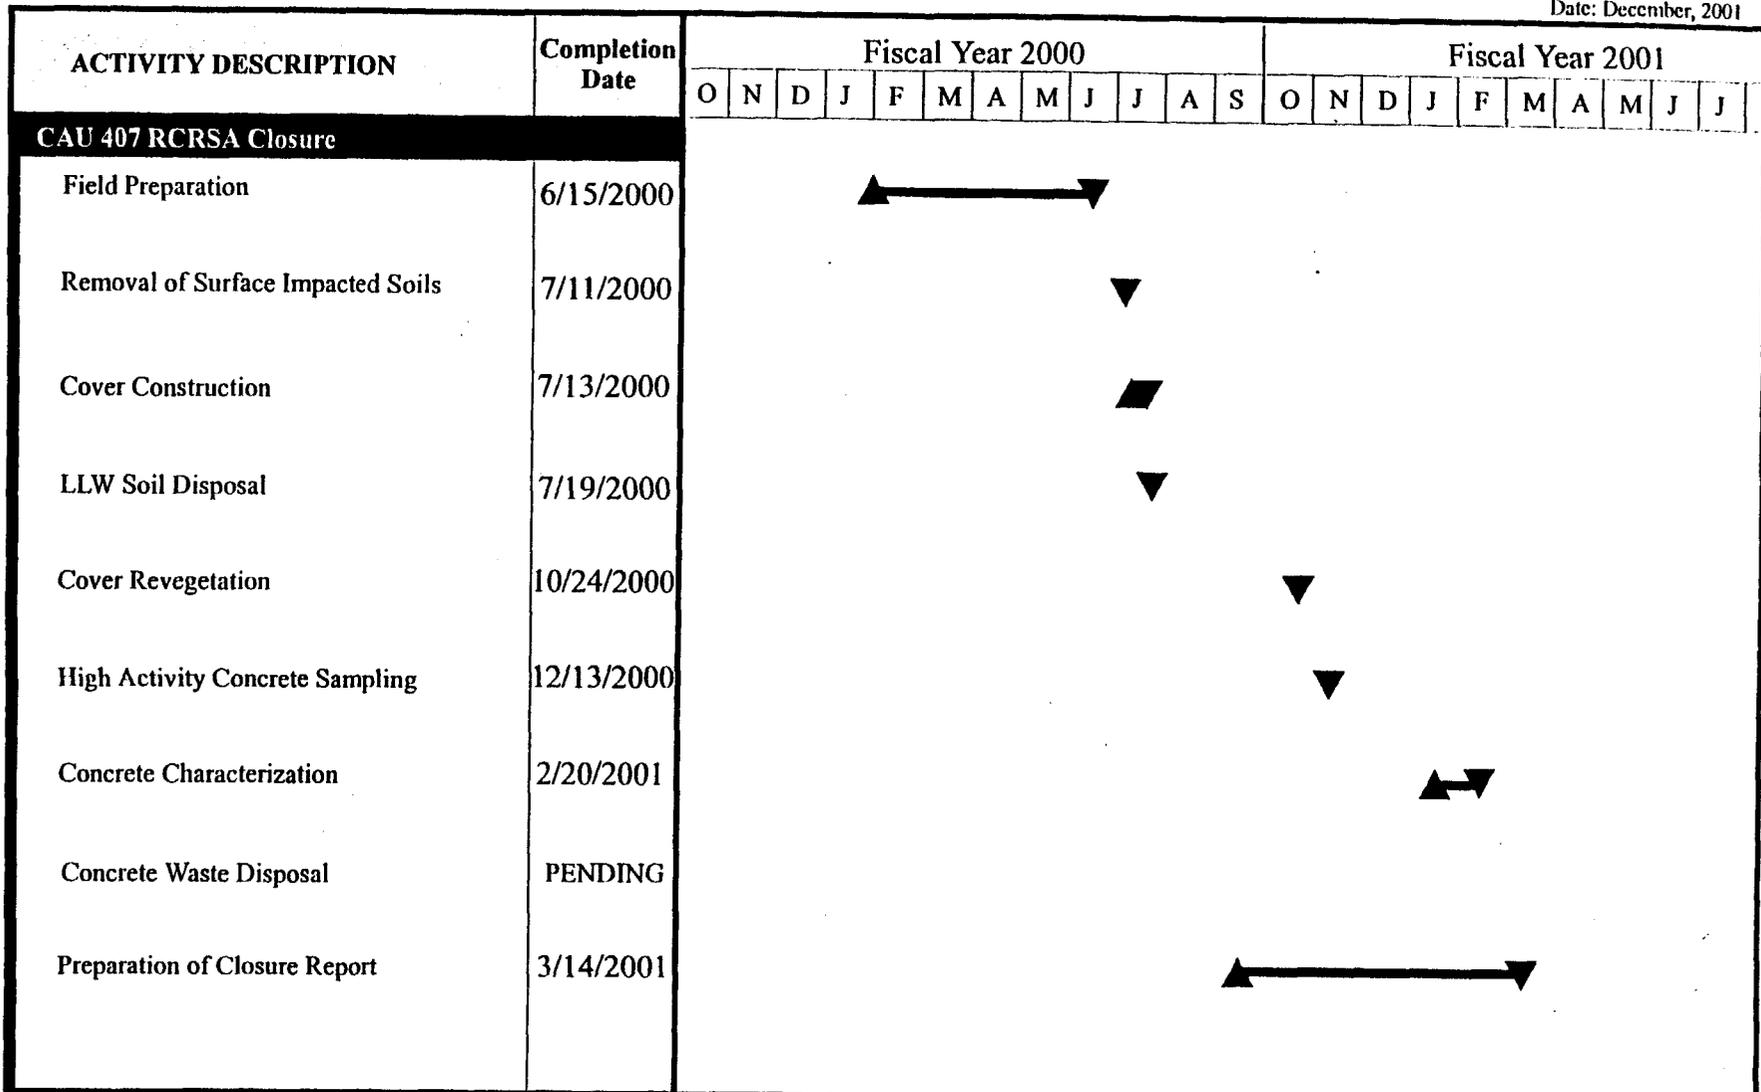


FIGURE 4
 CAU 407 SCHEDULE AS COMPLETED

3.0 WASTE DISPOSITION

Waste generated from CAU 407 closure activities consisted of radiologically impacted soil and concrete, personal protective equipment, and sanitary trash. Radiologically impacted soil was contained in a 55-gal drum and shipped to the NTS as LLW. The high-activity radiologically impacted pieces of concrete were sampled in order to develop a waste profile. Swipe results from the concrete pieces indicated that the activity was fixed. Sample results indicated that the concrete meets the definition of TRU waste (Table 1). The concrete was shipped to the NTS for storage at the Area 5 TRU pad pending final disposal at the Waste Isolation Pilot Project in Carlsbad, New Mexico. The certificate of disposal for the 55-gal drum of LLW is in Appendix D. All sanitary trash was bagged and disposed of at the TTR dumpster in Area 3.

TABLE 1 - SAMPLE RESULTS FOR THE HIGH ACTIVITY CONCRETE

Sample Identification	Mass of Concrete	Activity of Americium-241 (nCi/g)
CAU4070001	20 grams	0.0212
CAU4070002	1814 grams	0.797
CAU4070003	60 grams	2.61
CAU4070004	5896 grams	145.0

THIS PAGE INTENTIONALLY LEFT BLANK

4.0 CLOSURE VERIFICATION RESULTS

Closure verification for the hot spot removal was accomplished using the FIDLER. The background FIDLER reading was established on native soils not associated with the CAU 407 RADS SAFE area. A one minute count established a background reading at 3,500 cpm. Three times this value is 10,500 cpm which was used as the clean-up criteria for "hot spot" removal. Results from the FIDLER before soil removal and after soil removal are presented in Table 1. Closure verification for the soil cover construction was accomplished by surveying the final cover. As-built drawings are presented in Appendix B.

TABLE 2 - FIDLER READINGS BEFORE AND AFTER HOT SPOT REMOVAL

Location Number	Initial Reading (cpm x 1000)	Reading after Removal (cpm x 1000)
1	64	10
2	16	9
3	12	8.5
4	12	9
5	13	9.4
6	47	10
7	30	8.4

4.1 REMAINING TRANSURANIC WASTE AT CAU 407

During the CAU 407 site investigation, 78 subsurface samples were collected in and around the waste pit and were submitted for laboratory analysis. Included in this total were 26 subsurface samples collected from the CAU 407 waste pit. The maximum ^{239/240}Pu concentration detected in these 26 waste pit samples was 5,210 picocuries per gram. Statistical analysis demonstrates that the number of samples collected from the CAU 407 waste pit was sufficient to ensure, at the 99.5 percent confidence level, that the mean TR concentration does not exceed 0.1% of the transuranic land disposal limit of 100,000 picocuries per gram (Appendix E).

The approved CAU 407 Corrective Action Investigation plan was designed primarily to identify COPCs exceeding PALs in surface and subsurface soils, and to determine the extent of any horizontal and vertical migration of COPCs beyond the site boundaries. These objectives were accomplished.

A radiological dose analysis was performed to determine the dose to hypothetical future land users from residual radioactivity in the CAU 407 waste pit. The analysis demonstrates that the maximum annual dose is well below established dose limits.

The plutonium-contaminated piece of concrete was found about 5 feet outside of the CAU 407 waste pit, this material might have been associated with the 1963 Roller Coaster RADS SAFE waste pit excavation. During the excavation, plutonium-contaminated debris, soil, and a steel baseplate were removed from the waste pit and shipped to the Nevada Test Site. Information concerning this operation, provides additional assurance that the waste pit does not currently contain significant amounts of transuranic radionuclides.

4.2 LAND-USE RESTRICTIONS

The RCRSA cover and the areas around the cover which contain radiological activity greater than background are fenced from general entry. This area has been posted with signs reading "Underground Radioactive Material." Only authorized personnel may enter for post-closure inspection and repair. The land-use restriction form has been submitted to the U.S. Air Force at the TTR. A copy of the form is located in Appendix F.

5.0 CONCLUSIONS AND RECOMMENDATIONS

5.1 CONCLUSIONS

Closure for this site was completed by the following:

- Removal and disposal of surface soils which were over three times background for the area. Soils identified for removal were disposed of at the Area 5 RWMS at the NTS. Excavated areas were backfilled with clean borrow soil located near the site.
- A soil cover was constructed over the waste disposal pit area, where subsurface Constituents of Concern remain.
- The site was fenced and posted as an "Underground Radioactive Material" area.
- During the hot spot removals, a piece of high activity concrete was uncovered. Sampling results indicated that the piece of concrete met the definition of TRU waste. Sampling results and process knowledge support the conclusion that the CAU 407 waste pit does not contain significant amounts of transuranic radionuclides.
- The cover was prepped and then seeded with plant species native to Area 3 of the TTR.

The information presented in this report documents that the closure was accomplished in accordance with the approved CAP (DOE/NV, 2000). FIDLER surface readings indicate that the hot spot clean up criteria were met. The as-built drawings demonstrate that the constructed soil cover was built according to specifications (Appendix B). Project photos provide a record of all pertinent activities (Appendix C)

5.2 INSPECTIONS

Inspections consist of visually inspecting the cover for signs of erosion, animal burrows, cracks, water ponding, vegetation, and inspecting the fencing and postings. Inspections will be performed twice during the first six months after construction of the cover has been completed. After completion of the quarterly inspections, the cover systems will be inspected and monitored semiannually (twice per year) for the next two years. The frequency after the second year will be determined by NDEP, based on the results of the previous inspections. Any identified maintenance and repair requirements will be remedied within 90 working days of discovery and documented in writing at the time of repair.

Results of all inspections in a given year will be addressed in a single annual report. The annual report will include the following information:

- Discussion of observations.
- Inspection checklist and maintenance record.
- Conclusions and recommendations.

A copy of each annual report will be submitted to the NDEP. A copy of the inspection checklist is provided in Appendix G.

5.3 RECOMMENDATIONS

Based upon the completion of site activities, it is requested that a notice of completion be provided by the NDEP for CAU 407. Upon closure approval, CAU 407 will be promoted from Appendix III to Appendix IV of the FFACO, "Closed Corrective Action Units."

6.0 REFERENCES

BN, see Bechtel Nevada.

Bechtel Nevada, 1997, Bechtel Nevada Performance Management Plan, B-A20/96.01, Las Vegas, NV.

Bechtel Nevada, 1998. "General Radiological Control Technician Field Instructions" L-A14.107.H, Revision 1, Las Vegas, NV.

Bechtel Nevada, 1999. "Radioactive Waste Tracking, Handling, and Management at the NTS," OP-2151.304, Las Vegas, NV.

DOE/NV, see U.S. Department of Energy, Nevada Operations Office

NDEP, see Nevada Division of Environmental Protection

Nevada Division of Environmental Protection, U.S. Department of Energy, and U.S. Department of Defense. 1996. Federal Facility Agreement and Consent Order (FFACO) of 1996.

Nevada Division of Environmental Protection. 2000. Approval of Final Corrective Action Plan (CAP) Corrective Action Unit (CAU) 407, Roller Coaster RADSAFE Area, TTR Federal Facility Agreement and Consent Order (FFACO).

U.S. Department of Energy, Nevada Operations Office, 1998. Corrective Action Investigation Plan for the Roller Coaster RADSAFE Area, Corrective Action Unit 407: Nevada Test Site, Nevada, Rev. 0, DOE/NV--503. Las Vegas, NV.

U.S. Department of Energy, Nevada Operations Office, 1999. Corrective Action Decision Document for Corrective Action Unit 407: Nevada Test Site, Nevada, Rev. 0, DOE/NV--567. Las Vegas, NV.

U.S. Department of Energy, Nevada Operations Office, 2000. Corrective Action Plan for Corrective Action Unit 407: Nevada Test Site, Nevada, Rev.0, DOE/NV--614. Las Vegas, NV.

THIS PAGE LEFT INTENTIONALLY BLANK

APPENDIX A

HISTORIC PHOTOS

THIS PAGE LEFT INTENTIONALLY BLANK

**Photographs of 1963 CAU 407 Waste Pit Excavation to
Recover Double Tracks Steel Plate and Debris**

Attachment E consists of four photographs showing debris and the Double Tracks baseplate being removed from the Roller Coaster Rad Safe Waste Pit.




Photo 175-03-TTR-63 shows Radiological Control Technicians during the Roller Coaster Followup Operation directing a bulldozer operator during digging for buried debris at the Rad Safe Waste Pit at Tonopah

THIS PAGE LEFT INTENTIONALLY BLANK

Photo 175-05-TTR-63 shows a Radiological Control Technician carrying debris from the Rad Safe Waste Pit at Tonopah




Photo 175-04-TTR-63 shows a Radiological Control Technician during the Roller Coaster Followup Operation using rope to handle contaminated debris at the Rad Safe Waste Pit at Tonopah

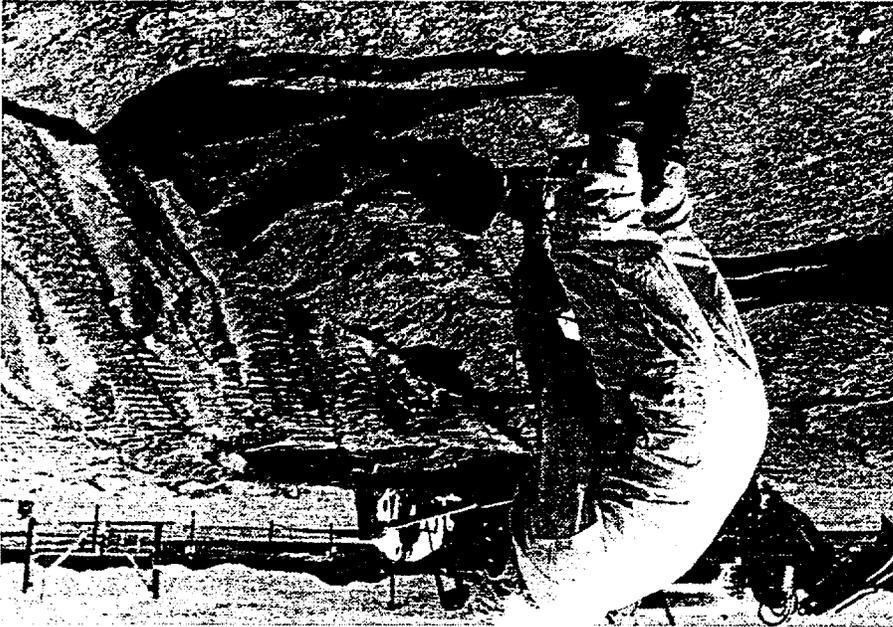

THIS PAGE LEFT INTENTIONALLY BLANK

Photo 175-12-TR-63 shows the crane lifting the 8 x 8 ft Double Tracks Steel Base Plate from the Rad Safe Waste Pit at Tonopah during the Roller Coaster Followup Operation

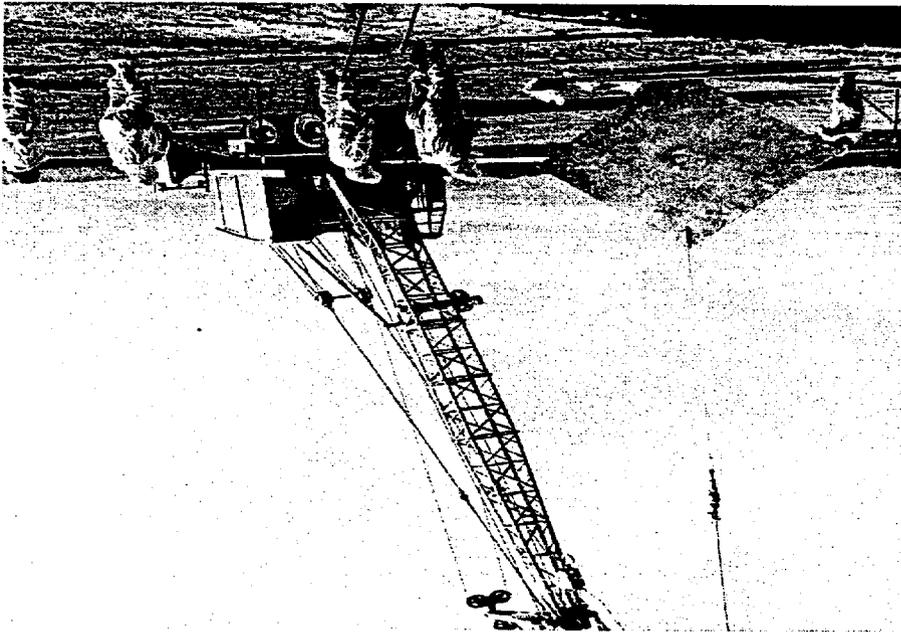

THIS PAGE LEFT INTENTIONALLY BLANK

APPENDIX B

CAU 407 AS-BUILT DRAWINGS

THIS PAGE LEFT INTENTIONALLY BLANK

UNITED STATES DEPARTMENT OF ENERGY

NEVADA OPERATIONS OFFICE
LAS VEGAS, NEVADA

TONOPAH TEST RANGE (TTR) CAU 407 ROLLER COASTER RAD SAFE AREA AREA 54

INDEX

DRAWING NUMBER	DRAWING TITLE	STANDARD NUMBER	DESCRIPTION
TITLE			
00022-054-133-11	REV 1 TITLE SHEET	STD 71 SHT 1 STD 72 SHT 1	STANDARDS INDEX GENERAL NOTES, DRAFTING SYMBOLS & ANSI STANDARDS
CIVIL			
00022-054-133-C1	REV 1 VICINITY MAP	STD C100 SHT 1	NOTES, LEGEND & SYMBOLS
00022-054-133-C2	REV 1 SITE PLAN	STD C101 SHT 1	ABBREVIATIONS
00022-054-133-C3	REV 1 GRADING PLAN & SECTIONS		
00022-054-133-C4	REV 1 DETAILS		

SCOPE OF WORK

THE SCOPE OF WORK FOR THIS PROJECT INCLUDES LIMITED EXCAVATION OF RADIOLOGICALLY IMPACTED SURFACE SOILS AT 13 LOCATIONS AND DESIGN OF A SOIL COVER FOR THE WASTE DISPOSAL PIT AT THE ROLLER COASTER RADSAFE AREA (CRS4).

AREA EVALUATION FOR RESIDUAL SOIL CONTAMINATION SHALL BE PERFORMED BY THE CONTRACTOR IN ACCORDANCE WITH DOE/WH 5480.11 AND THE CONTRACTOR'S STANDARD OPERATING PROCEDURES PRIOR TO COMMENCING CONSTRUCTION ACTIVITIES.


PROJECT NOTES

ALL CONSTRUCTION DOCUMENTATION, SPECIAL FEATURES, MATERIALS, TESTS AND DETAILS SHALL CONFORM TO CONSTRUCTION SPECIFICATIONS FOR CAU 407 REMEDIATION, ROLLER COASTER RAD-SAFE AREA CLOSURE, DATED APRIL 2000 AND THE APPROVED CORRECTIVE ACTION PLAN. FOR STANDARDS REFERENCED ON THIS PROJECT, SEE THE RSH DESIGN DRAWING STANDARDS.

AS-BUILT	
Bechtel Nevada	Scotty Gilman 4/11/00
Scotty Gilman	4/11/00
4/11/00	4/11/00
4/11/00	4/11/00
4/11/00	4/11/00

UNLESS NOTED BY MARKED CHANGES, ALL DIMENSIONS, NOTES, REFERENCES AND CONSTRUCTION FEATURES ARE CORRECTED, AND WERE CONSTRUCTED AS SHOWN ON THIS DRAWING.

LOCATION MAP
NOT TO SCALE

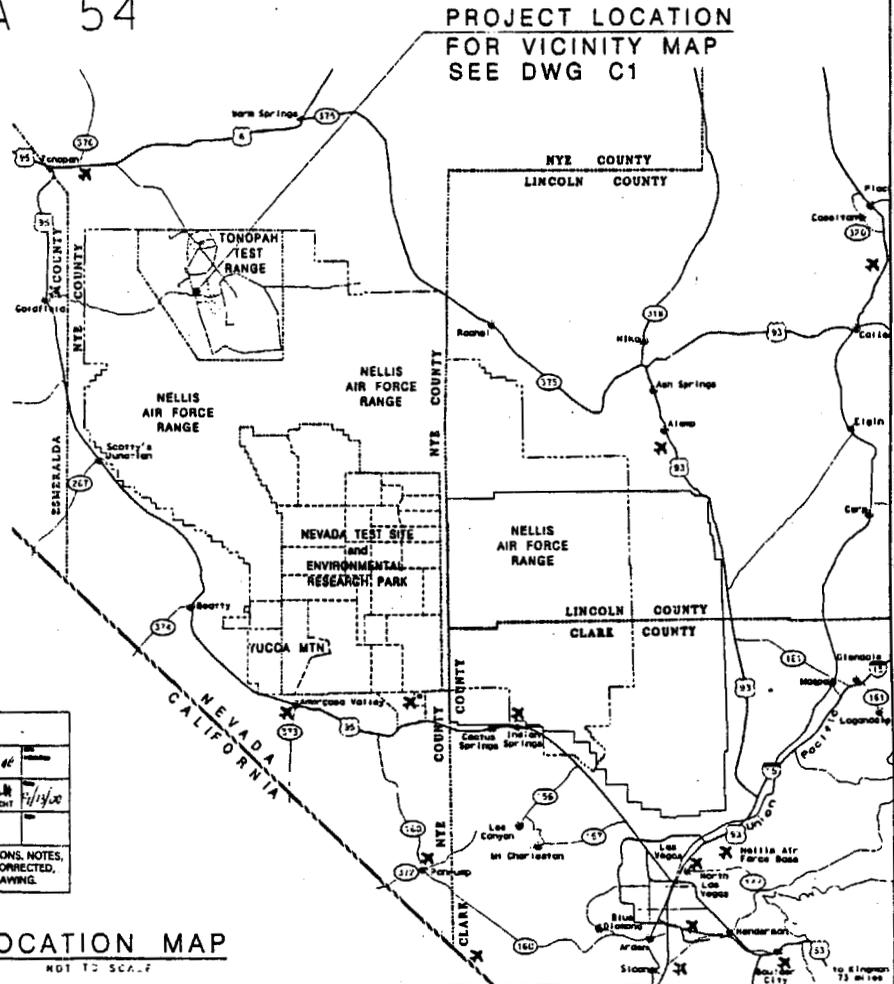

PROJECT LOCATION
FOR VICINITY MAP
SEE DWG C1

DATE	BY	CHKD	APP'D	REV
04/11/00	SG	SG	SG	1
04/11/00	SG	SG	SG	2
04/11/00	SG	SG	SG	3
04/11/00	SG	SG	SG	4
04/11/00	SG	SG	SG	5
04/11/00	SG	SG	SG	6
04/11/00	SG	SG	SG	7
04/11/00	SG	SG	SG	8
04/11/00	SG	SG	SG	9
04/11/00	SG	SG	SG	10
04/11/00	SG	SG	SG	11
04/11/00	SG	SG	SG	12
04/11/00	SG	SG	SG	13
04/11/00	SG	SG	SG	14
04/11/00	SG	SG	SG	15
04/11/00	SG	SG	SG	16
04/11/00	SG	SG	SG	17
04/11/00	SG	SG	SG	18
04/11/00	SG	SG	SG	19
04/11/00	SG	SG	SG	20

AS-BUILT DATE 07/26/00
DESIGNED BY SCOTT GILMAN
CHECKED BY SCOTT GILMAN
APPROVED BY SCOTT GILMAN
DATE 07/26/00
SCALE 1"=1 MILE
PROJECT NO. 00022-054-133-11
DRAWING NO. 00022-054-133-11
SHEET NO. 1 OF 1
REVISIONS FOR CONSTRUCTION 05/11/00
REVISED BY SG

ORIGINAL W.T.M. STORED BY 1

U.S. DEPARTMENT OF ENERGY
NEVADA OPERATIONS OFFICE
LAS VEGAS, NEVADA
Bechtel Nevada
00022-054-133-11

PROJECT NOTES

- GENERAL**
 BASIS FOR VERTICAL CONTROL IS THE NORTH AMERICAN DATUM 1983, STATE PLANE, NEVADA CENTRAL ZONE, METERS.
- MADE FOR VERTICAL CONTROL IS THE NORTH AMERICAN VERTICAL DATUM OF 1929, E.T.C.
 - SOURCE OF CONSTRUCTION WATER WILL BE THE ROLLER COASTER WELL LOCATED NEAREST TO THE PROJECT SITE. SEE VICINITY MAP, DRAWING C-1.
 - BORROW SOILS FOR BACKFILLING AND CONSTRUCTION OF THE CLOSURE CAP SHALL BE OBTAINED FROM THE SOIL STOCKPILE AT THE PROJECT SITE.
- DEMOLITION**
- EXISTING WIRE FENCING TO BE REMOVED. REMAIN FENCE MATERIALS WERE POSSIBLE TO REUSE FOR NEW FENCE. FOR NEW FENCE LOCATION SEE DRAWING C-1.
 - DURING CONSTRUCTION MAINTAIN BARRIERS TO LIMIT EXPOSURE TO CONTAMINANTS.
- CONTAMINATED SOILS REMOVAL**
- FIELD SURVEY FOR CONTAMINATION MUST BE PERFORMED TO LOCATE CONTAMINATED SURFACE LOCATIONS TO BE EXCAVATED.
 - EXCAVATION OF RADIOLOGICALLY IMPACTED SOILS SHALL BE PERFORMED IN ACCORDANCE WITH SPECIFICATION SECTION 0222.
 - EXCAVATIONS SHALL BE FIELD SCREENED FOR RADIATION AFTER REMOVAL.
 - EXCAVATIONS SHALL BE BACKFILLED WITH CLEAN NATIVE MATERIAL BACKFILL. BACKFILL SHALL BE GRADED TO MAINTAIN POSITIVE DRAINAGE.
- CLOSURE CAP**
- NATIVE MATERIAL BACKFILL SHALL MEET THE REQUIREMENTS OF SPECIFICATION SECTION 0223.

LEGEND

- EXISTING FENCE
- NEW FENCE
- EXISTING INDEX CONTOR
- PROPOSED INDEX CONTOR
- BUILT ROAD
- PAVED ROAD
- EXISTING FLOOR LINE



REFERENCES


TITLE SHEET: 00022-004-133-01
 VICINITY MAP & SECTIONS: 00022-004-133-01
 CONSTRUCTION SPECIFICATION FOR CAU 407: 00022-004-133-03
 ROLLER COASTER ROADSAFE AREA: 9-0002204-0006-0

AS-BUILT

Project No.	00022-004-133-01
Sheet No.	11
Date	11/16/00
Drawn By	J. J. [unclear]
Checked By	[unclear]

UNLESS NOTED BY MARKED CHANGES ALL DIMENSIONS, NOTES, AND CONSTRUCTION SPECIFICATIONS ARE TO BE CONSIDERED AS SHOWN ON THIS DRAWING.

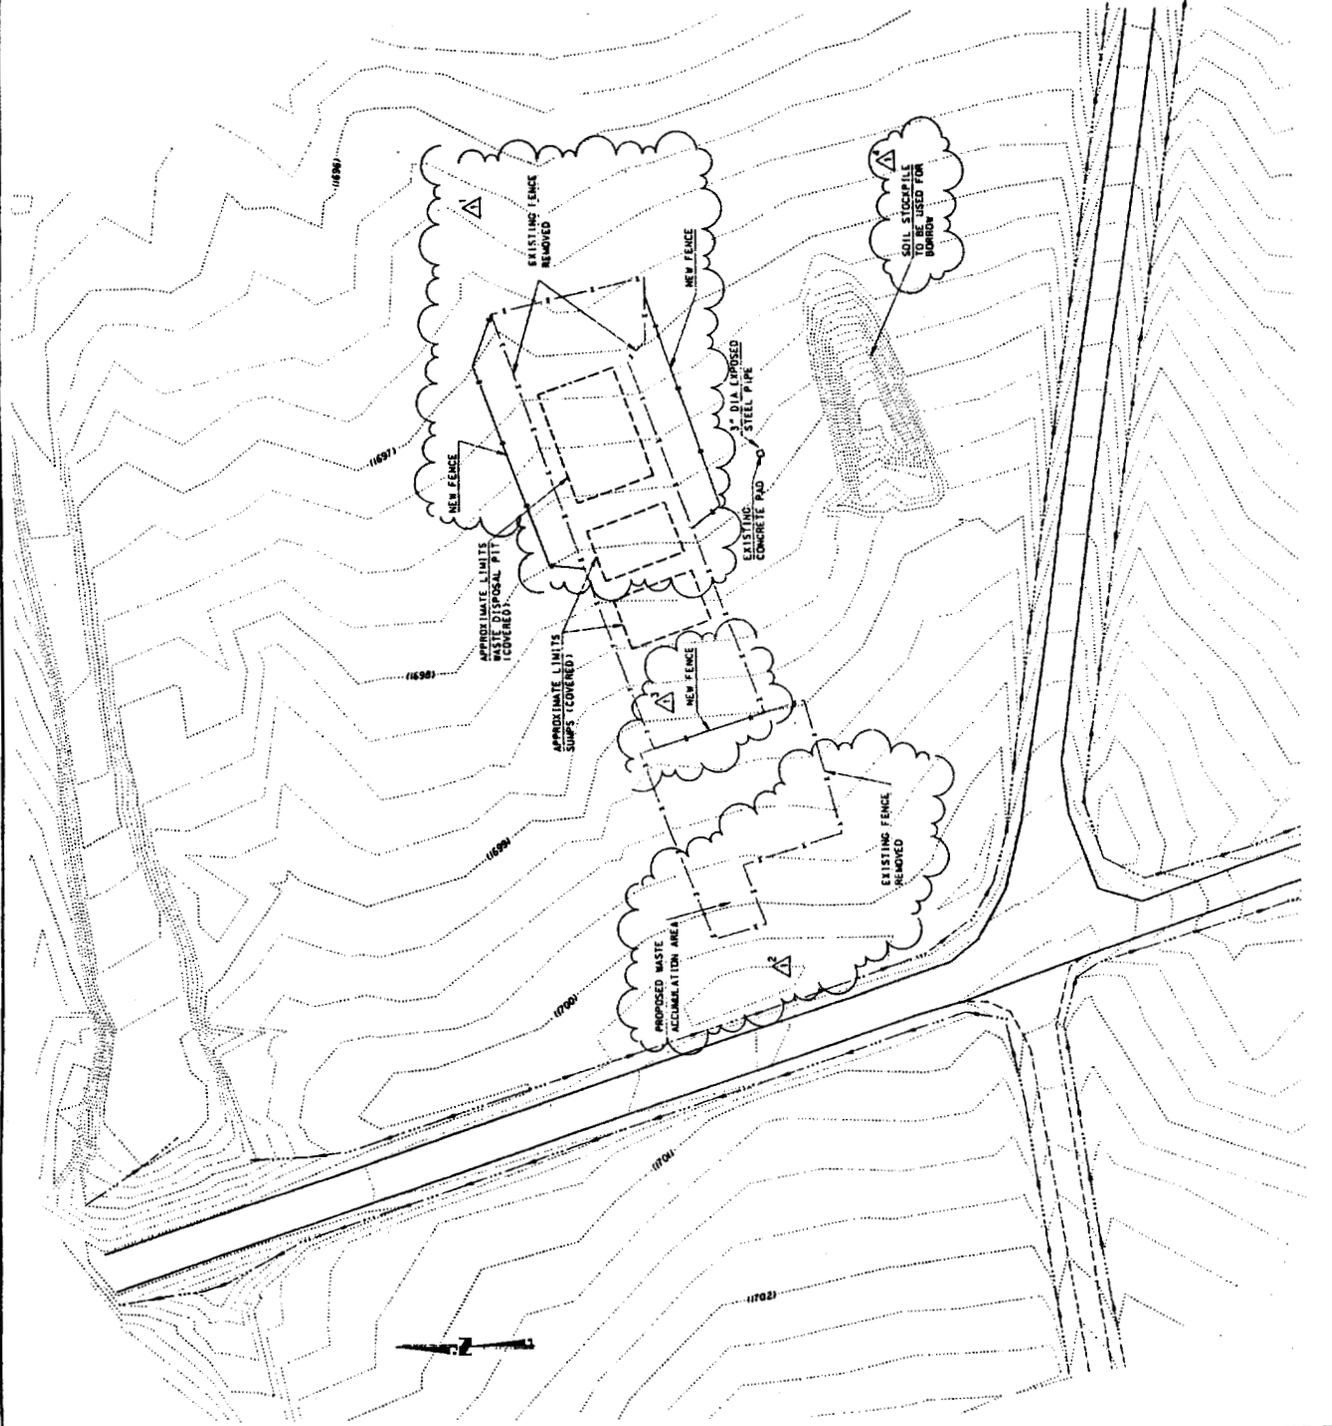

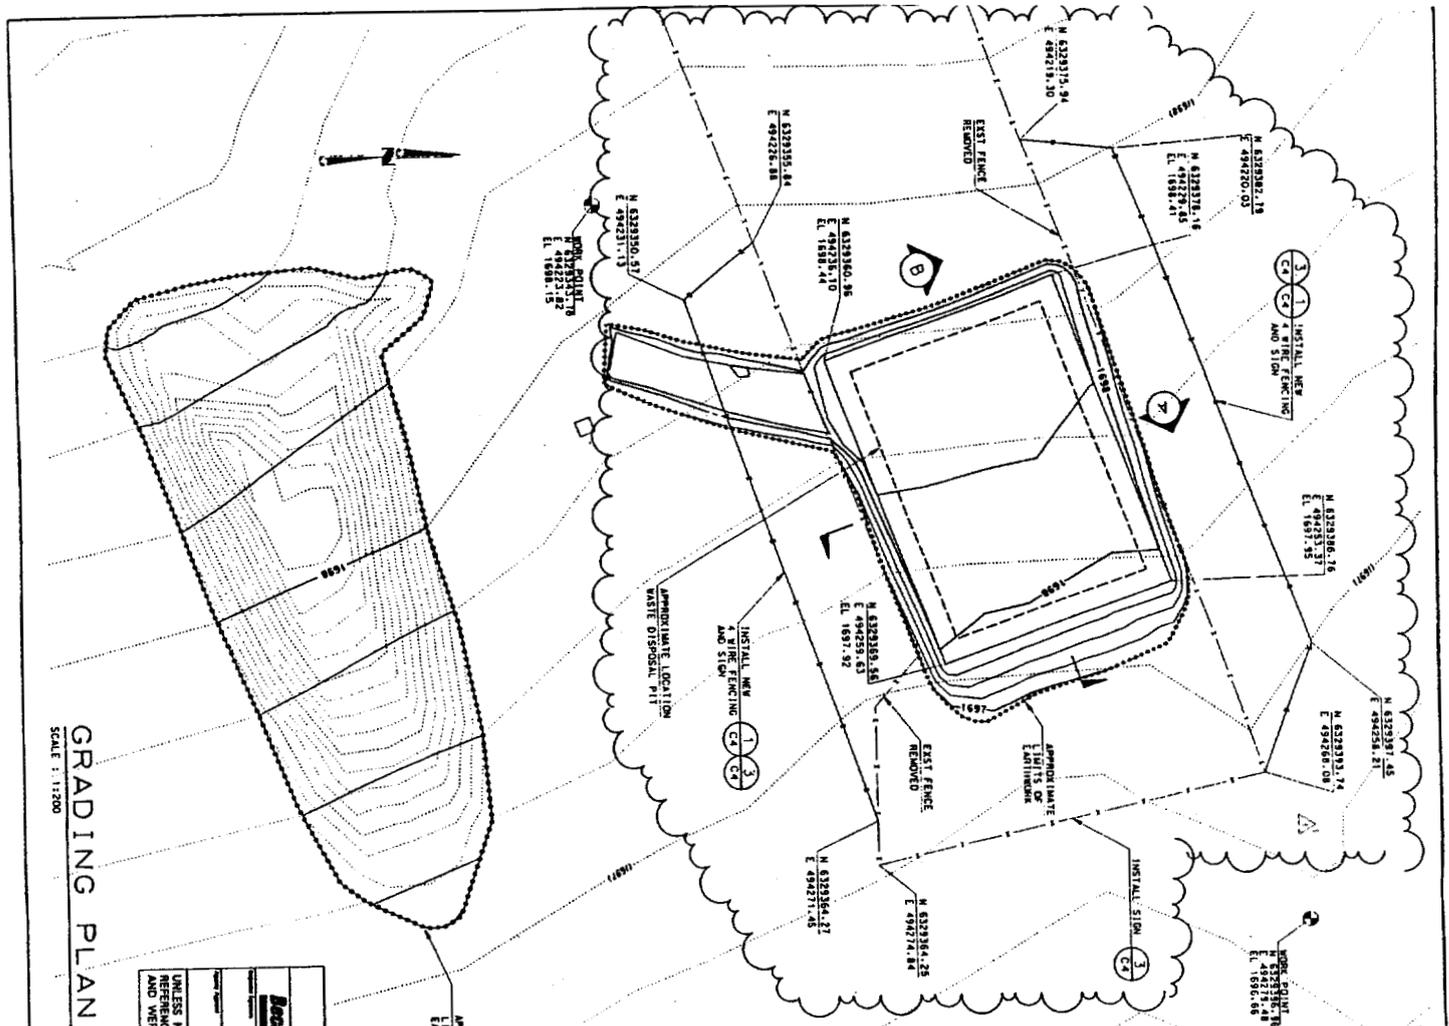




GRADING PLAN
SCALE: 1:1200

AS-BUILT	
DATE	07/26/00
BY	J. J. [Signature]
CHECKED BY	[Signature]
SCALE	AS SHOWN

UNLESS NOTED BY MARKED CHANGES, ALL DIMENSIONS, NOTES, REFERENCES AND CONSTRUCTION FEATURES ARE CORRECTED AND WERE CONSTRUCTED AS SHOWN ON THIS DRAWING.



ESTIMATED QUANTITIES

DESCRIPTION	QUANTITY	UNIT
NATIVE FILL	455	CUBIC YARDS

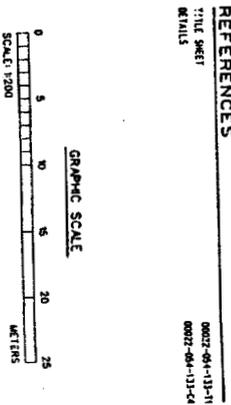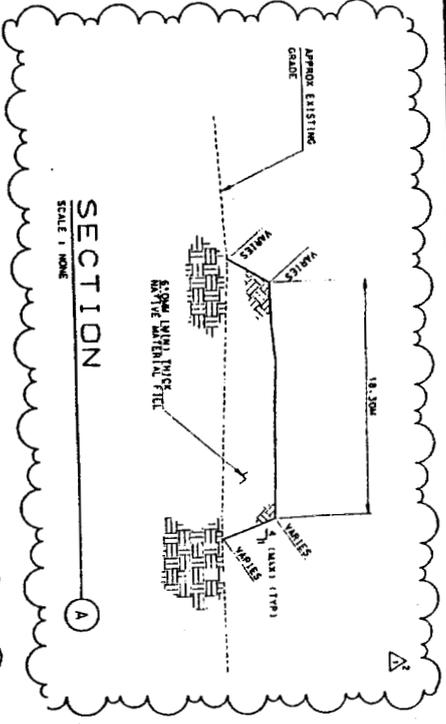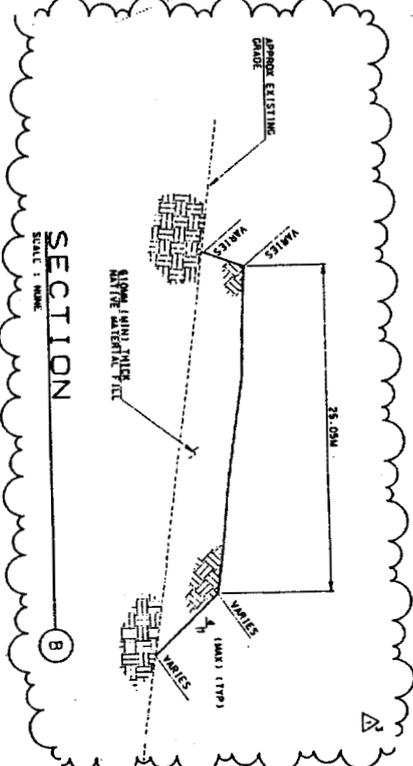

ORIGINAL MYLAR SIGNED BY:

	U.S. DEPARTMENT OF ENERGY TONOPAH TEST RANGE AREA 54 CAU 407 REMEDIATION ROLLER COASTER RAD SAFE AREA GRADING PLAN & SECTIONS	DATE: 05/08/00 DRAWN BY: JAMES F. JOHNSON CHECKED BY: JAMES F. JOHNSON PROJECT NO.: 00027-04-13-24 SHEET NO.: 13 OF 13	AS-BUILT, DATED 07/26/00 MODIFIED GRADING, FENCE, SECTIONS. ISSUED FOR CONSTRUCTION 05/11/00
	00027-04-13-21 00027-04-13-24	05/08/00 05/08/00 05/10/00 05/11/00	13 OF 13

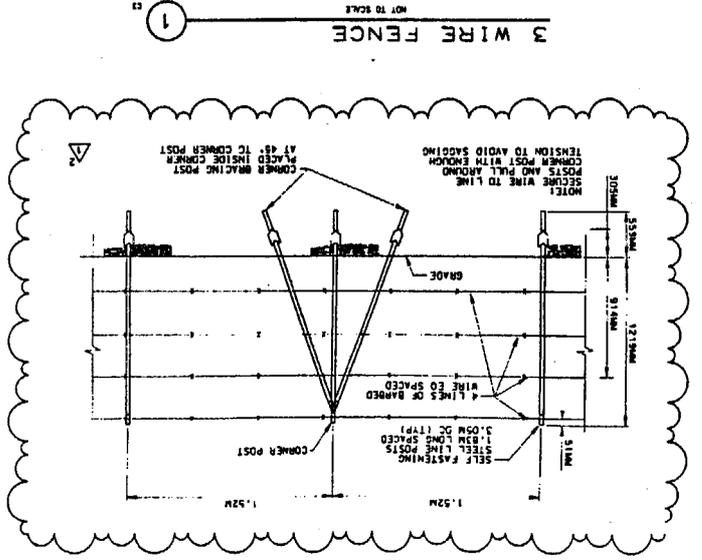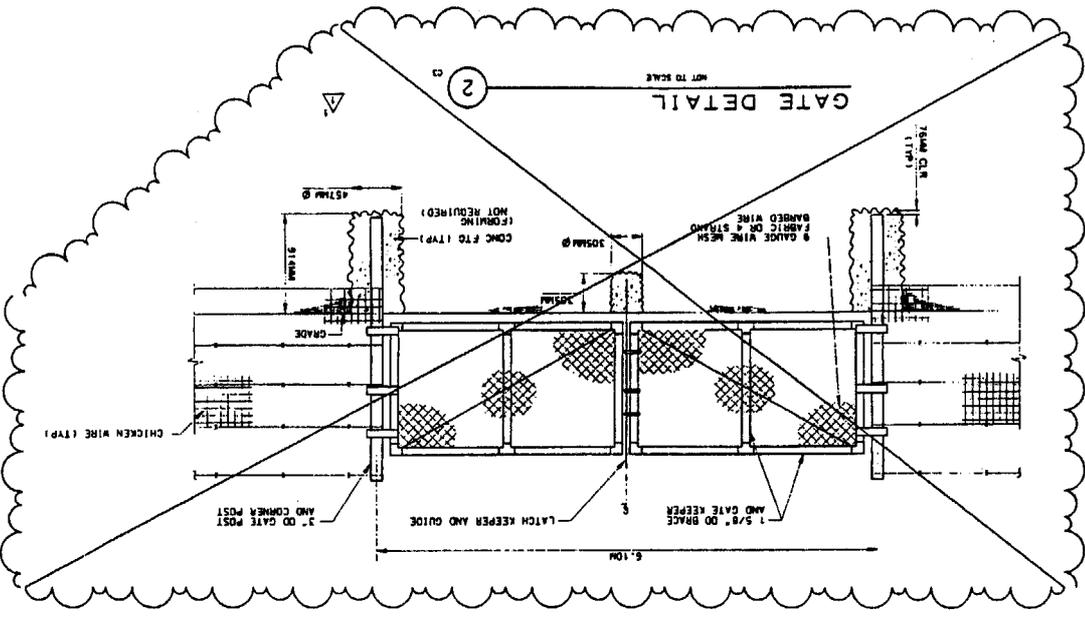

- SIGN NOTES**
1. THIS DETAIL APPLIES TO SIGNS ON FENCE ONLY.
 2. SIGN SHALL BE YELLOW WITH BLACK LETTERING AND RADIATION WARNING SYMBOL.
 3. MINIMUM LETTER/WORD HEIGHT SHALL BE CONTACT TEXT = 32MM WARNING TEXT = 19MM CONTACT TEXT = 19MM
 4. SIGN STOCK THICKNESS SHALL BE 16 GAGE/0.0635 ON ONE SIDE.
 5. SIGNS SHALL BE LOCATED CENTERED ON ALL SIDES OF FENCE AND GATE.
- FENCE NOTES**
1. FENCING SHALL MEET THE REQUIREMENTS OF SPECIFICATION SECTION 02831.
 2. ALL FENCING COMPONENT DIMENSIONS SHOWN ARE NOMINAL. SEE NOTE 1.


REFERENCES

111E SHEET
 00022-054-132-11
 00022-054-131-03
 00022-054-130-08
 DRAWING PLAN & SECTIONS
 CONSTRUCTION SPECIFICATION FOR CAU 407
 ROLLER COASTER RASAFE AREA, SECTION 02831
 SP-00022-054-10008-0

AS-BUILT

DATE	BY	REVISION
9/17/00	W. J. BACHT	AS-BUILT
9/11/00	W. J. BACHT	AS-BUILT

UNLESS NOTED BY HATCHED CHANGES, ALL DIMENSIONS, NOTES, REFERENCES AND CONSTRUCTION FEATURES ARE CORRECTED, AND WERE CONSTRUCTED AS SHOWN ON THIS DRAWING.

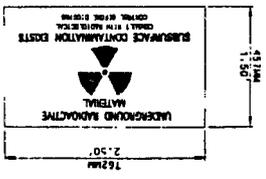

00022-054-133-01

Bechtel Nevada

U.S. DEPARTMENT OF ENERGY
 ROLLER COASTER RASAFE AREA

TONOPAH TEST RANGE
 CAU 407 REMEDIATION
 ROLLER COASTER RAD SAFE AREA

AREA 54

NO.	DATE	BY	REVISION
1	9/17/00	W. J. BACHT	AS-BUILT
2	9/11/00	W. J. BACHT	AS-BUILT


ORIGINAL, UNLESS STAMPED BY:

APPENDIX C

PROJECT PHOTOGRAPHS

THIS PAGE LEFT INTENTIONALLY BLANK

HOT SPOT REMOVAL

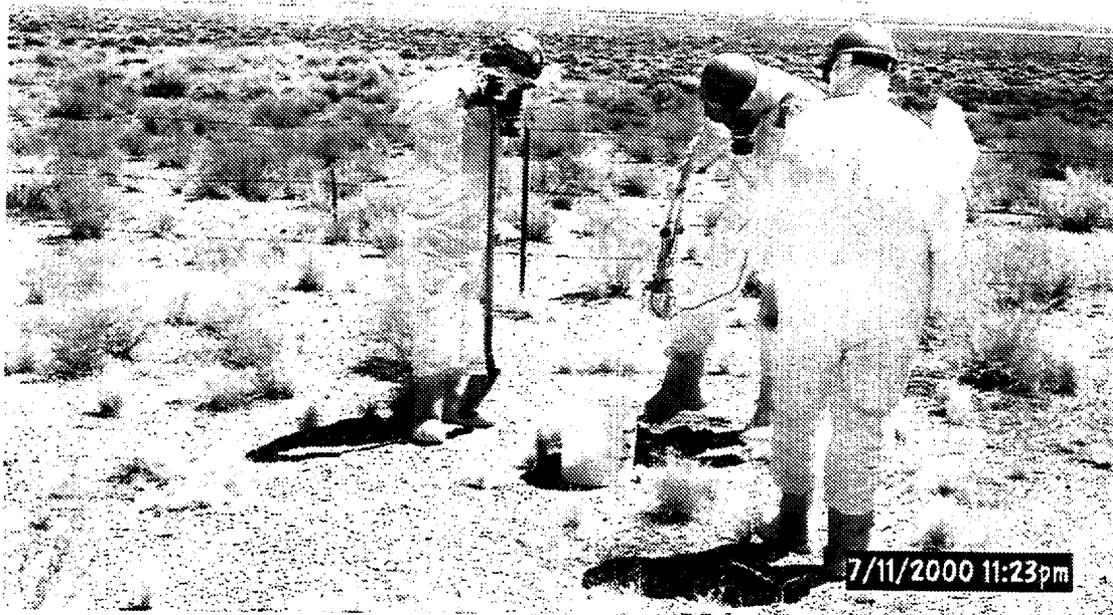

PLACING COVER FILL MATERIAL



CORRECTIVE ACTION ACTIVITIES

DISCING THE COVER SURFACE



DISPERSING SEED ON THE COVER




COVER REVEGETATION

PUTTING HAY ON THE COVER SURFACE



COVER AS IT APPEARED AFTER THE
HAY WAS CRIMPED INTO PLACE

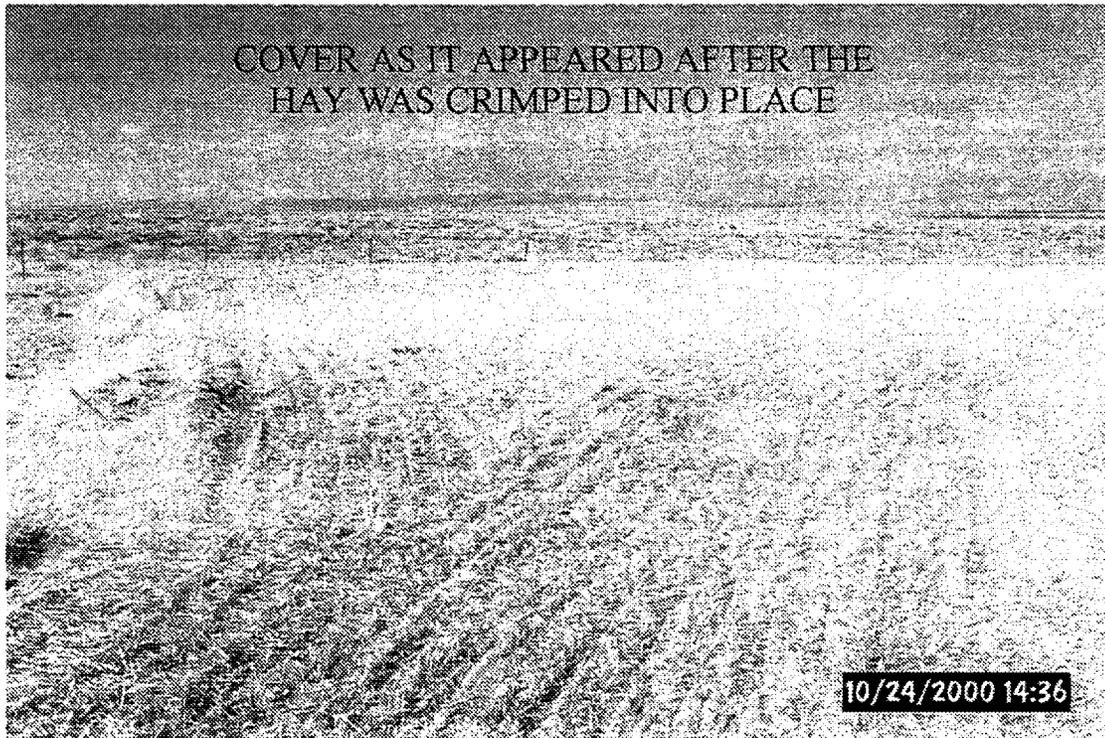

COVER REVEGETATION

APPENDIX D

CERTIFICATE OF DISPOSAL

THIS PAGE LEFT INTENTIONALLY BLANK

Certificate of Disposal

This is to certify that the, Waste Stream No., LRY5-LLFY00010 container number 194397 was shipped and received at the Nevada Test Site Radioactive Waste Management Site in Area 5 for disposal as stated below.

Stefan Duke

Bechtel Nevada Waste Control

Scientist


Shipped by

Organization

Title


Signature

4-18-01
Date


Received by

R W M S
Organization

tech
Title


Signature

4-18-2001
Date

THIS PAGE LEFT INTENTIONALLY BLANK

APPENDIX E

**STATISTICAL ANALYSIS OF CAU 407
CHARACTERIZATION DATA**

THIS PAGE LEFT INTENTIONALLY BLANK

Data Assessment

The following statistical parameters were calculated using the methods described in Gilbert (1987).

Summary statistics of the radioanalytical results for the 26 soil samples collected from the CAU 407 Waste Pit (Section 13.1, Gilbert, 1987).

Geometric mean concentration of the TR in the 26 soil samples (pCi/g) = 0.146

Geometric median concentration of the TR in the 26 soil samples (pCi/g) = 0.031

Geometric standard deviation of the TR concentration in the 26 soil samples (pCi/g) = 45.4

Geometric variance of the TR concentration in the 26 soil samples (pCi/g) = 2,057

Geometric relative standard deviation in the TR concentration in the 26 soil samples (pCi/g) = 26

- Sufficient samples were collected from the CAU 407 Waste Pit to ensure, with >99.5 percent confidence level, that the mean concentration of transuranic radionuclides in the CAU 407 Waste Pit is less than 0.1 percent of the transuranic waste land disposal limit of 100,000 pCi/g (Section 4.4.3, Table A2, Gilbert, 1987).
- As noted in Appendix E of the CAU 407 CADD, the maximum dose to the hypothetical future land user will not exceed the established dose limits.

Gilbert, R.O. 1987. *Statistical Methods for Environmental Pollution Monitoring*. New York, NY: Van Nostrand Reinhold.

THIS PAGE LEFT INTENTIONALLY BLANK

APPENDIX F

USE RESTRICTION FORM

THIS PAGE LEFT INTENTIONALLY BLANK

CAU Use Restriction Information

CAU Number/Description: CAU 407: Roller Coaster RADSAFE Area

Applicable CAS Numbers/Descriptions: CAS TA-23-001-TARC

Contact (organization/project): DOE/NV Industrial Sites Project Manager

Surveyed Area (UTM coordinates; Zone 11, NAD 27): Corners of perimeter fence

N 4,174,452.08m; E 523,716.57m.

N 4,174,448.41m; E 523,726.45m.

N 4,174,418.05m; E 523,733.32m.

N 4,174,418.96m; E 523,729.93m.

N 4,174,405.12m; E 523,689.67m.

N 4,174,410.38m; E 523,685.40m.

N 4,174,397.11m; E 523,650.12m.

N 4,174,417.83m; E 523,643.29m.

N 4,174,430.44m; E 523,677.75m.

N 4,174,437.29m; E 523,678.46m.

Survey Date: July 2000

Survey Method (GPS, etc.): Standard Survey Methods

Site Monitoring Requirements: Visual inspection as specified by the closure documentation

Required Frequency (quarterly, annually?): Quarterly the first six months, then biannually (once every six months) for two years. After two years the frequency will be determined by the NDEP based on previous inspection results.

If Monitoring Has Started, Indicate Last Completion Date: N/A

Use Restrictions


The future use of any land related to this Corrective Action Unit (CAU), as described by the above surveyed location, is restricted from any DOE or Air Force activity that may alter or modify the containment control as approved by the state and identified in the CAU Closure Report or other CAU documentation unless appropriate concurrence is obtained in advance.

Comments: Radiological contamination is present in the soil a minimum of approximately 3.0 meters (10 feet) below ground surface within the above surveyed location. Refer to the Closure Report more details and additional information on the condition of the site and any monitoring and/or inspection requirements.

Submitted By: _____

Date: _____

cc with copy of survey map:
CAU Files (2 copies)

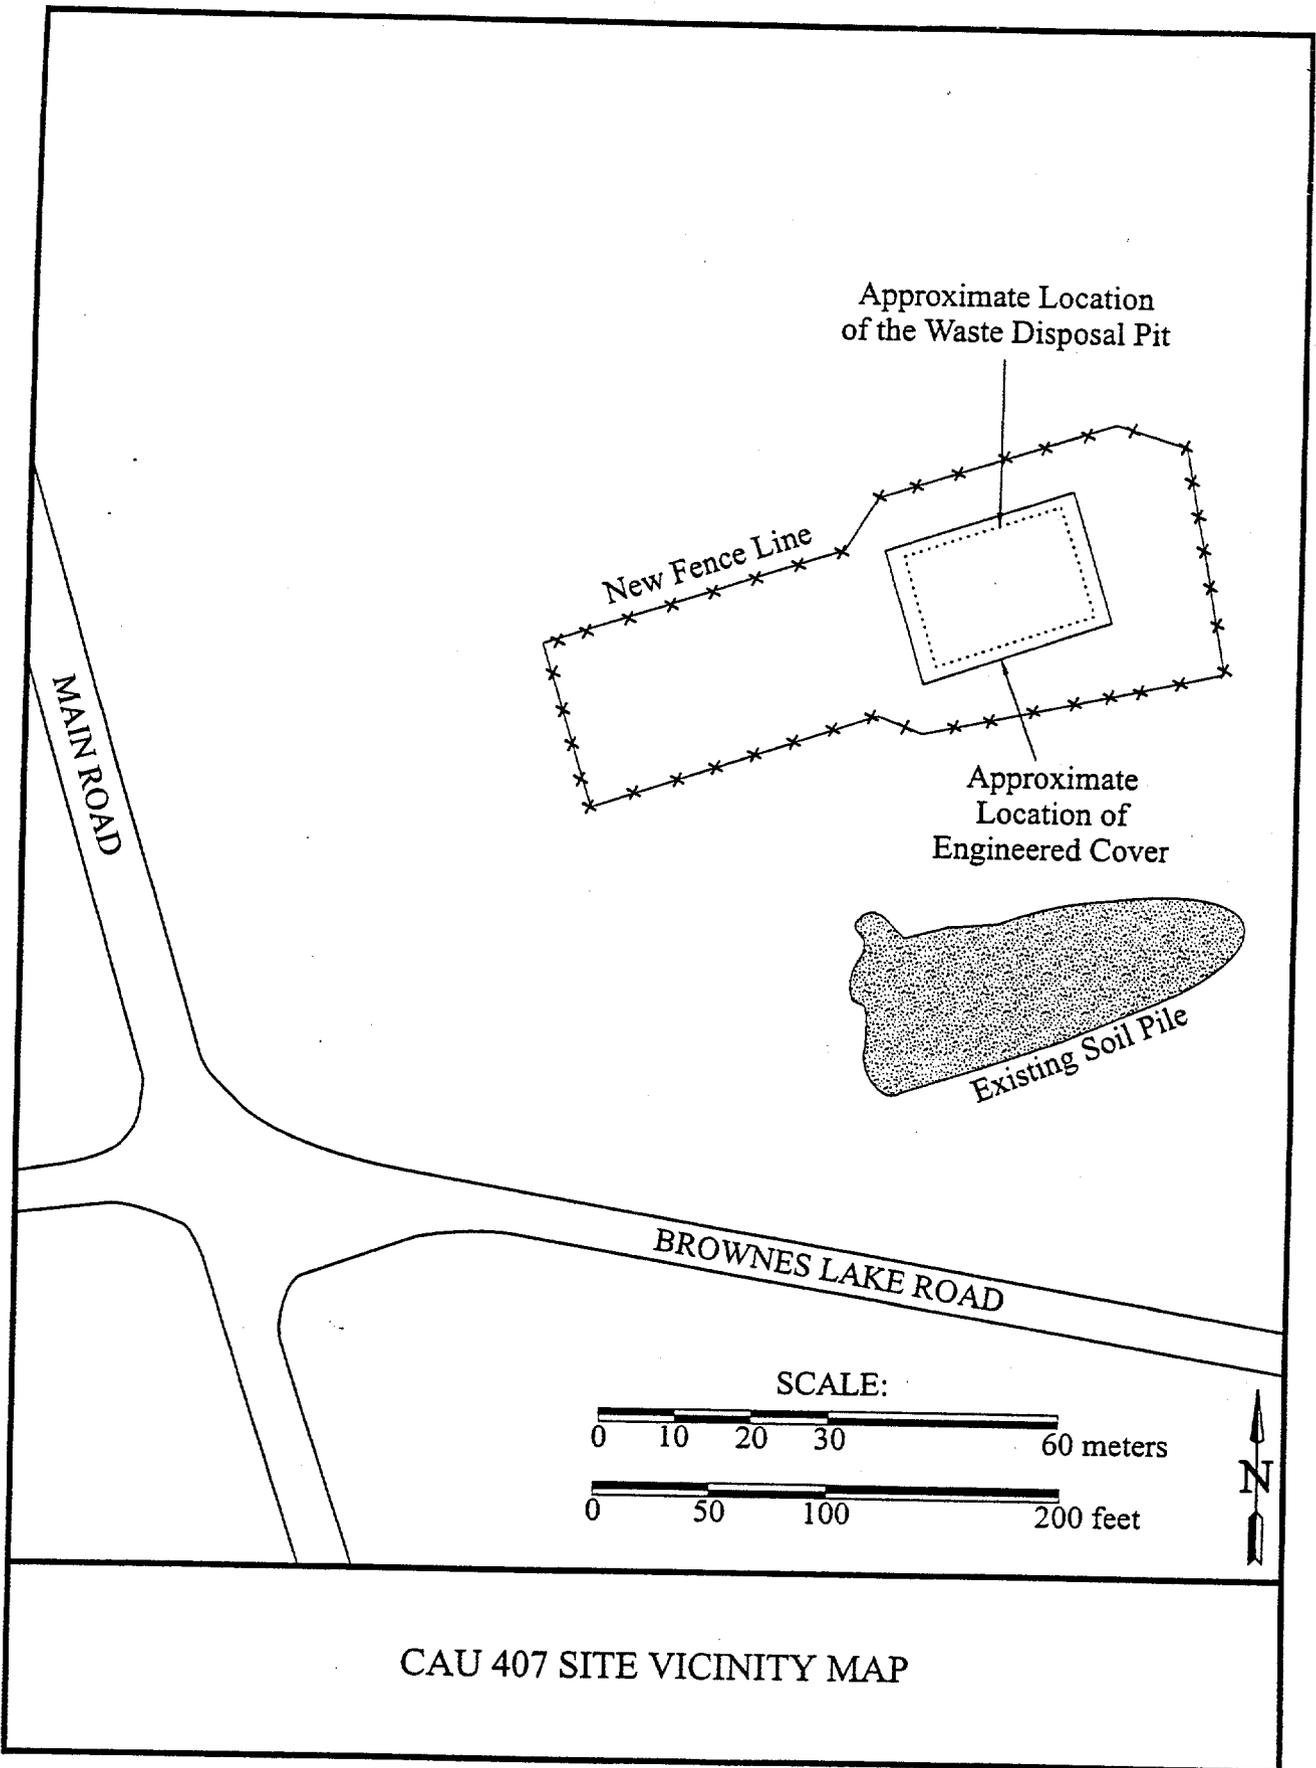

CAU 407 SITE VICINITY MAP



DEPARTMENT OF THE AIR FORCE

99TH CIVIL ENGINEER SQUADRON (ACC)

NELLIS AIR FORCE BASE, NEVADA 89191

Ms. Eloisa Hopper
Chief, Environmental Management Flight
4349 Duffer Dr., Suite 1601
Nellis AFB NV 89191-7007

23 Feb 01

Ms. Runore C. Wycoff
Director, Environmental Restoration Division
DOE Nevada Operations Office
P.O. Box 98518
Las Vegas NV 89193-8518

RECORDATION OF CORRECTIVE ACTION UNIT (CAU) 407

Nellis Air Force Base (Nellis) has recorded the U.S. Department of Energy's (DOE) Use Restriction Information for Corrective Action Unit (CAU) 407. The information was placed in the Geographic Information System at the Range Management Office, Nellis.

Please contact me at 652-4123 if you have any questions.

Sincerely


ELOISA HOPPER

Chief, Environmental Management Flight

cc:
NDEP
HQ AWFC RMO/RML
HQ AWFC/JAV

THIS PAGE LEFT INTENTIONALLY BLANK

APPENDIX G

CAU 407 INSPECTION CHECKLIST

THIS PAGE LEFT INTENTIONALLY BLANK

ROLLER COASTER RADSAFE AREA, POST-CLOSURE MONITORING CHECKLIST

Date of Last Inspection:

Reason for Last Inspection:

Responsible Agency:

Project Manager:

Inspection Date:

Inspector (name, title, organization):

Assistant Inspector (name, title, organization):

A. GENERAL INSTRUCTIONS

1. All checklist items must be completed and detailed comments made to document the results of the site inspection. The completed checklist is part of the field record of the inspection. Additional pages should be used as necessary to ensure that a complete record is made. Attach the additional pages and number all pages upon completion of the inspection.
3. Any checklist line item marked by an inspector in a SHADED BOX, must be fully explained or an appropriate reference to previous reports provided. The purpose of this requirement is to provide a written explanation of inspector observations and the inspector's rationale for conclusions and recommendations. Explanations are to be placed on additional attachments and cross-referenced appropriately. Explanations, in addition to narrative, will take the form of sketches, measurements, annotated site maps.
4. The site inspection is a walking inspection of the entire site including the perimeter and sufficient transects to be able to inspect the entire surface and all features specifically described in this checklist.
5. A standard set of color 35mm photographs (or equivalent) is required. In addition, all anomalous features or new features (such as changes in adjacent area land use) are to be photographed. A photo log entry will be made for each photograph taken.
6. This unit will be inspected biannually with formal reporting to the Nevada Division of Environmental Protection to be done annually. The annual report will include an executive summary, this inspection checklist with field notes and photo log attached, and recommendations and conclusions.

B. PREPARATION (To be completed prior to site visit)

YES

NO

EXPLANATION

1. Site as-built plans and site base map reviewed.

2. Previous inspection reports reviewed.

a. Were anomalies or trends detected on previous inspections?

b. Was maintenance performed?

3. Site maintenance and repair records reviewed.

a. Has site repair resulted in a change from as-built conditions?

b. Are revised as-builts available that reflect repair changes?

C. SITE INSPECTION (To be completed during inspection)

YES

NO

EXPLANATION

1. Adjacent off-site features within watershed areas.

a. Have there been any changes in use of adjacent area?

b. Are there any new roads or trails?

c. Has there been a change in the position of nearby washes?

d. Has there been lateral excursion or erosion/deposition of nearby washes?

e. Are there new drainage channels?

f. Change in surrounding vegetation?

2. Security fence, signs.

a. Displacement of fences, site markers, boundary markers, or monuments?

b. Have any signs been damaged or removed?
(Number of signs replaced: _____)

c. Were gates in working condition?

ROLLER COASTER RADS SAFE AREA, POST-CLOSURE MONITORING CHECKLIST

3. Waste Unit cover.

YES NO EXPLANATION

- a. Is there evidence of settling?
- b. Is there cracking?
- c. Is there evidence of erosion around the cap (wind or water)?
- d. Is there evidence of animal burrowing?
- e. Do natural processes threaten to integrity of any cover or site marker?
- f. Other?

YES	NO	EXPLANATION

4. Vegetative cover.

- a. Is perimeter fence or mesh fencing damaged?
- b. Is there evidence of horses or rabbits on site?
- c. Is organic mulch adequate to prevent erosion?
- d. Are weedy annual plants present? If yes, are they a problem?
- e. Are seeded plant species found on site?
- f. Is there evidence of plant mortality?

YES	NO	EXPLANATION

5. Photo Documentation

- a. Has a photo log been prepared?
- c. Number of photos exposed ()

YES	NO	EXPLANATION

D. FIELD CONCLUSIONS

- 1. Is there an imminent hazard to the integrity of the unit? (Immediate report required)

YES	NO	EXPLANATION

Person/Agency to whom report made:

- 2. Are more frequent inspections required?
- 3. Are existing maintenance/repair actions satisfactory?
- 4. Is other maintenance/repair necessary?
- 5. Is current status/condition of vegetative cover satisfactory?

YES	NO	EXPLANATION

6. Rationale for field conclusions:

E. CERTIFICATION

I have conducted an inspection of the Cactus Spring Waste Trenches, CAU 426, at the TTR in accordance with the Post-Closure Monitoring Plan (see Closure Report) as recorded on this checklist, attached sheets, field notes, photo logs, and photographs.

Chief Inspector's Signature:

Printed Name:

Title:

Date:

APPENDIX H

COMMENT RESPONSE DOCUMENTATION

THIS PAGE LEFT INTENTIONALLY BLANK

DOCUMENT REVIEW SHEET

<p>Document Title/Number: Draft Closure Report for Corrective Action Unit 407: Roller Coaster RADSAFE Area, Tonopah Test Range, Nevada</p> <p>Document Date: December 2000</p> <p>Revision Number: 0</p> <p>Originator/Organization: Nevada Division of Environmental Protection</p> <p>Date Comments Due: January 28, 2000</p> <p>Reviewer/Organization: Michail D. McKinnon / NDEP</p>				
Comment Number/ Location	Type	Comment	Comment Response	Accept
1. Appendix C	M	In Appendix C (Waste Manifests), the BN Hazardous Material Shipping Order lists the weight of the disposed soil as 68 pounds. The Straight Bill of Lading lists the weight as 568 pounds. These two weights should agree.	The Hazardous Material Shipping Order should have listed the weight of the disposed soil as 568 pounds. The Straight Bill of Lading is correct. The Hazardous Material Shipping Order has been corrected in the file.	Yes

THIS PAGE LEFT INTENTIONALLY BLANK

Document Title/Number: Closure Report for Corrective Action Unit 407: Roller Coaster RADSAFE Area, Tonopah Test Range,
Nevada

Document Date: April, 2000

Revision Number: 0

Originator/Organization: Nevada Division of Environmental Protection

Date Comments Due: May, 2000

Reviewer/Organization: Michael D. McKinnon / NDEP

Comment Number/ Location	Type	Comment	Comment Response	Accept
1. General	M	<p>There are discrepancies between the Preliminary Action Level (PAL) for radioactivity specified in the CAIP, the CADD, and the CR. The CAIP originally specified, "...two time the established daily background...", but was changed to, "...the average activity of 20 background surface samples plus two times the standard deviation of the average activity...."(Record of Technical Change, 8/17/98). The CADD indicates, "...Contaminated surface soil greater than 2 to 3 times background...will be excavated to a depth of 6 in....". The CR documents removal of soil which exceeds 3 times background. DOE/NV needs to reconcile the discrepancies in the radioactivity PAL among these documents.</p>	<p>A section was added (2.2.1 Soil Removal Criteria) which explains the different screening criteria during the different phases of this project.</p>	Yes

Comment Number/ Location	Type	Comment	Comment Response	Accept
2. Section 2.1.1	M	Removal of Subsurface Impacted Soils, refers to radioactivity background of 3,500 counts per minute (CPM) as established by the FIDLER. The twenty individual FIDLER readings of radiation background as well as the average and standard deviation of the average should also be indicated. This will enable a comparison of the original PAL for radiation with the activity remaining at the surface (prior to capping).	See above response. Additional detail was provided in Section 2.2.2 and Section 4.0 explaining how background was established prior to "hot spot" removal.	Yes
3. General	M	At the FFACO Quarterly meeting held on 2/7/01, NDEP expressed concern that transuranic (TRU) waste might still be located in the waste pit of CAU 407. Since TRU waste which is below the surface will not be detected by a surface FIDLER survey, DOE/NV has not demonstrated in this closure report that all TRU waste has been removed from CAU 407. This issue was not addressed in previous reviews because DOE/NV did not identify TRU waste at this site until after the draft CR had been approved.	A section was added (4.1 Remaining Transuranic Waste at CAU 407) to assess the probability that transuranic waste still may be present within the waste pit. Also section 2.1 (Description of Prior Closure Activities) was added. These activities were not discussed in the previous report.	Yes

THIS PAGE LEFT INTENTIONALLY BLANK

DISTRIBUTION LIST

THIS PAGE LEFT INTENTIONALLY BLANK

DISTRIBUTION LIST

*Provide copy of initial distribution or Revision 0; remainder of list gets Revision 0 if approved without changes. The entire list receives Revision 1, if issued.

Nevada Division of Environmental Protection

Paul Liebendorfer 2(Controlled)*
Bureau of Federal Facilities
Division of Environmental Protection
333 W. Nye Lane, Room 13B
Carson City, NV 89706-0866

Mike McKinnon 1(Controlled)*
Bureau of Federal Facilities
Division of Environmental Protection
Sawyer State Building
555 E. Washington, Suite 4300
Las Vegas, NV 89101-1049

U.S. Department of Energy

Janet Appenzeller-Wing 1(Uncontrolled)*
Environmental Restoration Division
U.S. Department of Energy, Nevada Operations Office
P.O. Box 98518 M/S 505
Las Vegas, NV 89193-8518

Kevin Cabble 1(Uncontrolled)*
Environmental Restoration Division
U.S. Department of Energy, Nevada Operations Office
P.O. Box 98518 M/S 505
Las Vegas, NV 89193-8518

Sabrina Lawrence 1(Controlled)*
Environmental Restoration Division
U.S. Department of Energy, Nevada Operations Office
P.O. Box 98518 M/S 505
Las Vegas, NV 89193-8518

DISTRIBUTION LIST (Continued)

U.S. Department of Energy (continued)

U.S. Department of Energy
Office of Scientific and Technical Information
P.O. Box 62
Oak Ridge, TN 37831-0062

1(Uncontrolled,
electronic copy)

U.S. Department of Energy
Nevada Operations Office
Technical Information Resource Center
P.O. Box 98518, M/S 505
Las Vegas, NV 89193-8521

1(Uncontrolled)

Manager, Southern Nevada
FFACO Public Reading Room
P.O. Box 98521 M/S NLV040
Las Vegas, NV 89193-8521

1(Controlled) &
1(Uncontrolled)

Manager, Northern Nevada
FFACO Public Reading Room
Nevada State Library and Archives Federal Publications
100 North Stewart Street
Carson City, NV 89701-4285

1(Uncontrolled)

Bechtel Nevada

Correspondence Control
Bechtel Nevada
P.O. Box 98521 M/S NLV008
Las Vegas, NV 89193-8521

1(Uncontrolled)*

Environmental Management Library
Bechtel Nevada
P.O. Box 98521, M/S NLV080
Las Vegas, NV 89193-8521

1(Uncontrolled)*

DISTRIBUTION LIST (Continued)

Bechtel Nevada (continued)

Ann Heidema
Bechtel Nevada
P.O. Box 98521 M/S NLV022
Las Vegas, NV 89193-8521

1(Uncontrolled)*

Thomas Fitzmaurice
Bechtel Nevada
P.O. Box 98521 M/S NTS306
Las Vegas, NV 89193-8521

1(Uncontrolled)*

Wayne Johnson
Bechtel Nevada
P.O. Box 98521 M/S NTS306
Las Vegas, NV 89193-8521

1(Uncontrolled)*

Steve Nacht
Bechtel Nevada
P.O. Box 98521 M/S NTS306
Las Vegas, NV 89193-8521

1 (Uncontrolled)*

IT Corporation

Lynn Kidman
IT Corporation
P.O. Box 93838
Las Vegas, NV 89193-8521

1 (Uncontrolled)*

Jeff Johnson
IT Corporation
P.O. Box 93838
Las Vegas, NV 89193-8521

1 (Uncontrolled)*

DISTRIBUTION LIST (Continued)

IT FFACO Support Office
IT Corporation
P.O. Box 93838
Las Vegas, NV 89193-8521

1 (Uncontrolled)*

U.S. Air Force

U.S. Air Force DOE Liason Office
DOE/Nevada Operations Office
P.O. Box 98518, M/S 505
Las Vegas, NV 89193-8518

1 (Uncontrolled)*

Eloisa V. Hopper
U.S. Air Force
99 ABW/EM
4349 Duffer Dr., Suite 1601
Nellis AFB, NV 89191-7007

3(Controlled)*

Major Roger Schofield
U.S. Air Force
AWFC RMO/RML99
3770 Duffer Dr.
Nellis AFB, NV 89191-7007

1 (Uncontrolled)*

**FEDERAL FACILITY AGREEMENT AND CONSENT ORDER (FFACO)
RECORD OF TECHNICAL CHANGE (ROTC)**

Corrective Action Unit (CAU) Number: 407

CAU Description: Roller Coaster RadSafe Area (TTR)

CAU Owner: Industrial Sites - Environmental Restoration (ER)

ROTC No. DOE/NV--694-rev 1-ROTC 1 **Page** 1 of 10

Document Type Closure Report (CR) **Date** 11/19/2019

The following technical changes (including justification) are requested by:

Tiffany Gamero
Requestor Name

Long-Term Monitoring Activity Lead
Requestor Title

Description of Change:

1. This ROTC replaces the Use Restriction (UR) information listed in the documentation for CAU 407.

UR forms have been updated to list all UR requirements, including but not limited to: post-closure site controls (signs, fencing, etc.), inspection and maintenance requirements, and Geographic Information Systems (GIS) coordinate information. The UR requirements and form(s) included in this ROTC represent the current corrective action requirements for each Corrective Action Site (CAS) in this CAU and supersede information concerning corrective action and post-closure requirements in existing documentation.
2. UR boundary coordinate values changed due to conversion from North American Datum (NAD) 1927 to NAD 1983 for CAS TA-23-001-TARC.

Justification:

1. Some changes in the UR requirements from those found in closure documents have been subsequently modified in letters, memos, and inspection reports. This has resulted in difficulty in determining current post-closure requirements. A review of the post-closure requirements for this CAU has been conducted to ensure that all requirements have been identified and documented on the new UR form. The new UR form was developed to be inclusive of all requirements for long-term monitoring and standardize information contained in the URs consistent with current protocols.
2. UR boundary coordinates need to be in one standardized coordinate system.

**FEDERAL FACILITY AGREEMENT AND CONSENT ORDER (FFACO)
RECORD OF TECHNICAL CHANGE (ROTC)**

Corrective Action Unit (CAU) Number: 407

CAU Description: Roller Coaster RadSafe Area (TTR)

CAU Owner: Industrial Sites - Environmental Restoration (ER)

ROTC No. DOE/NV--694-rev 1-ROTC 1 **Page** 2 **of** 10

Document Type Closure Report (CR) **Date** 11/19/2019

Description of Change:

3. Removed the 7th coordinate pair listed in the original UR coordinate list.

4. Remove vegetation monitoring from the UR requirements.

Justification:

3. This coordinate pair caused a small inadvertent deflection in the boundary that is only notable when viewed at a larger scale. Removal of this coordinate pair more accurately depicts the original intended boundary.
4. In letter from C.D. Andres (Nevada Division of Environmental Protection [NDEP]) to B.R. Wilborn (EM Nevada Program) dated June 25, 2019, it was agreed that the UR requirement of vegetation monitoring could be removed as the current requirement for visual inspections of the soil cover would suffice to protect site workers from exposure to buried waste.

Schedule Impacts:

No impacts to schedule.

ROTC applies to the following document(s):

- U.S. Department of Energy, Nevada Operations Office. 2001. Closure Report for Corrective Action Unit 407: Roller Coaster RADSAFE Area, Tonopah Test Range, Nevada, Rev. 1, DOE/NV--694-rev 1. Las Vegas, NV.

**FEDERAL FACILITY AGREEMENT AND CONSENT ORDER (FFACO)
RECORD OF TECHNICAL CHANGE (ROTC)**

Corrective Action Unit (CAU) Number: 407

CAU Description: Roller Coaster RadSafe Area (TTR)

CAU Owner: Industrial Sites - Environmental Restoration (ER)

ROTC No. DOE/NV--694-rev 1-ROTC 1 **Page** 3 **of** 10

Document Type Closure Report (CR) **Date** 11/19/2019

Approvals:




Date 12/5/2019

Tiffany Gamero

Activity Lead

Environmental Management (EM) Nevada Program




Date 12/9/19

Bill Wilborn

Deputy Program Manager, Operations

Environmental Management (EM) Nevada Program



Date 12/18/19

FOR Christine Andres

Chief, Bureau of Federal Facilities

Nevada Division of Environmental Protection (NDEP)

U.S. Department of Energy, Environmental Management Nevada Program Use Restriction Information

General Information

Use Restriction (UR) Type(s):	FFACO Only
Corrective Action Unit (CAU) Number & Description:	407 - Roller Coaster RadSafe Area (TTR)
Corrective Action Site (CAS) Number & Description:	TA-23-001-TARC - Roller Coaster RadSafe Area
CAU/CAS Owner:	Industrial Sites - ER
Note:	N/A

Section I. Federal Facility Agreement and Consent Order (FFACO) UR

Basis for FFACO UR

Summary Statement: This FFACO UR is established to protect workers from inadvertent exposure to radiological and chemical contaminants that were released at this site. Radiological and chemical contaminants are assumed to be present that exceed action levels.

FFACO UR Physical Description

Surveyed Area (UTM, Zone 11, NAD 83, meters):

UR Boundary	UR Point ¹	Easting ²	Northing ²
FFACO Boundary	1	523,571	4,174,596
	2	523,564	4,174,616
	3	523,598	4,174,628
	4	523,599	4,174,635
	5	523,637	4,174,650
	6	523,647	4,174,646
	7	523,654	4,174,616
	8	523,610	4,174,603
	9	523,606	4,174,608
	10	523,571	4,174,596

¹UR Points are listed clockwise beginning at the southernmost point. If multiple points share the southernmost Northing coordinate, the easternmost point is listed as Point 1.

²UR coordinate values presented herein were transformed from the North American Datum of 1927, and rounded to the nearest meter; resultant coordinates may not reflect the original precision of values contained within the source GIS data set.

U.S. Department of Energy, Environmental Management Nevada Program Use Restriction Information

Boundary Applies to: Subsurface

Starting Depth: 50 **Ending Depth:** _____

Depth Unit: Centimeters

Survey Source: GPS

FFACO UR Requirements

Site Controls:

This FFACO UR is recorded as described in **Section IV. Recordation Requirements** to restrict activities within the area by the coordinates listed above and depicted in the attached figure without prior notification of NDEP unless the activities are conducted under the provisions of 10 CFR, Part 835, Occupational Radiation Protection and 10 CFR, Part 851, Worker Safety and Health Program.

Control	Criteria
Fence	Present and provides barrier.
Signage	Present and legible.
Soil Cover	Must completely cover waste material.

Inspection Frequency: Annual

Additional Considerations:

Consideration	Criteria
None	None

Requirements Comments: Surface is uncontaminated. Ending depth is unknown.

Section II. Administrative UR

An Administrative UR is not identified for this site.

U.S. Department of Energy, Environmental Management Nevada Program Use Restriction Information

Section III. Supporting Documentation

UR Source Document(s)

ROTC 1 for CAU 407 CR (DOE/NV--694-rev 1), dated 11/19/2019.

Andres, C.D., Nevada Division of Environmental Protection, Bureau of Federal Facilities. 2019. Letter to B.R. Wilborn (EM Nevada Program) titled Request to Implement Changes to the Use Restriction Language for Corrective Action Unit (CAU) 407: Roller Coaster Radsafe Area, Tonopah Test Range, 25 June. Las Vegas, NV.

MacDougall, J., Nevada Division of Environmental Protection, Bureau of Federal Facilities. 2014. Letter to R.F. Boehlecke (NNSA/NFO) titled Acceptance of the Post Closure Inspection Report for 2013, Tonopah Test Range, Nevada, Federal Facility Agreement and Consent Order, 20 March. Las Vegas, NV.

Murphy, T.H., Nevada Division of Environmental Protection, Bureau of Federal Facilities. 2006. Letter to J.B. Jones (NNSA/NSO) titled NNSA/NSO Request to Reduce the Frequency of Post-Closure Monitoring of Corrective Action Units (CAU) 400, 404, 407, 423, 424, 426, 427, 453, and 487 at Tonopah Test Range (TTR), Nevada, 5 December. Las Vegas, NV.

U.S. Department of Energy, Nevada Operations Office. 2001. Closure Report for Corrective Action Unit 407: Roller Coaster RADSAFE Area, Tonopah Test Range, Nevada, Rev. 1, DOE/NV--694-rev 1. Las Vegas, NV.

Attachments

- FFACO UR Boundary Map (UTM, Zone 11, NAD 83 meters)
- Supplemental Information Figure (UTM, Zone 11, NAD 83 meters)

Section IV. Recordation Requirements

Recordation:

The above UR(s) are recorded in the:

- FFACO Database
- NNSA M&O Contractor GIS
- USAF (Nellis Air Force Base Range Operations) GIS
- EM Nevada Program CAU/CAS Files

U.S. Department of Energy, Environmental Management Nevada Program Use Restriction Information

Section V. EM Nevada Program Approval



Tiffany Gamero

Activity Lead

EM Nevada Program

Date:

12/5/2019

523,500


523,575

523,650

4,174,675

4,174,600

4,174,525

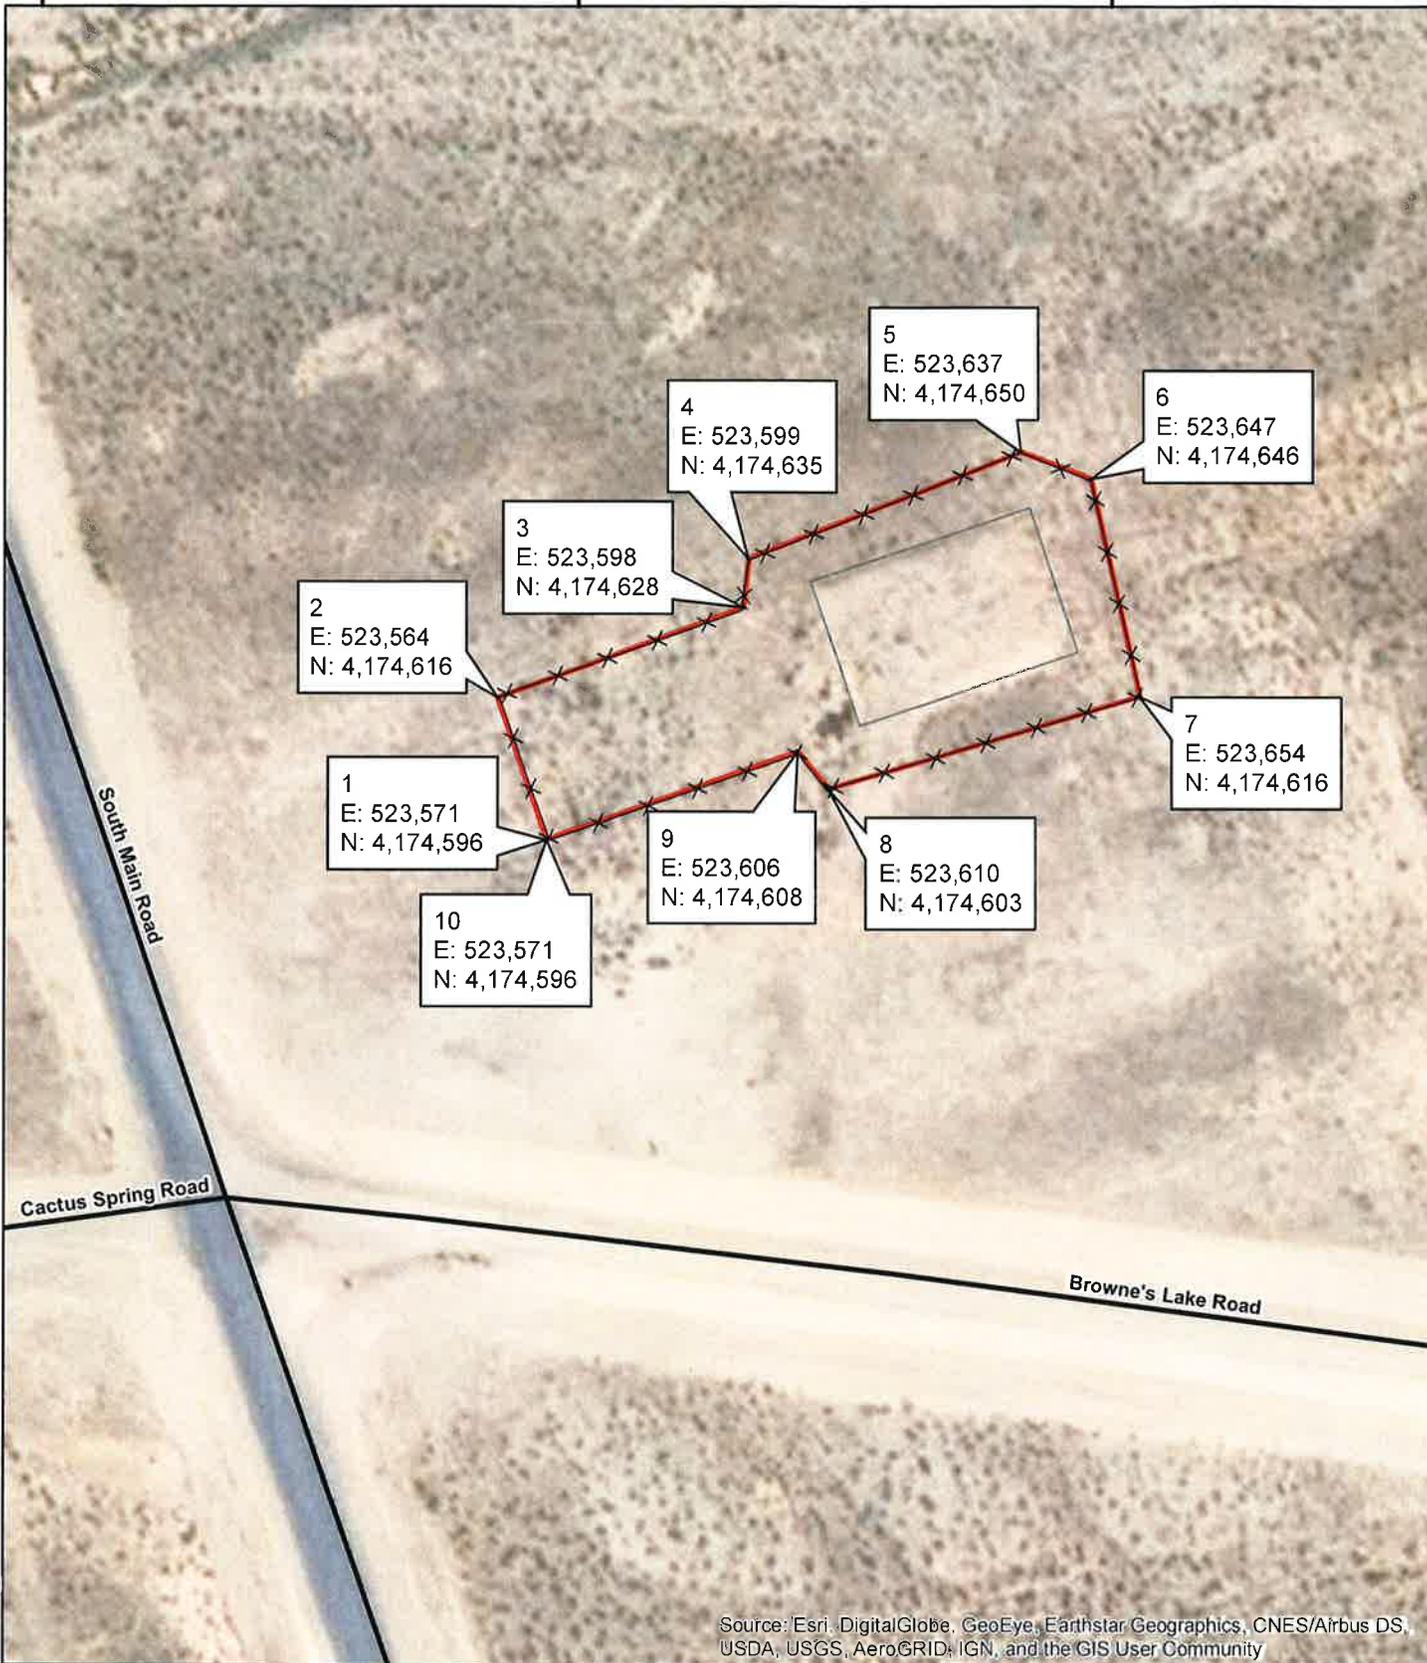

Source: Esri, DigitalGlobe, GeoEye, Earthstar Geographics, CNES/Airbus DS, USDA, USGS, AeroGRID, IGN, and the GIS User Community


H:\407\GPS\CASTA-23-001-TARC_FFAO\UR.mxd - 7/24/2019



Source: Navarro GIS, 2019

Explanation

- FFAO UR
- Approximate Location of Soil Cover
- Paved Road



Coordinate System: NAD 1983 UTM Zone 11N, Meter

**CAU 407, CAS TA-23-001-TARC
Roller Coaster RadSafe Area
FFAO UR Boundary**

Supplemental Information Figure

The attached supplemental information figure(s) are included to capture site feature information that was available in previous iterations of this Use Restriction (UR) to prevent loss of that information.

523,500

523,575

523,650

4,174,675

4,174,600

4,174,525



Explanation

-  FFACO UR
-  Fence Line
-  Approximate Location of Soil Cover
-  Existing Soil Pile
-  Paved Road


Source: Esri, DigitalGlobe, GeoEye, Earthstar Geographics, CNES/Airbus DS, USDA, USGS, AeroGRID, IGN, and the GIS User Community

H:\407\GPS\CASTA-23-001-TARC_SUPP.mxd - 8/1/2019



Source: Navarro GIS, 2019

**CAU 407, CAS TA-23-001-TARC
Roller Coaster RadSafe Area
Supplemental Information
General Location of Site Features**



NOTE: Size and location of features are approximated
Coordinate System: NAD 1983 UTM Zone 11N, Meter